



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**108395-1185**  
Component  
**Rear Right Wheel Hub**  
Fluid  
**GEAR OIL SAE 80W90 (--- GAL)**

### RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH</b>	LH	LH0242899
Sample Date		Client Info		<b>22 May 2024</b>	20 Jun 2023	21 Dec 2022
Machine Age	hrs	Client Info		<b>6899</b>	5938	5183
Oil Age	hrs	Client Info		<b>2000</b>	2000	0
Filter Age	hrs	Client Info		<b>2000</b>	2000	0
Oil Changed		Client Info		<b>N/A</b>	N/A	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	ATTENTION	NORMAL

### WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>650	<b>11</b>	● 325	11
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	2	0
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	2	0
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	0	<1
Copper	ppm	ASTM D5185(m)	>60	<b>&lt;1</b>	7	1
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	VLITE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>75	<b>0</b>	7	1
Potassium	ppm	ASTM D5185(m)	>20	<b>1</b>	2	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)	>170	<b>4</b>	18	5
Boron	ppm	ASTM D5185(m)	400	<b>&lt;1</b>	9	4
Barium	ppm	ASTM D5185(m)	200	<b>&lt;1</b>	3	0
Molybdenum	ppm	ASTM D5185(m)	12	<b>0</b>	<1	0
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	3	<1
Magnesium	ppm	ASTM D5185(m)	12	<b>&lt;1</b>	8	<1
Calcium	ppm	ASTM D5185(m)	150	<b>7</b>	134	30
Phosphorus	ppm	ASTM D5185(m)	1650	<b>2201</b>	2200	2371
Zinc	ppm	ASTM D5185(m)	125	<b>9</b>	76	12
Sulfur	ppm	ASTM D5185(m)	22500	<b>24472</b>	27543	36385
Visc @ 40°C	cSt	ASTM D7279(m)	143	<b>188</b>	159	179

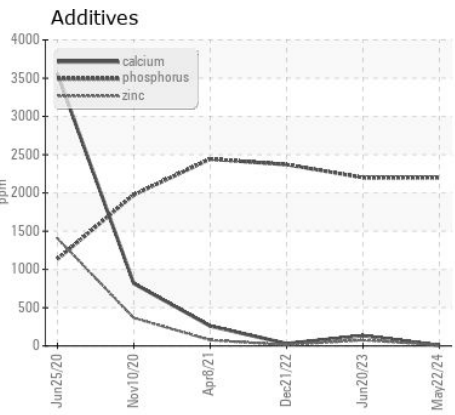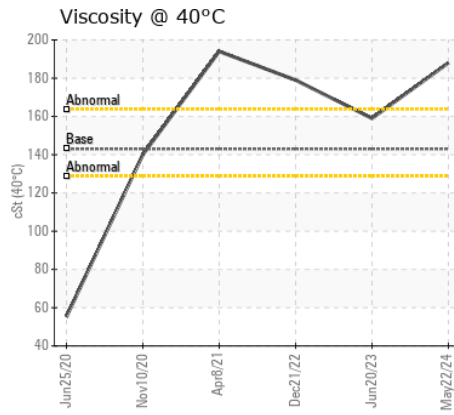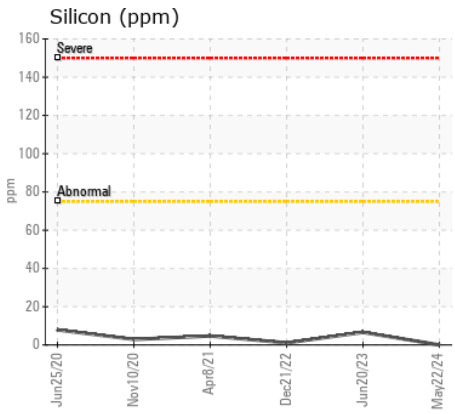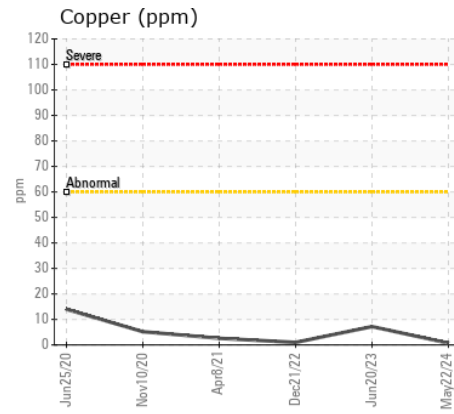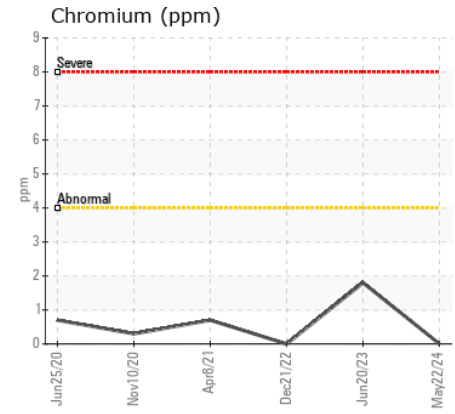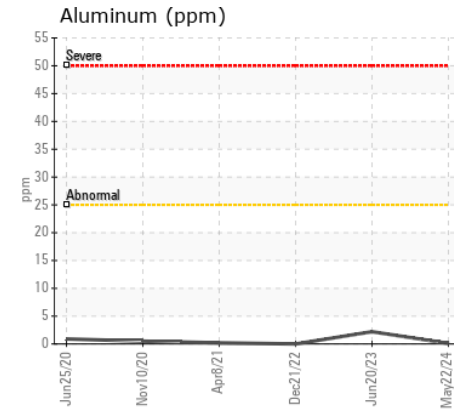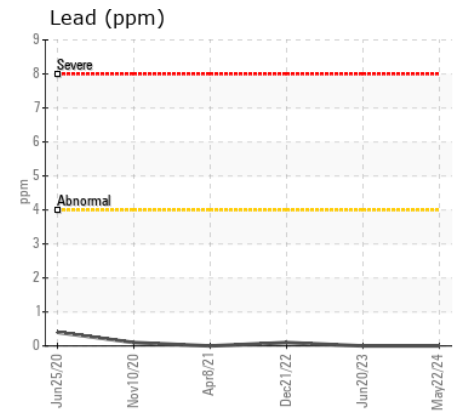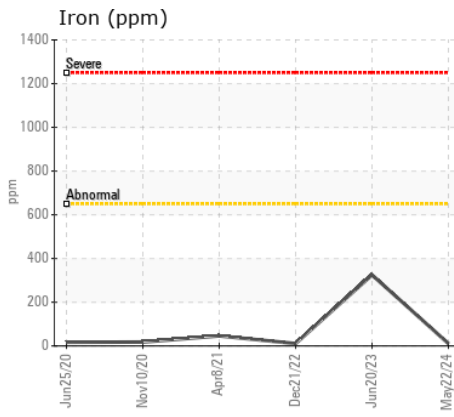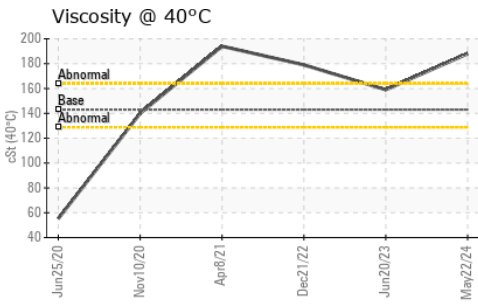

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH  
**Lab Number** : 02641276  
**Unique Number** : 5798815  
**Test Package** : MOB 1  
**Received** : 11 Jun 2024  
**Tested** : 12 Jun 2024  
**Diagnosed** : 12 Jun 2024 - Wes Davis

**GFL Environmental - 756 - Quebec Lavoisier MRF**  
 2244 rue Lavoisier  
 Quebec, QC  
 CA G1N 4H2  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T:  
F: