



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**059596-194**  
Component  
**Rear Right Wheel Hub**  
Fluid  
**PETRO CANADA TRAXON 75W90 SYNTHETIC (3 GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0289609</b>	LH0278952	LH0274780
Sample Date		Client Info		<b>09 Jun 2024</b>	07 Feb 2024	23 Nov 2023
Machine Age	hrs	Client Info		<b>19988</b>	19498	19244
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>1</b>	5	2
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	0
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	0	<1
Copper	ppm	ASTM D5185(m)	>60	<b>8</b>	<1	14
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>&lt;1</b>	2	3
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Boron	ppm	ASTM D5185(m)	328	<b>314</b>	297	297
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	1	<b>1</b>	1	<1
Calcium	ppm	ASTM D5185(m)	7	<b>15</b>	13	6
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1201</b>	1247	1243
Zinc	ppm	ASTM D5185(m)	3	<b>13</b>	9	15
Sulfur	ppm	ASTM D5185(m)	17909	<b>20136</b>	20906	20528
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>105</b>	104	106

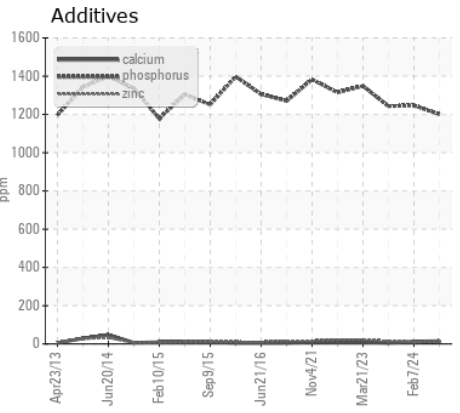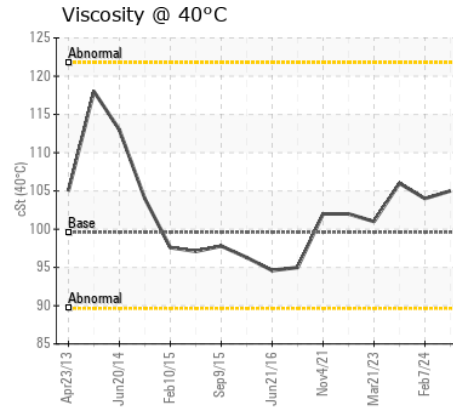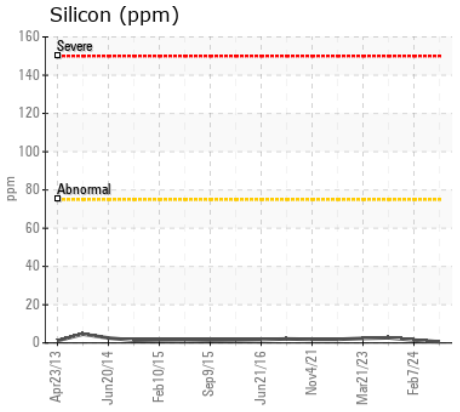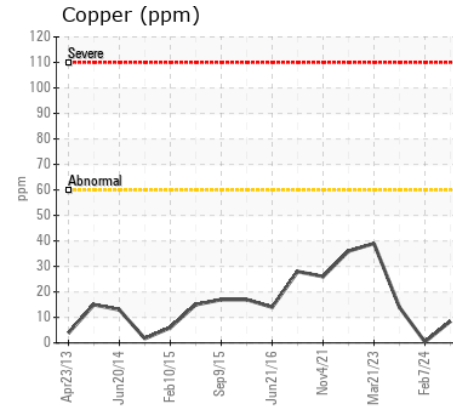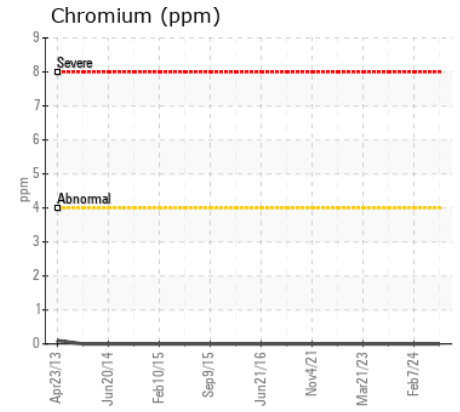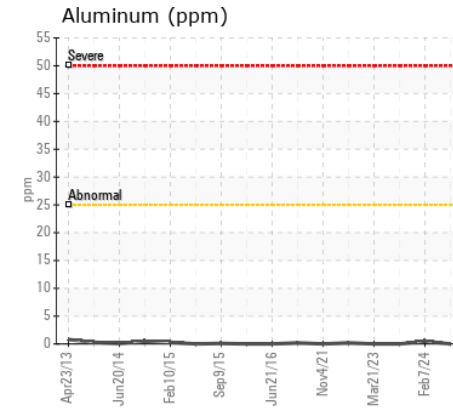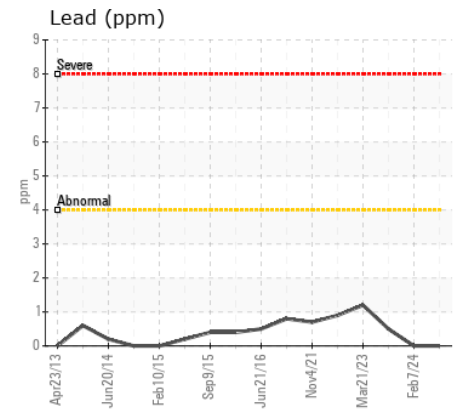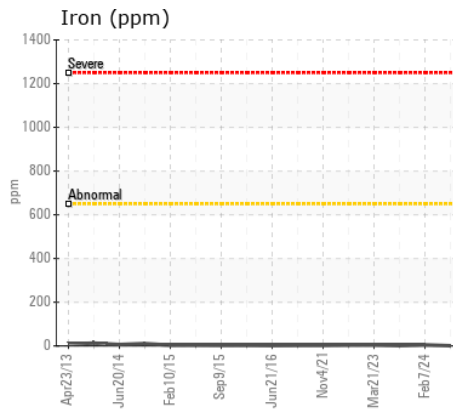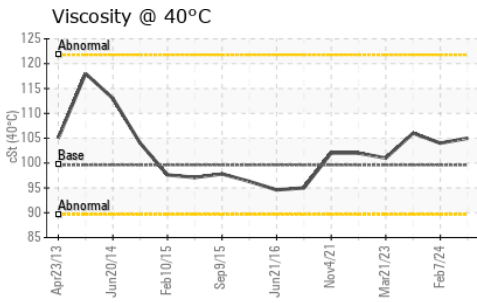

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0289609 **Received** : 12 Jun 2024  
**Lab Number** : 02641494 **Tested** : 12 Jun 2024  
**Unique Number** : 5799033 **Diagnosed** : 12 Jun 2024 - Wes Davis  
**Test Package** : MOB 1

**American Iron and Metal**  
 2555 Sheffield Road  
 Ottawa, ON  
 CA K1B 3V6  
 Contact: Dan Dupelle  
 ddupelle@aim-rg.com  
 T: (613)228-9380  
 F: (613)745-0692

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.