



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR LH22M 110435-1250

Component
Rear Right Wheel Hub

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (3 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0288120	LH0283994	LH0260474
Sample Date		Client Info		30 May 2024	31 Jan 2024	14 Aug 2023
Machine Age	hrs	Client Info		13142	12137	11129
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		None	None	None
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>450	5	4	6
Chromium	ppm	ASTM D5185(m)	>4	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>15	0	<1	<1
Lead	ppm	ASTM D5185(m)	>4	0	0	0
Copper	ppm	ASTM D5185(m)	>75	<1	<1	<1
Tin	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>60	0	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	0	1	<1
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<1	<1	1
Boron	ppm	ASTM D5185(m)	328	317	298	303
Barium	ppm	ASTM D5185(m)	1	0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	1	<1	<1	2
Calcium	ppm	ASTM D5185(m)	7	5	5	17
Phosphorus	ppm	ASTM D5185(m)	1145	1219	1221	1295
Zinc	ppm	ASTM D5185(m)	3	8	8	13
Sulfur	ppm	ASTM D5185(m)	17909	20215	20687	21093
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	105	106	104

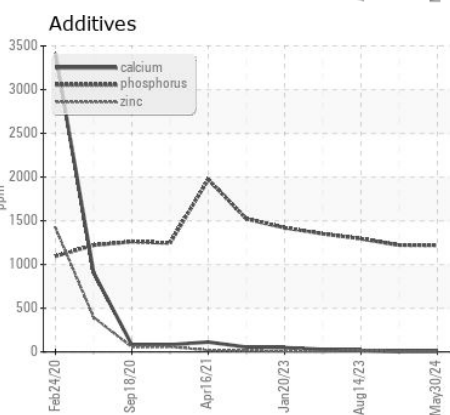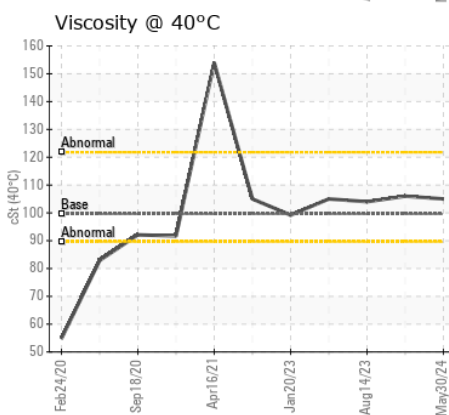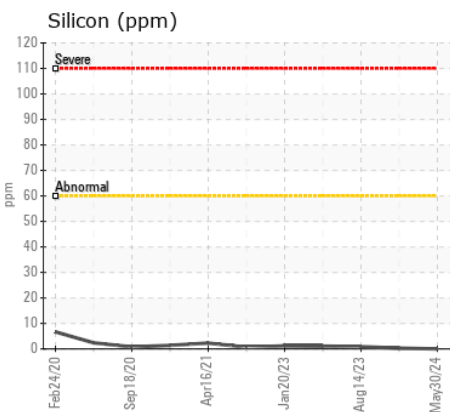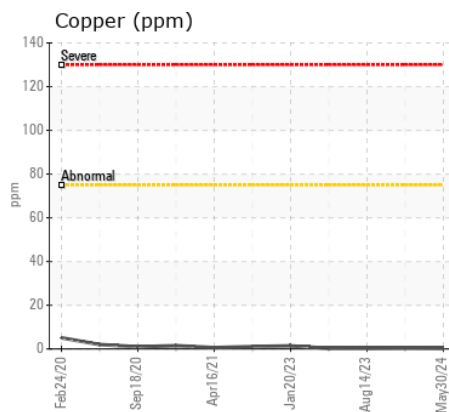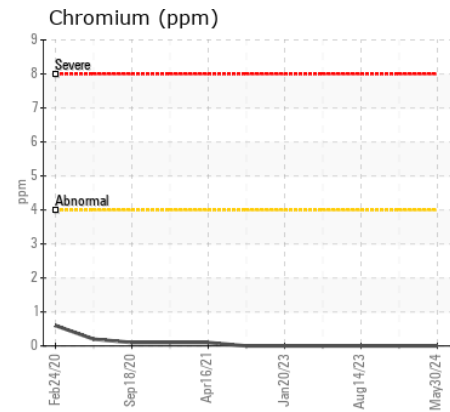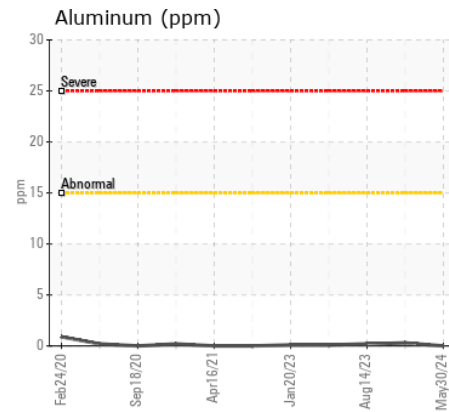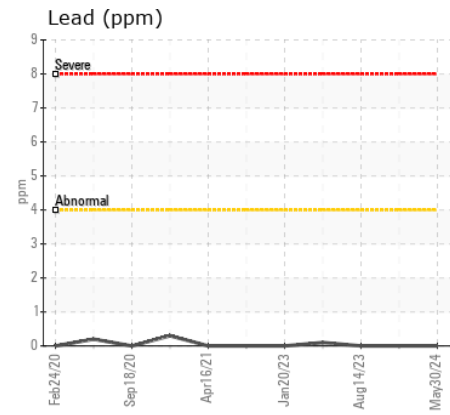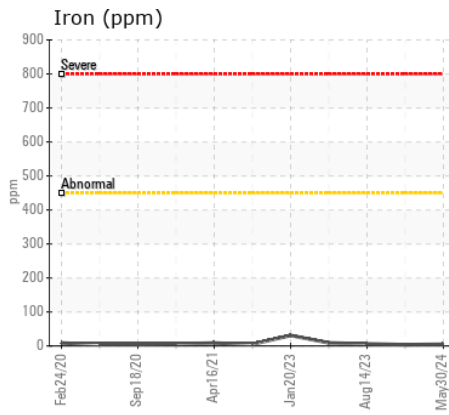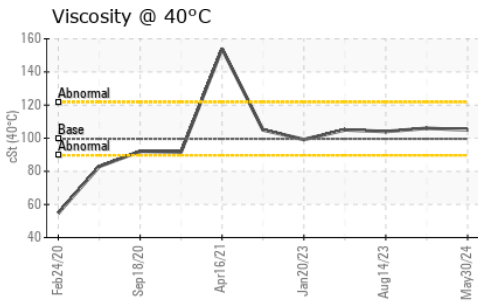

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0288120
Lab Number : 02641500
Unique Number : 5799039
Test Package : MOB 1
Received : 12 Jun 2024
Tested : 12 Jun 2024
Diagnosed : 12 Jun 2024 - Wes Davis

ECOWASTE INDUSTRIES
 4 SPRUCE ST
 NEW WESTMINSTER, BC
 CA V3L 5G6
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: