



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH22M 110435-1250**

Component  
**Rear Left Wheel Hub**

Fluid  
**PETRO CANADA TRAXON 75W90 SYNTHETIC (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0288107</b>	LH0260476	LH0234089
Sample Date		Client Info		<b>30 May 2024</b>	14 Aug 2023	07 Mar 2023
Machine Age	hrs	Client Info		<b>13142</b>	11129	10153
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>None</b>	None	None
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>5</b>	6	9
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>60	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>0</b>	<1	1
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	VLITE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	2	2
Boron	ppm	ASTM D5185(m)	328	<b>320</b>	298	287
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)	1	<b>&lt;1</b>	2	1
Calcium	ppm	ASTM D5185(m)	7	<b>5</b>	17	29
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1234</b>	1280	1356
Zinc	ppm	ASTM D5185(m)	3	<b>8</b>	14	7
Sulfur	ppm	ASTM D5185(m)	17909	<b>20700</b>	20741	21125
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>105</b>	104	104

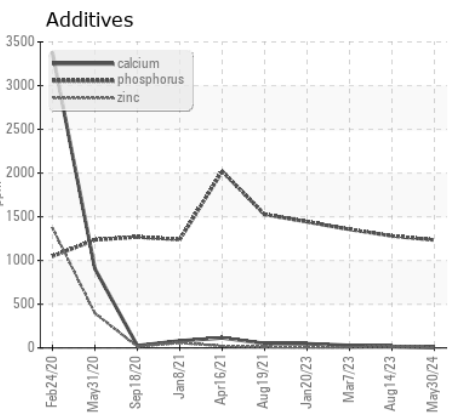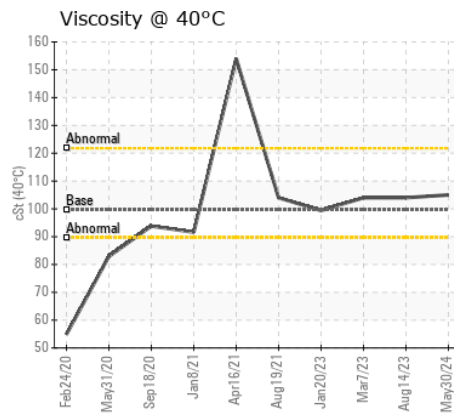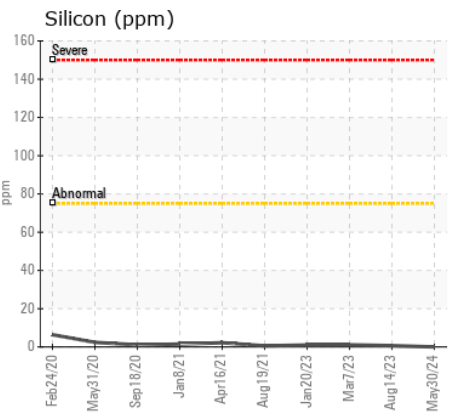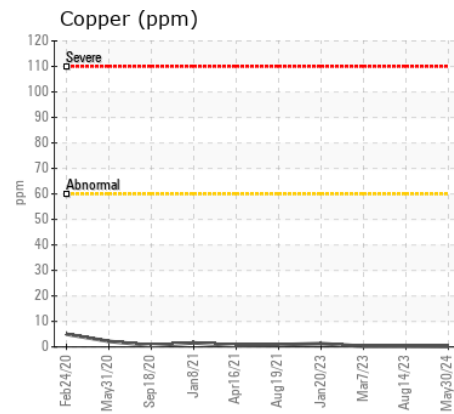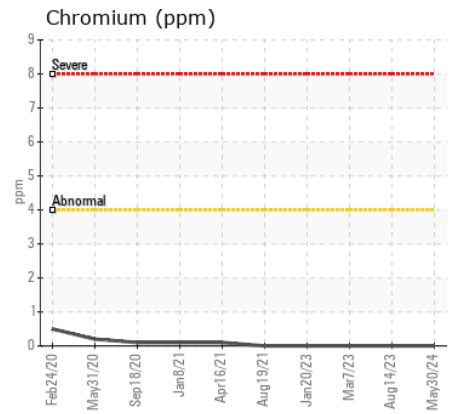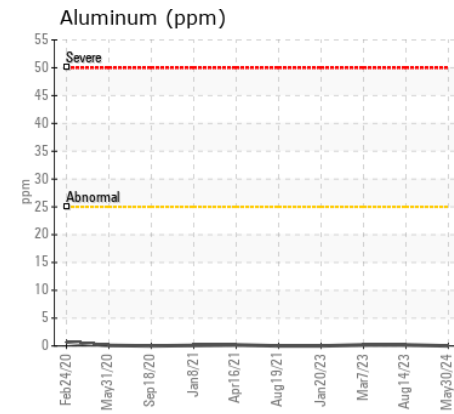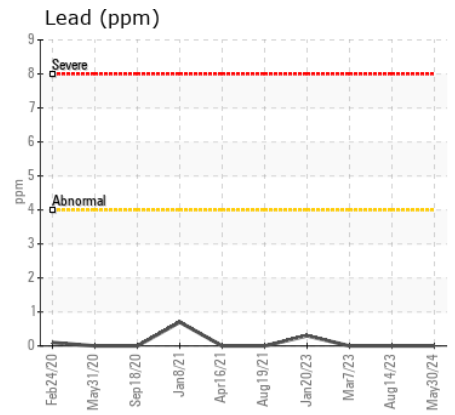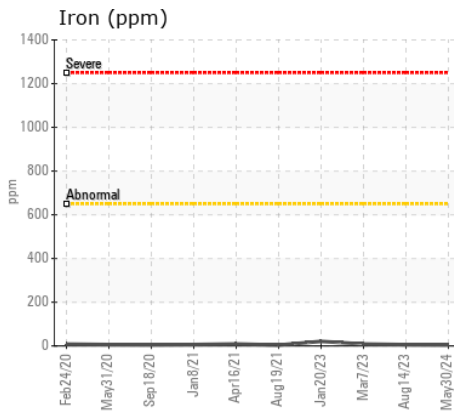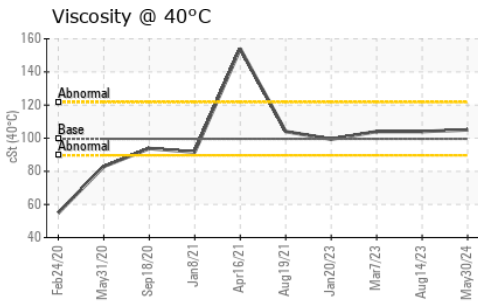

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0288107  
**Lab Number** : 02641501  
**Unique Number** : 5799040  
**Test Package** : MOB 1  
**Received** : 12 Jun 2024  
**Tested** : 12 Jun 2024  
**Diagnosed** : 12 Jun 2024 - Wes Davis

**ECOWASTE INDUSTRIES**  
 4 SPRUCE ST  
 NEW WESTMINSTER, BC  
 CA V3L 5G6  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T:  
F: