



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area

[86892]

Machine Id

2601 14TH AVE MARKHM OUTSIDE EAST SIDE OF BUILDING MODERN NIAGARA SGM322K2V

Component

Rear Diesel Engine

Fluid

ESSO XD-3 EXTRA 15W40 (60 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		PN0006221	PN0003999	PN0000021
Sample Date		Client Info		08 Jun 2024	14 Aug 2022	19 May 2019
Machine Age	hrs	Client Info		131	111	80
Oil Age	hrs	Client Info		11	13	0
Filter Age	hrs	Client Info		11	13	0
Oil Changed		Client Info		Changed	Changed	Not Changed
Filter Changed		Client Info		Changed	Changed	Not Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185(m)	>100	2	2	2
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>4	<1	0	0
Titanium	ppm	ASTM D5185(m)		0	0	<1
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	2	<1
Lead	ppm	ASTM D5185(m)	>40	0	<1	<1
Copper	ppm	ASTM D5185(m)	>330	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	3	7	8
Potassium	ppm	ASTM D5185(m)	>20	0	<1	<1
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	4.3	7.4	5.2
Sulfation	Abs/.1mm	ASTM D7415*	>30	16.8	17.1	21.7
Silt	scalar	Visual*	NONE	VLITE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	1	3	7
Boron	ppm	ASTM D5185(m)		4	73	51
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		51	81	39
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)		801	40	508
Calcium	ppm	ASTM D5185(m)	3780	1237	2207	1512
Phosphorus	ppm	ASTM D5185(m)	1370	1002	969	747
Zinc	ppm	ASTM D5185(m)	1500	1149	1131	886
Sulfur	ppm	ASTM D5185(m)	3800	2598	3249	2202
Oxidation	Abs/.1mm	ASTM D7414*	>25	11.8	12.9	18.3
Visc @ 40°C	cSt	ASTM D7279(m)	116	102	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	14.0	13.7	13.2
Viscosity Index (VI)	Scale	ASTM D2270*	140	139	---	---

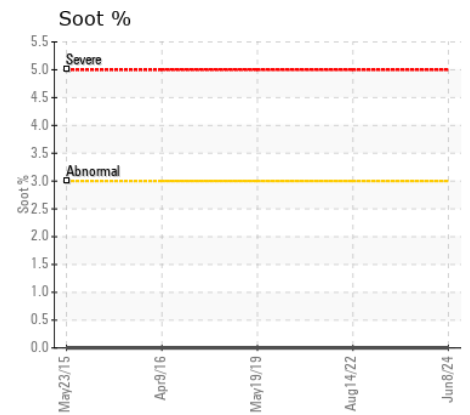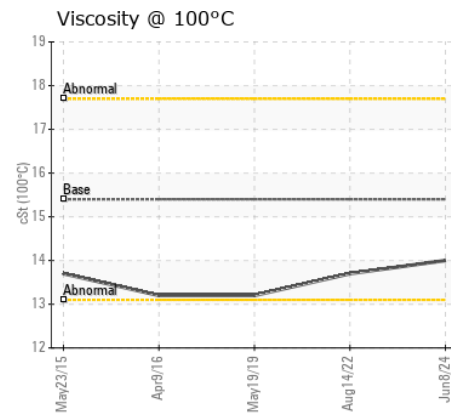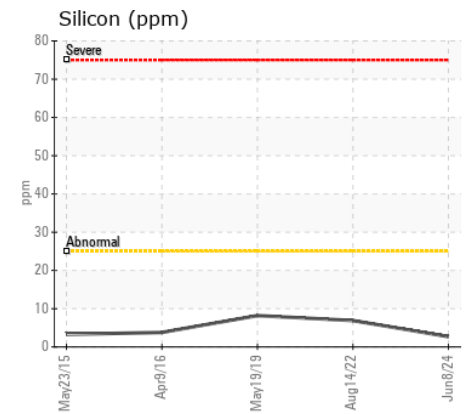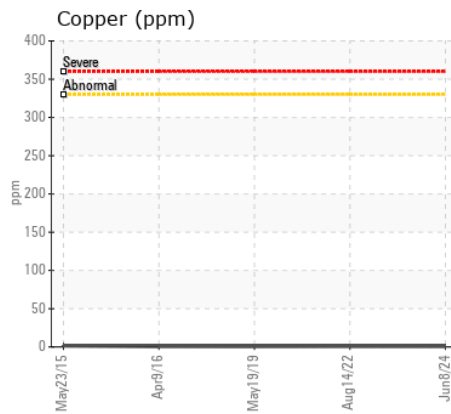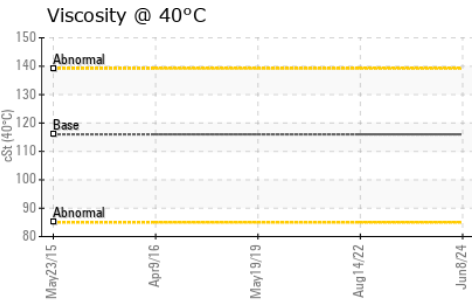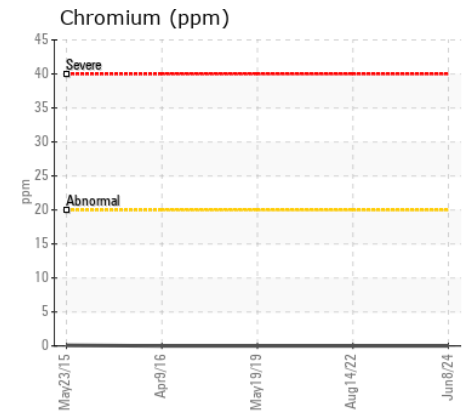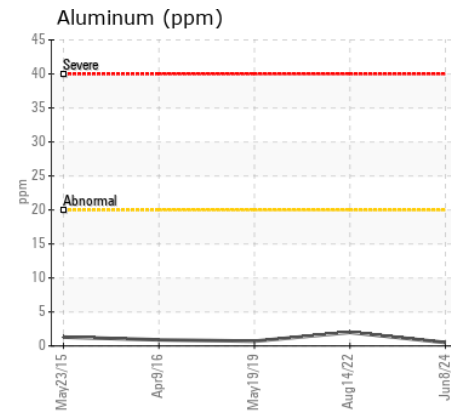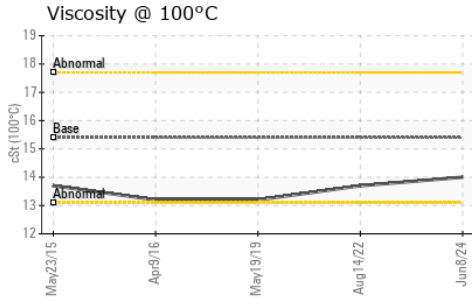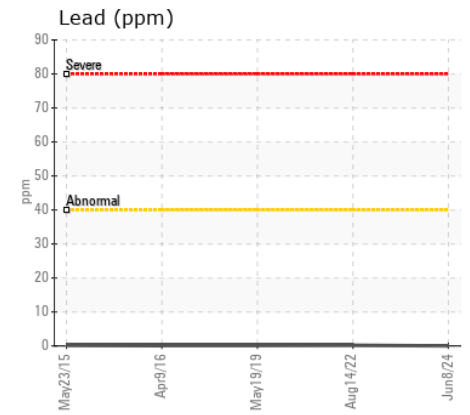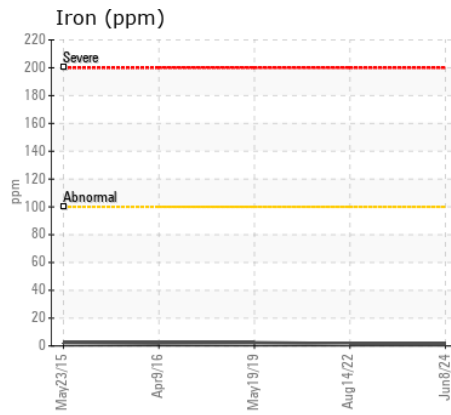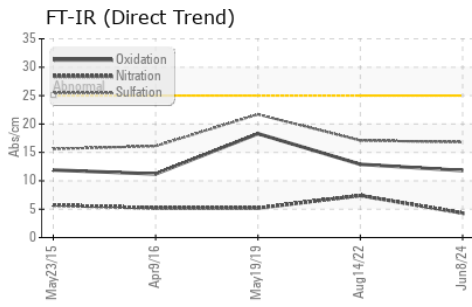

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PN0006221 **Received** : 18 Jun 2024
Lab Number : 02642536 **Tested** : 18 Jun 2024
Unique Number : 5800075 **Diagnosed** : 18 Jun 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: KV40, VI, Visual)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

POWER STATION INC.
 1050 JAYSON COURT
 MISSISSAUGA, ON
 CA L4W 2V5
 Contact: Brett Kinkley
 Bkinkley@pwrstn.com
 T:
 F: (905)565-8544