

**OIL ANALYSIS REPORT** 

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

Area


## **SKYCARE AIR AMBULANCE [53387]**


1124 P77556 (S/N 303)


Right Jet Turbine


MOBIL JET OIL 254 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT55318	GT55323	GT55310
	Sample Date		Client Info		14 Jun 2024	26 Apr 2024	15 Dec 2023
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		590	468	362
	Filter Age	hrs	Client Info		122	108	198
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL	NORMAL	NORMAL
WEAR	Iron	ppm	ASTM D5185(m)	>8	2	2	1
	Chromium	ppm	ASTM D5185(m)	>2	<1	<1	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Aluminum	ppm	ASTM D5185(m)	>2	2	2	1
	Lead	ppm	ASTM D5185(m)	>3	2	2	1
	Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	3	3	3
	Visc @ 40°C	cSt	ASTM D7279(m)	26.4	27.6	27.4	27.8

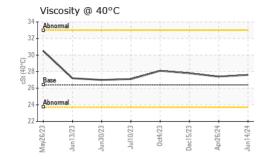

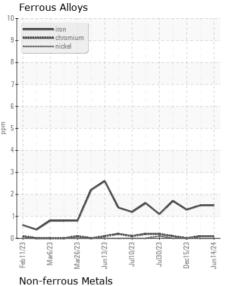

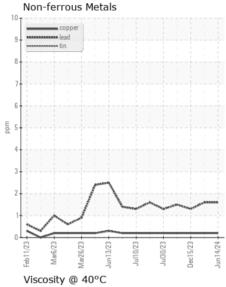

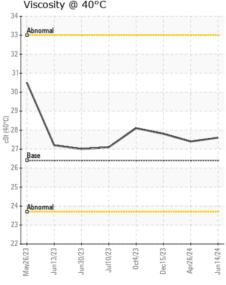



**CALA** ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT55318 Lab Number : 02642746 Unique Number : 5800285

**Tested** Diagnosed

Received : 18 Jun 2024 : 18 Jun 2024

: 18 Jun 2024 - Wes Davis

**Honeywell Engines** 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ US 85034

Contact: GARRETT

Test Package : G731 ( Additional Tests: ICP ) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (602)365-2676