

OIL ANALYSIS REPORT


WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**


SKYCARE AIR AMBULANCE [53392] FAIRCHILD SSA226 P-54167 (S/N TC274)


2 Jet Turbine


ESSO EXXON TURBO OIL 2380 (--- GAL)


RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57977	GT57962	GT57968
	Sample Date		Client Info		18 Jun 2024	31 May 2024	13 May 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		503	434	359
	Filter Age	hrs	Client Info		69	76	67
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL		NORMAL
WEAR	Iron	ppm	ASTM D5185(m)	>8	0	0	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	0	0
	Copper	ppm	ASTM D5185(m)	>3	0	0	<1
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0.0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	.38	0.42	0.43	0.43
	Visc @ 40°C	cSt	ASTM D7279(m)	24.1	24.4		24.7

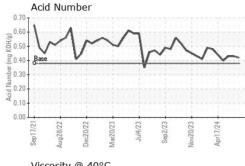


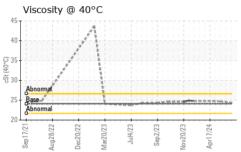

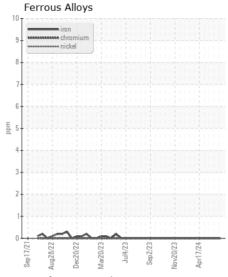

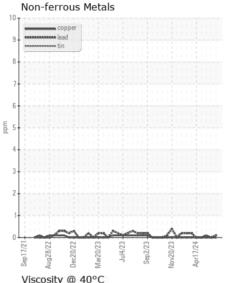

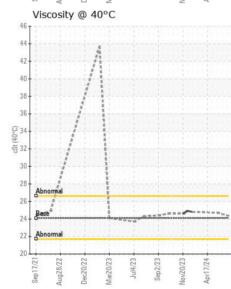

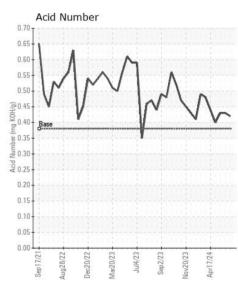



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57977 Lab Number : 02643058

Unique Number : 5800597

Received Tested Diagnosed

: 19 Jun 2024 : 19 Jun 2024

: 19 Jun 2024 - Wes Davis

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ US 85034

Contact: GARRETT

Test Package : G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (602)365-2676

T: