Honeywell

OIL ANALYSIS REPORT

WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

Area (CFTSK) PERIMETER AVIATION [53396] Machine Id [CFTSK] FAIRCHILD SA227AC P-44719C (S/N AC-674B)

1 Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)


RECOMMENDATION

This is a baseline read-out on the submitted sample.

W	FΔ	R

CONTAMINATION
FLUID CONDITION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GT56373	GT57519	GT57531
Sample Date		Client Info		14 Jun 2024	28 Mar 2024	28 Feb 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		54	844	751
Filter Age	hrs	Client Info		93	93	87
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL		
Iron	ppm	ASTM D5185(m)	>8	0	<1	<1
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>3	0	0	<1
Water		WC Method	>0.1	NEG	NEG	NEG
Magnesium	ppm	ASTM D5185(m)	0	<1	1	1
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.52	0.59	0.50
Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.6	24.4	

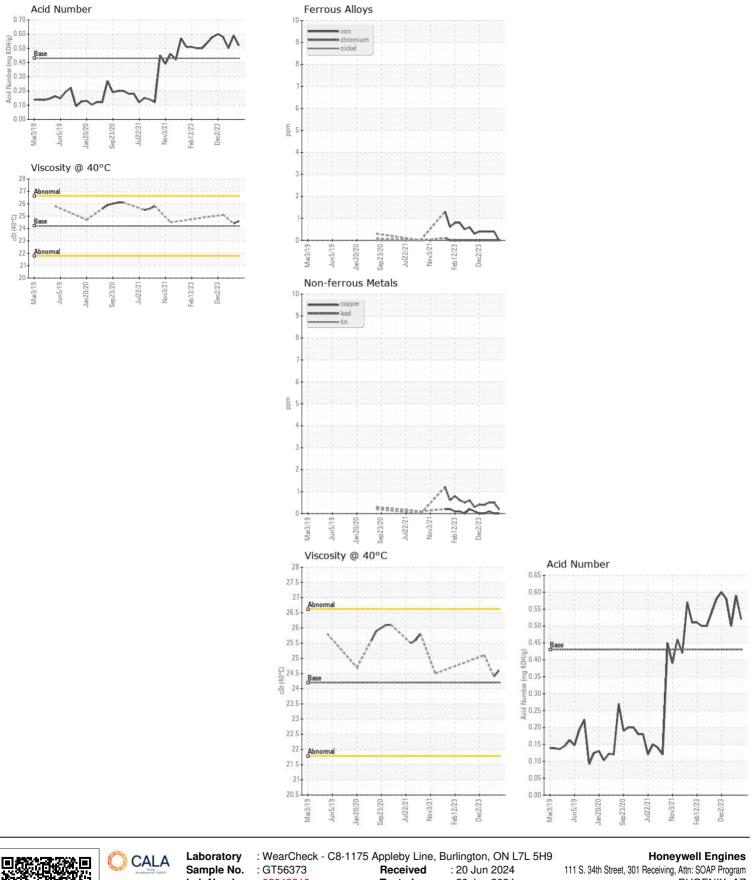

Lab Number : 02643310 Tested PHOENIX, AZ : 20 Jun 2024 ISO 17025:2017 Accredited Laboratory Diagnosed Unique Number : 5800849 : 20 Jun 2024 - Wes Davis US 85034 Test Package : G331 (Additional Tests: ICP) Contact: GARRETT To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T: Validity of results and interpretation are based on the sample and information as supplied. F: (602)365-2676

Contact/Location: GARRETT ? - HONPHO Page 2 of 2