



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area

**[86948]**

Machine Id

**115 WALTON STREET PORT HOPE, BASEMENT/GEN RM BELL CANADA 4A0274047**

Component

**Right Diesel Engine**

Fluid

**ESSO XD-3 EXTRA 15W40 (20 LTR)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PN0006268</b>	PN0004934	PN0003626
Sample Date		Client Info		<b>12 Jun 2024</b>	05 Jul 2023	21 Dec 2021
Machine Age	hrs	Client Info		<b>0</b>	804	777
Oil Age	hrs	Client Info		<b>15</b>	0	33
Filter Age	hrs	Client Info		<b>15</b>	0	33
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>200	<b>2</b>	2	2
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>2	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>2	<b>0</b>	0	3
Aluminum	ppm	ASTM D5185(m)	>30	<b>&lt;1</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>30	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>30	<b>&lt;1</b>	<1	1
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>VLITE</b>	---	---

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>30	<b>3</b>	3	4
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	<1
Fuel		WC Method	>3.0	<b>&lt;1.0</b>	<1.0	0.4
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>3	<b>0</b>	0	0
Nitration	Abs/cm	ASTM D7624*	>20	<b>3.2</b>	3.7	4.1
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>12.7</b>	13.4	16.0
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	<b>1</b>	3	9
Boron	ppm	ASTM D5185(m)		<b>5</b>	15	10
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>3</b>	9	11
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)		<b>658</b>	80	73
Calcium	ppm	ASTM D5185(m)	3780	<b>1678</b>	3432	3147
Phosphorus	ppm	ASTM D5185(m)	1370	<b>964</b>	743	745
Zinc	ppm	ASTM D5185(m)	1500	<b>1087</b>	769	832
Sulfur	ppm	ASTM D5185(m)	3800	<b>2537</b>	2328	2332
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>5.6</b>	5.0	6.1
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>13.6</b>	12.8	12.7

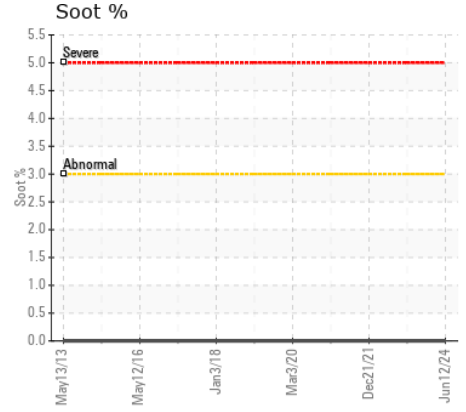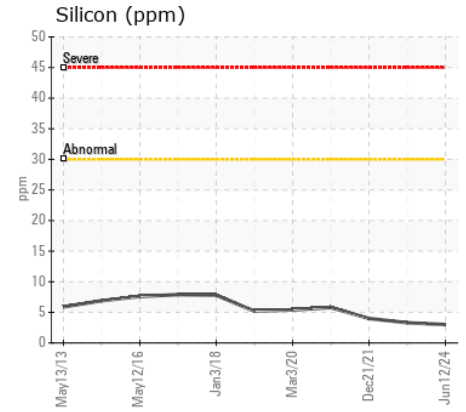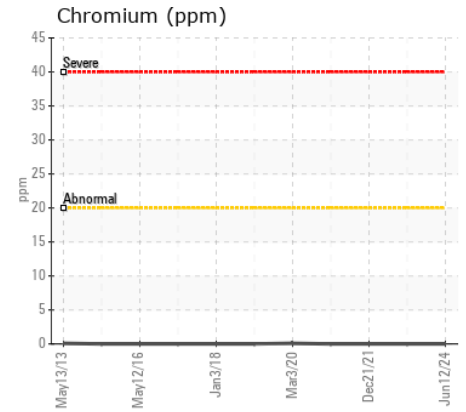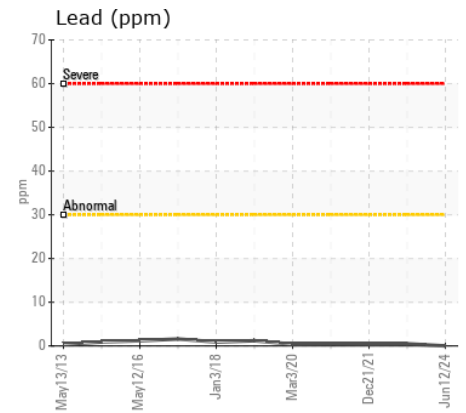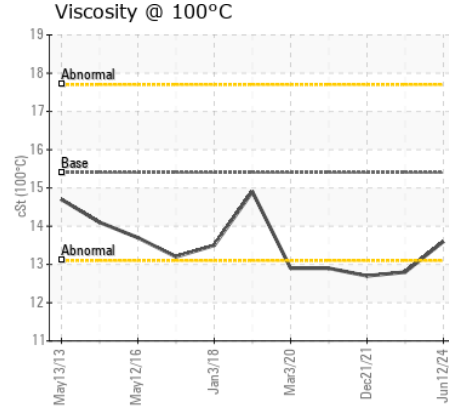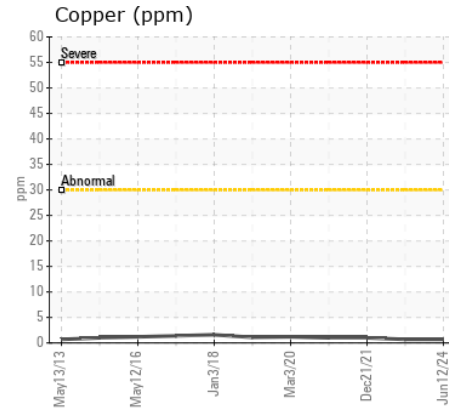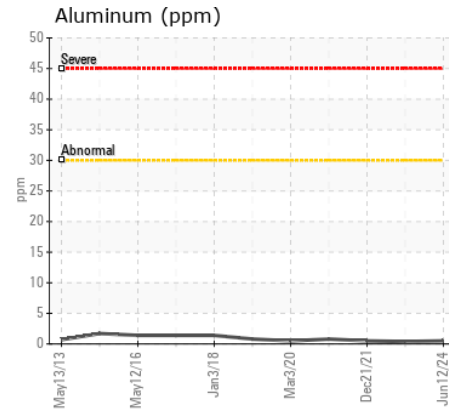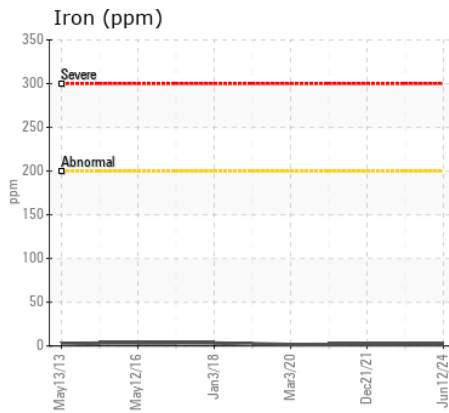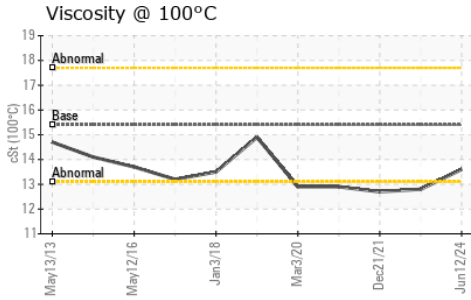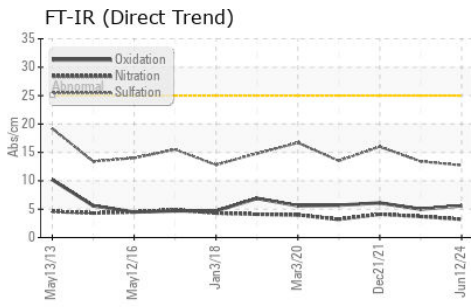

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PN0006268 **Received** : 24 Jun 2024  
**Lab Number** : 02643642 **Tested** : 24 Jun 2024  
**Unique Number** : 5801181 **Diagnosed** : 24 Jun 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: Visual )

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**POWER STATION INC.**  
 1050 JAYSON COURT  
 MISSISSAUGA, ON  
 CA L4W 2V5  
 Contact: Brett Kinkley  
 Bkinkley@pwrstn.com  
 T:  
 F: (905)665-8544