



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area

**[87054]**

Machine Id

**MULHOLLAND LANE LYNDEN 6401092 BELL CANADA U400164U**

Component

**Left Diesel Engine**

Fluid

**ESSO XD-3 EXTRA 15W40 (7 LTR)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PN0006319</b>	PN0300938	PN931421
Sample Date		Client Info		<b>19 Jun 2024</b>	21 Sep 2018	16 Apr 2015
Machine Age	hrs	Client Info		<b>169</b>	501	401
Oil Age	hrs	Client Info		<b>3</b>	45	19
Filter Age	hrs	Client Info		<b>3</b>	45	19
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185(m)	>250	<b>2</b>	7	4
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185(m)	>5	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>35	<b>&lt;1</b>	2	2
Lead	ppm	ASTM D5185(m)	>100	<b>2</b>	<1	0
Copper	ppm	ASTM D5185(m)	>60	<b>&lt;1</b>	2	1
Tin	ppm	ASTM D5185(m)	>5	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	NONE

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>35	<b>2</b>	5	4
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>3	<b>0</b>	0	0
Nitration	Abs/cm	ASTM D7624*	>20	<b>4.9</b>	5.9	5.8
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>18.2</b>	21.2	16.0
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	VLITE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	<b>2</b>	2	4
Boron	ppm	ASTM D5185(m)		<b>10</b>	52	12
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>54</b>	38	33
Manganese	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)		<b>842</b>	482	579
Calcium	ppm	ASTM D5185(m)	3780	<b>1082</b>	1561	1431
Phosphorus	ppm	ASTM D5185(m)	1370	<b>943</b>	739	962
Zinc	ppm	ASTM D5185(m)	1500	<b>1114</b>	869	1117
Sulfur	ppm	ASTM D5185(m)	3800	<b>2541</b>	2196	3001
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>13.9</b>	18.8	12.7
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>14.6</b>	13.2	13.7

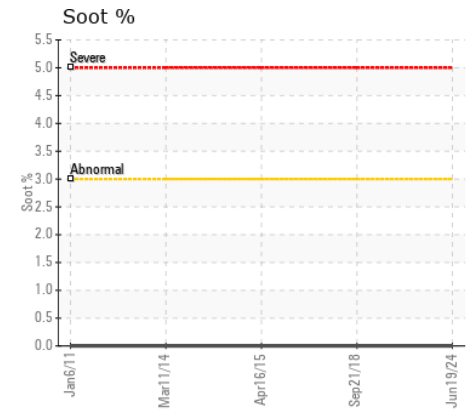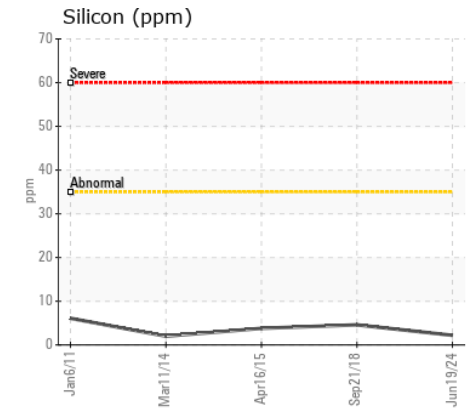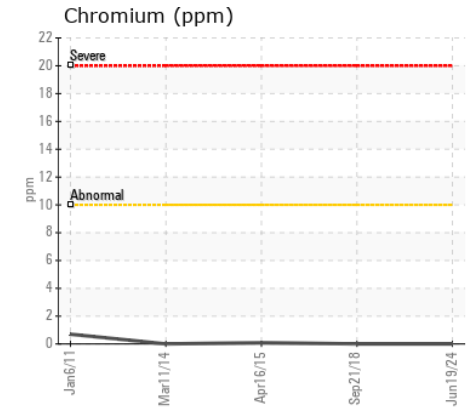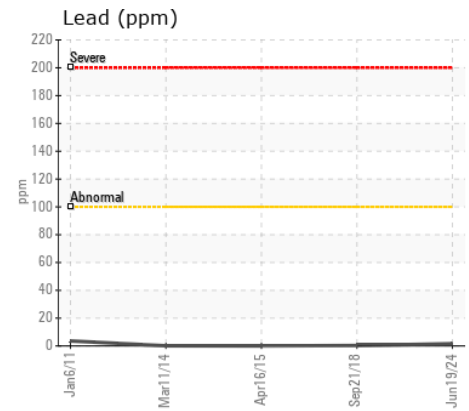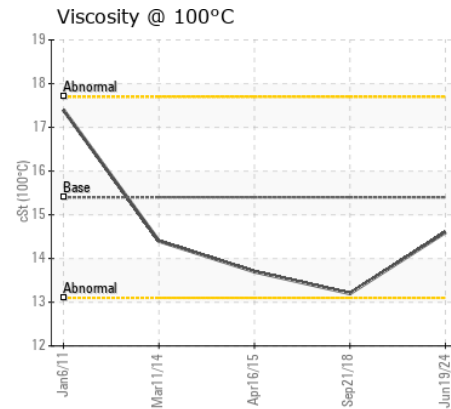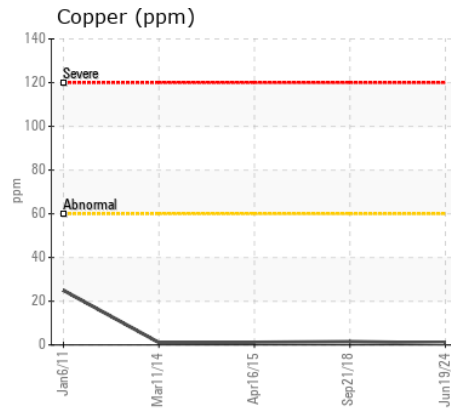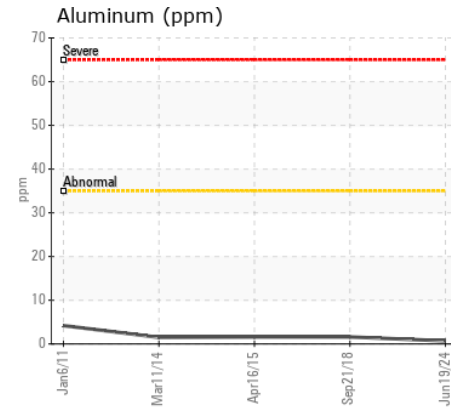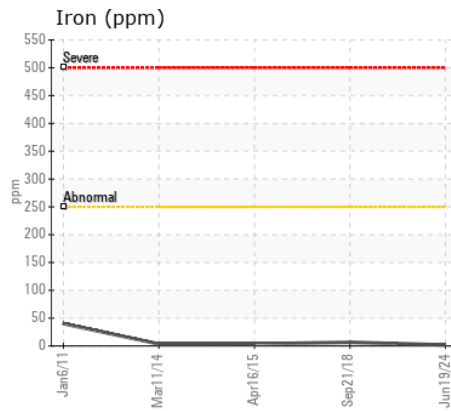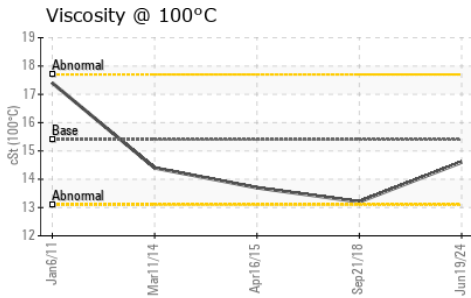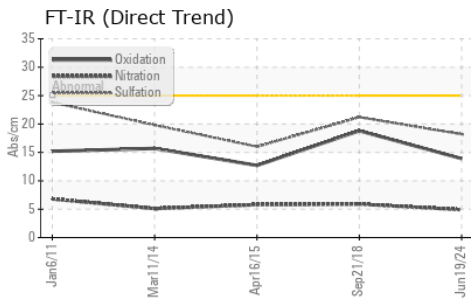

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PN0006319 **Received** : 25 Jun 2024  
**Lab Number** : 02643933 **Tested** : 25 Jun 2024  
**Unique Number** : 5801472 **Diagnosed** : 25 Jun 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: Visual )

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**POWER STATION INC.**  
 1050 JAYSON COURT  
 MISSISSAUGA, ON  
 CA L4W 2V5  
 Contact: Ryan Udall  
 rudall@pwrstn.com  
 T: (905)565-1621  
 F: (905)629-1499