



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
ELTEC ELTEC LP0250

Component
Hydraulic System

Fluid
CASTROL HVI 32 (300 LTR)

RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		ST45665	ST45595	---
Sample Date		Client Info		25 May 2024	27 Mar 2024	---
Machine Age	hrs	Client Info		0	0	---
Oil Age	hrs	Client Info		0	1700	---
Filter Age	hrs	Client Info		0	0	---
Oil Changed		Client Info		N/A	N/A	---
Filter Changed		Client Info		N/A	N/A	---
Sample Status				NORMAL	ABNORMAL	---

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>20	5	4	---
Chromium	ppm	ASTM D5185(m)	>20	0	0	---
Nickel	ppm	ASTM D5185(m)	>20	<1	0	---
Titanium	ppm	ASTM D5185(m)		0	0	---
Silver	ppm	ASTM D5185(m)		0	0	---
Aluminum	ppm	ASTM D5185(m)	>20	<1	<1	---
Lead	ppm	ASTM D5185(m)	>20	0	0	---
Copper	ppm	ASTM D5185(m)	>20	2	1	---
Tin	ppm	ASTM D5185(m)	>20	0	0	---
Vanadium	ppm	ASTM D5185(m)		0	0	---
White Metal	scalar	Visual*	NONE	VLITE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	---

CONTAMINATION










La propreté du système est acceptable pour votre objectif de propreté ISO 4406. La teneur en eau est négligeable. La propreté du système et du fluide est acceptable.

Silicon	ppm	ASTM D5185(m)	>15	3	<1	---
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	---
Water	%	ASTM D6304*	>0.05	0.011	0.001	---
ppm Water	ppm	ASTM D6304*	>500	111	15	---
Particles >4µm		ASTM D7647	>5000	3106	4019	---
Particles >6µm		ASTM D7647	>1300	793	614	---
Particles >14µm		ASTM D7647	>160	37	35	---
Particles >21µm		ASTM D7647	>40	9	10	---
Particles >38µm		ASTM D7647	>10	0	2	---
Particles >71µm		ASTM D7647	>3	0	1	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	19/17/12	19/16/12	---
Silt	scalar	Visual*	NONE	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG	---

FLUID CONDITION

Le AN est acceptable pour ce fluide. L'état de l'huile permet d'en prolonger l'utilisation.

Sodium	ppm	ASTM D5185(m)		2	2	---
Boron	ppm	ASTM D5185(m)		13	8	---
Barium	ppm	ASTM D5185(m)		0	0	---
Molybdenum	ppm	ASTM D5185(m)		11	6	---
Manganese	ppm	ASTM D5185(m)		0	0	---
Magnesium	ppm	ASTM D5185(m)		128	73	---
Calcium	ppm	ASTM D5185(m)		249	166	---
Phosphorus	ppm	ASTM D5185(m)		433	354	---
Zinc	ppm	ASTM D5185(m)		512	425	---
Sulfur	ppm	ASTM D5185(m)		1584	1423	---
Acid Number (AN)	mg KOH/g	ASTM D974*		0.70	0.54	---
Visc @ 40°C	cSt	ASTM D7279(m)		31.3	▲ 27.4	---

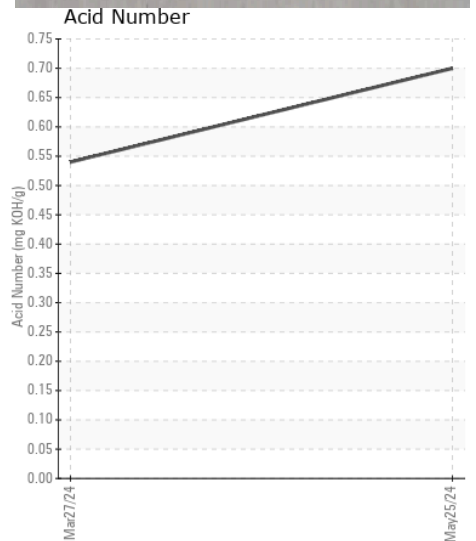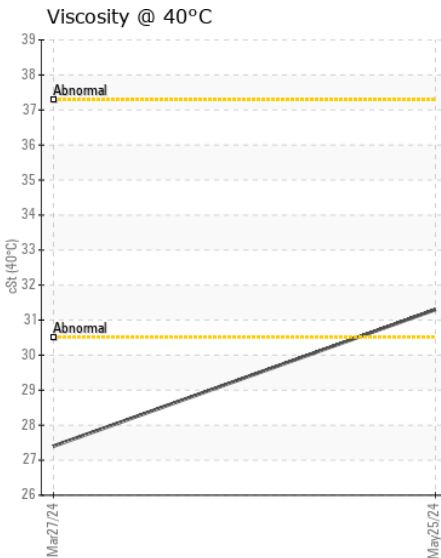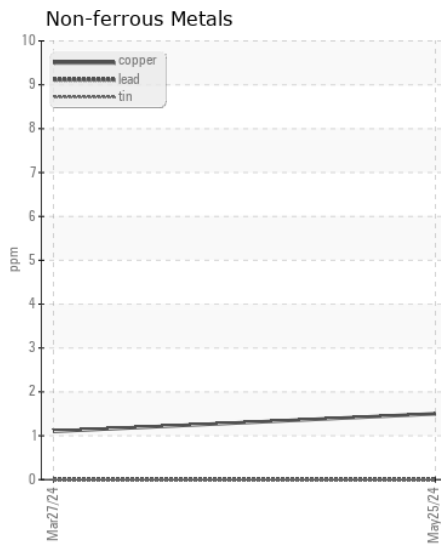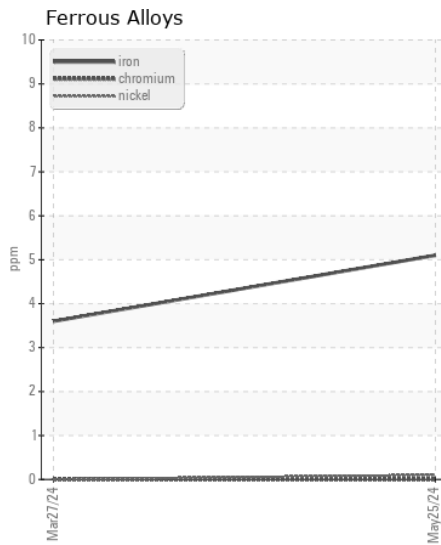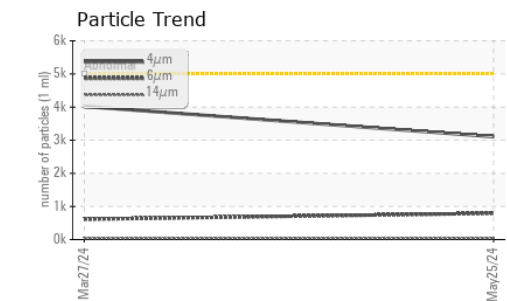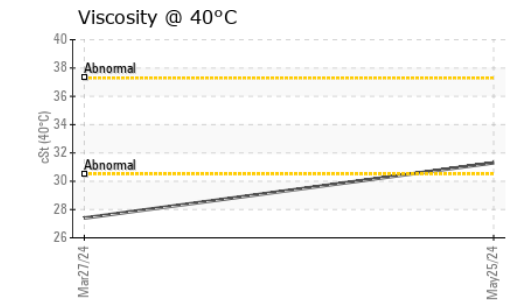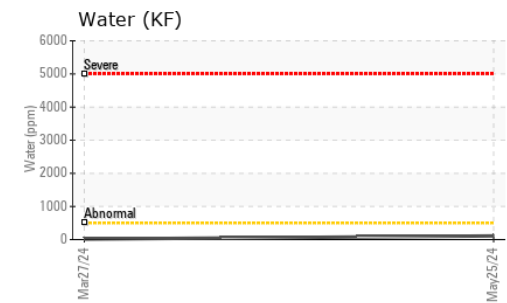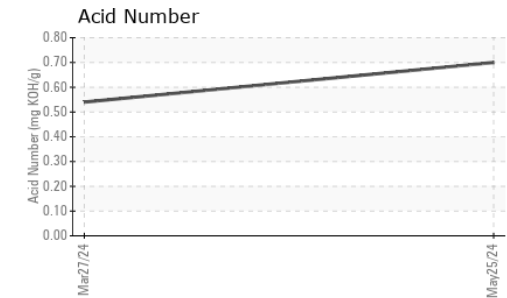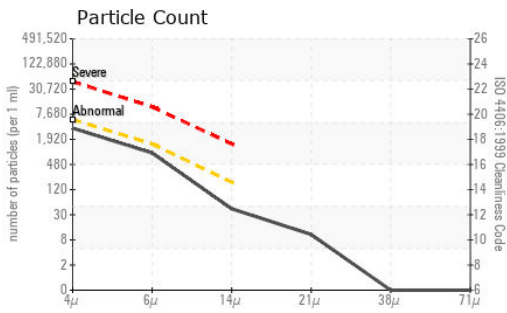

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : ST45665 **Received** : 27 Jun 2024
Lab Number : **02644354** **Tested** : 28 Jun 2024
Unique Number : 5801893 **Diagnosed** : 28 Jun 2024 - Kevin Marson
Test Package : IND 2 (Additional Tests: Bottom, BottomAnalysis, FilterPatch, KF, PrtFilter, TAN, etc)

HYDROMECC INC
 2921, BLVD WALLBERG
 DOLBEAU, QC
 CA G8L 1L6
 Contact: Melissa Dubois
 serviceadministrator@hydromec.ca
 T: (418)276-5831E X:t253
 F: (418)276-8166

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.