



OIL ANALYSIS REPORT

WEAR	UNKNOWN
CONTAMINATION	UNKNOWN
FLUID CONDITION	UNKNOWN

Area

ADVENTURE AIR [53423]

Machine Id

CESSNA CARAVAN P-123130 (S/N 20800223)

Component

Jet Turbine

Fluid

BP TURBO OIL 2380 (--- GAL)

RECOMMENDATION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GT57635	GT57638	GT57637
Sample Date		Client Info		27 Jun 2024	13 Jun 2024	06 Jun 2024
Machine Age	hrs	Client Info		6182	6114	6086
Oil Age	hrs	Client Info		411	343	315
Filter Age	hrs	Client Info		69	28	88
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				---	NORMAL	NORMAL

WEAR







Iron	ppm	ASTM D5185(m)	>8	<1	<1	<1
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>3	0	0	0

CONTAMINATION

Water		WC Method	>0.1	NEG	NEG	NEG
-------	--	-----------	------	------------	-----	-----

FLUID CONDITION

Magnesium	ppm	ASTM D5185(m)	0	<1	<1	<1
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	1.09	1.01	0.99
Visc @ 40°C	cSt	ASTM D7279(m)	24.2	---	24.3	24.4

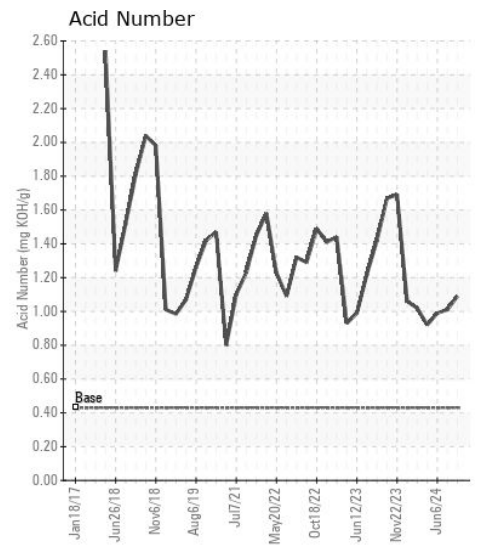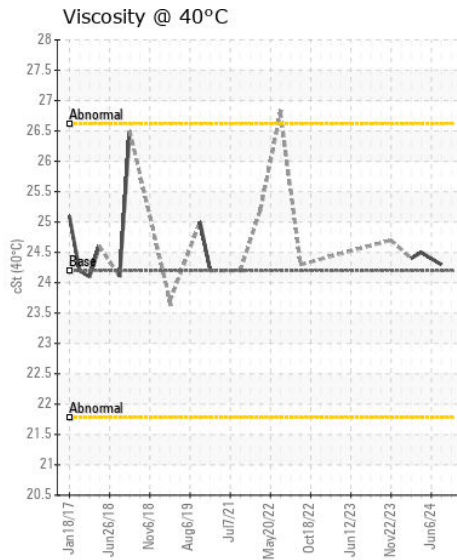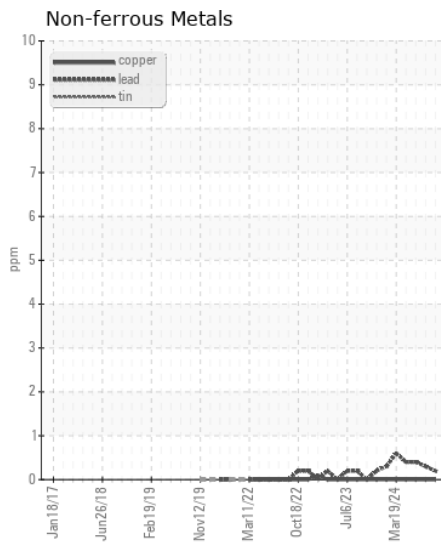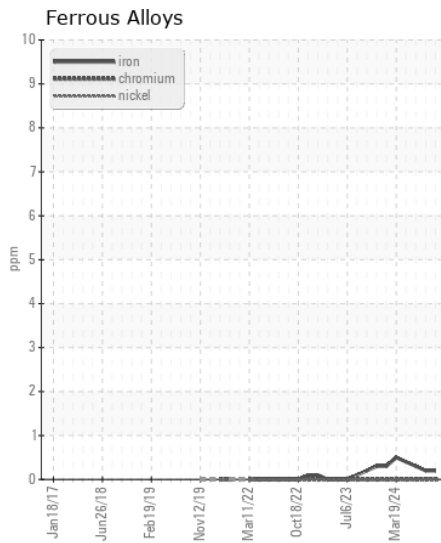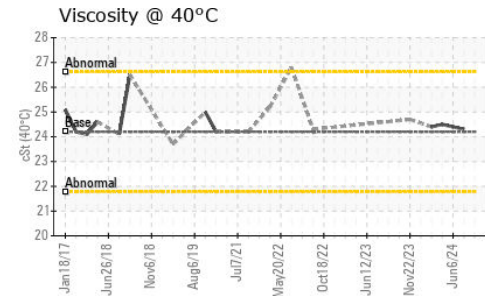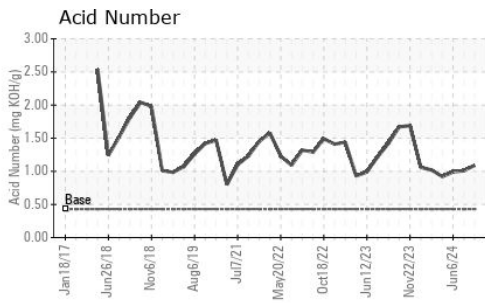

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GT57635 **Received** : 02 Jul 2024
Lab Number : 02645104 **Tested** :
Unique Number : 5802643 **Diagnosed** :
Test Package : G331 (Additional Tests: ICP)

Honeywell Engines
 111 S. 34th Street, 301 Receiving, Attn: SOAP Program
 PHOENIX, AZ
 US 85034
 Contact: GARRETT

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
 F: (602)365-2676