



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
PIECES HYDRAULIQUES MENARDS
 Machine Id
YANMAR NO UNIT ASF0000446
 Component
Diesel Engine
 Fluid
CHEVRON DELO 400 XLE 10W30 (--- GAL)

RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		ASF0000446	---	---
Sample Date		Client Info		21 Jun 2024	---	---
Machine Age	hrs	Client Info		1400	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		1250	---	---
Oil Changed		Client Info		Not Changd	---	---
Filter Changed		Client Info		Not Changd	---	---
Sample Status				NORMAL	---	---

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>80	3	---	---
Chromium	ppm	ASTM D5185(m)	>6	0	---	---
Nickel	ppm	ASTM D5185(m)	>2	<1	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	<1	---	---
Aluminum	ppm	ASTM D5185(m)	>20	2	---	---
Lead	ppm	ASTM D5185(m)	>95	0	---	---
Copper	ppm	ASTM D5185(m)	>85	<1	---	---
Tin	ppm	ASTM D5185(m)	>9	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION














Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>25	4	---	---
Potassium	ppm	ASTM D5185(m)	>20	4	---	---
Fuel		WC Method	>4.0	<1.0	---	---
Water		WC Method	>0.1	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	ASTM D7844*		0	---	---
Nitration	Abs/cm	ASTM D7624*	>20	6.3	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	17.4	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---

FLUID CONDITION

Le résultat pour le BN indique que la réserve d'alcalinité est acceptable pour l'huile. Le AN est acceptable pour ce fluide. L'état de l'huile permet d'en prolonger l'utilisation.

Sodium	ppm	ASTM D5185(m)		2	---	---
Boron	ppm	ASTM D5185(m)		92	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		12	---	---
Manganese	ppm	ASTM D5185(m)		<1	---	---
Magnesium	ppm	ASTM D5185(m)		664	---	---
Calcium	ppm	ASTM D5185(m)		1234	---	---
Phosphorus	ppm	ASTM D5185(m)		623	---	---
Zinc	ppm	ASTM D5185(m)		725	---	---
Sulfur	ppm	ASTM D5185(m)		2354	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	11.9	---	---
Acid Number (AN)	mg KOH/g	ASTM D974*		2.10	---	---
Base Number (BN)	mg KOH/g	ASTM D2896*		9.57	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		77.9	---	---
Visc @ 100°C	cSt	ASTM D7279(m)		11.7	---	---
Viscosity Index (VI)	Scale	ASTM D2270*		143	---	---

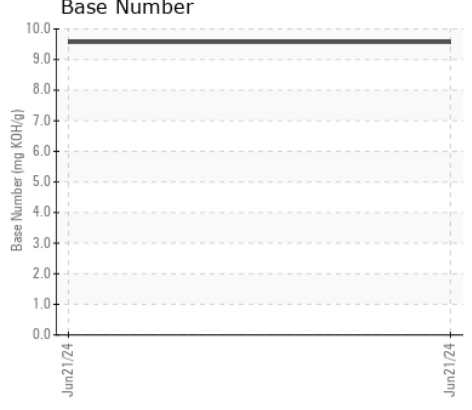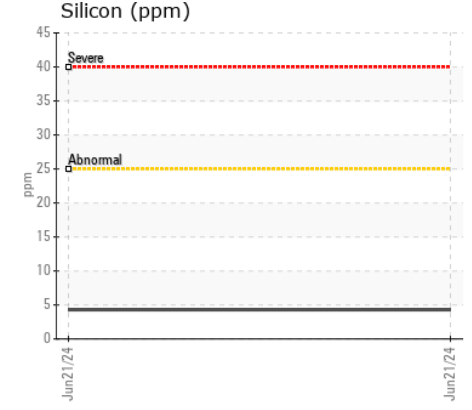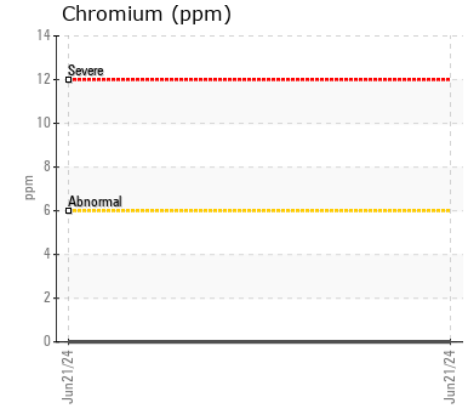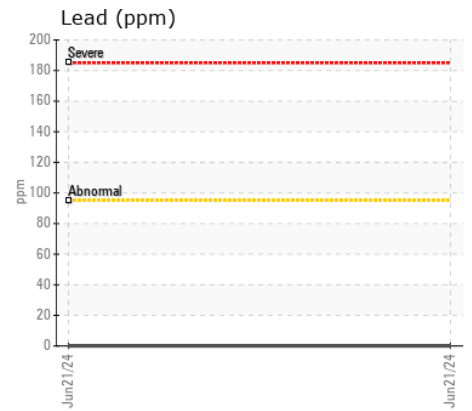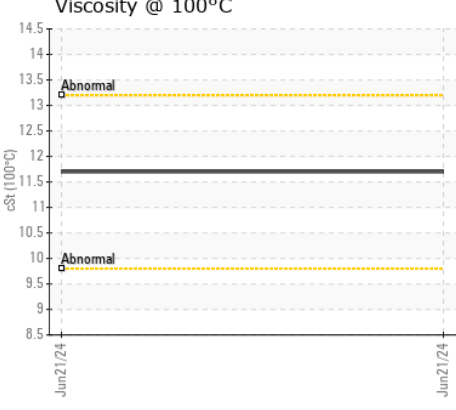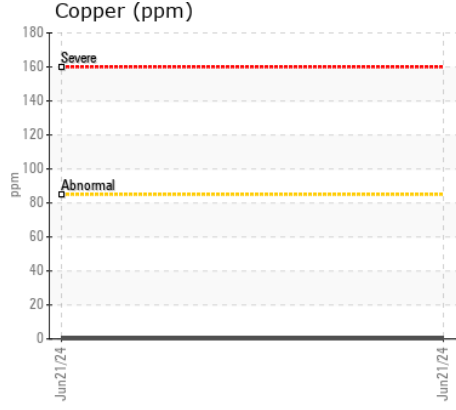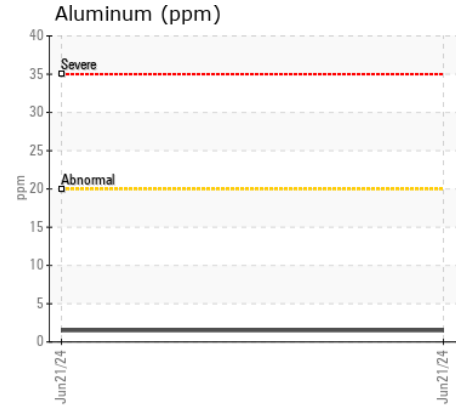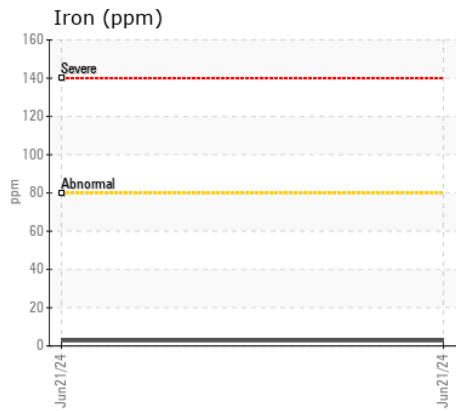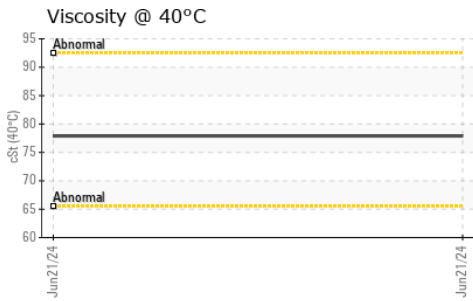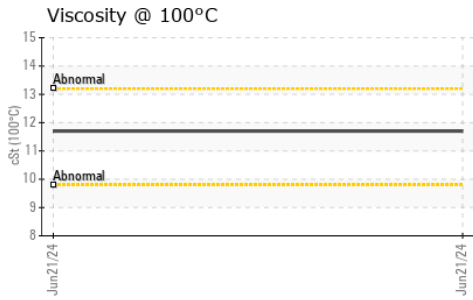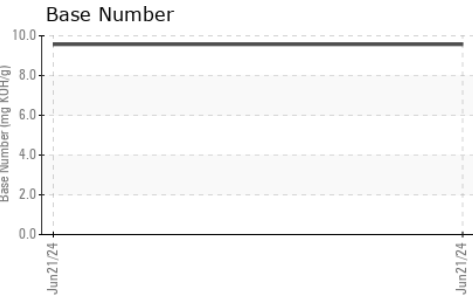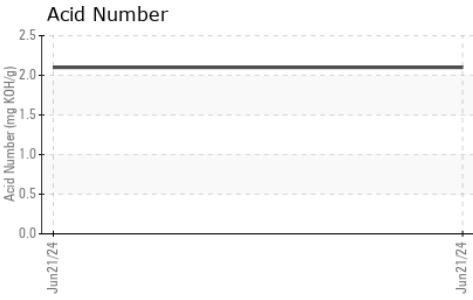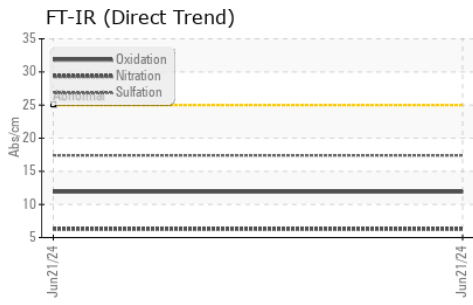

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : ASF0000446 **Received** : 04 Jul 2024
Lab Number : 02645420 **Tested** : 05 Jul 2024
Unique Number : 5802959 **Diagnosed** : 05 Jul 2024 - Wes Davis
Test Package : MOB 2 (Additional Tests: KV40, TAN Auto, TAN Man, VI, Visual)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

April Super Flo
 9 rue Beland
 L'Isle-Verte, QC
 CA G0L 1K0
 Contact: Michel Jalbert
 mjalbert@aprilsuperflo.com
 T:
 F: (418)898-2192