

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area Ascendum Machinery Machine Id VOLVO A45G PN-1 (S/N 342225) Component Bogie/Center Axle

Fluid {not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP335329		
Sample Date		Client Info		11 Nov 2021		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Filter Changed		Client Info		N/A		
Sample Status				NORMAL		
Iron	ppm	ASTM D5185m	>900	120		
Chromium	ppm	ASTM D5185m	>20	1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>30	2		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>150	10		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>50	4		
Potassium	ppm	ASTM D5185m	>20	0		
Water	ppin	WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium	ppm	ASTM D5185m		0		
Boron	ppm	ASTM D5185m		15		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		2		
Manganese	ppm	ASTM D5185m		2		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		723		
Phosphorus	ppm	ASTM D5185m		383		
Zinc	ppm	ASTM D5185m		193		
Sulfur	ppm	ASTM D5185m		22399		
Vice @ 40°C	oSt	ACTM D445		262		


Contact/Location: KEVIN LADGERWOOD - CARCONVC


262

Visc @ 40°C

cSt

ASTM D445

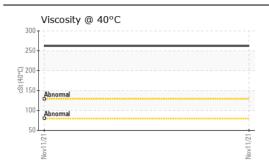

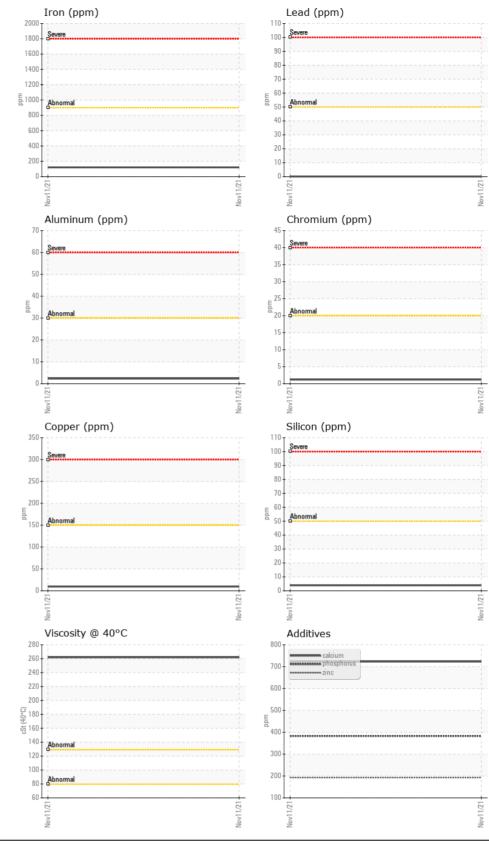

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 **CAROLINA EXCAVATING** Sample No. Received 1036 BRANCHVIEW DR, SUITE 106 : VCP335329 : 12 Nov 2021 Lab Number : 05399999 : 16 Nov 2021 CONCORD, NC Tested Unique Number : 9739149 : 16 Nov 2021 - Don Baldridge US 28025 Diagnosed Test Package : MOB 1 Contact: KEVIN LADGERWOOD Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. kevin@carlinaexcavation.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F:

Contact/Location: KEVIN LADGERWOOD - CARCONVC