



# VOLVO

## OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area  
**Ascendum Machinery**  
Machine Id  
**VOLVO A45G PN-1 (S/N 342225)**  
Component  
**Rear Axle**  
Fluid  
**{not provided} (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP335323	---	---
Sample Date		Client Info		11 Nov 2021	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	201	---	---
Chromium	ppm	ASTM D5185m	>20	3	---	---
Nickel	ppm	ASTM D5185m	>10	<1	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>30	2	---	---
Lead	ppm	ASTM D5185m	>50	0	---	---
Copper	ppm	ASTM D5185m	>150	<1	---	---
Tin	ppm	ASTM D5185m	>20	0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	VLITE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	4	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Water		WC Method	>0.2	NEG	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		0	---	---
Boron	ppm	ASTM D5185m		23	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		4	---	---
Manganese	ppm	ASTM D5185m		6	---	---
Magnesium	ppm	ASTM D5185m		0	---	---
Calcium	ppm	ASTM D5185m		541	---	---
Phosphorus	ppm	ASTM D5185m		412	---	---
Zinc	ppm	ASTM D5185m		116	---	---
Sulfur	ppm	ASTM D5185m		22974	---	---
Visc @ 40°C	cSt	ASTM D445		261	---	---

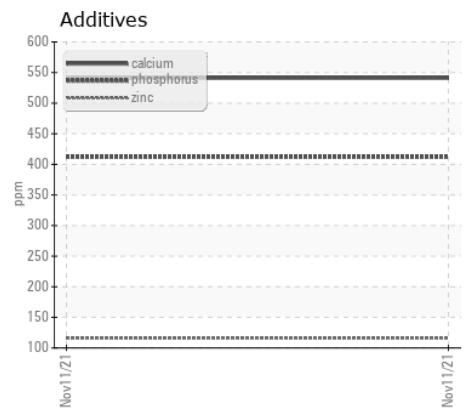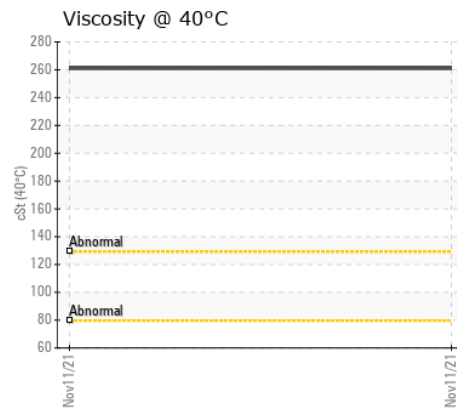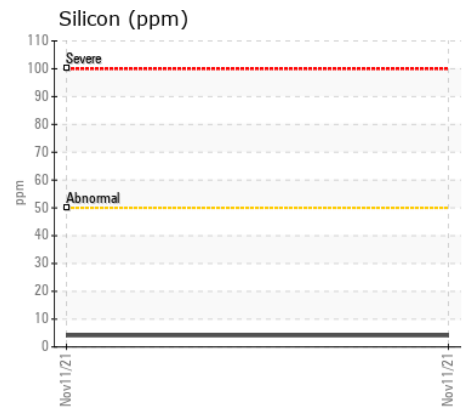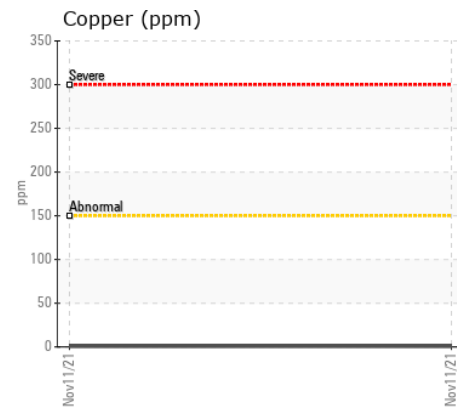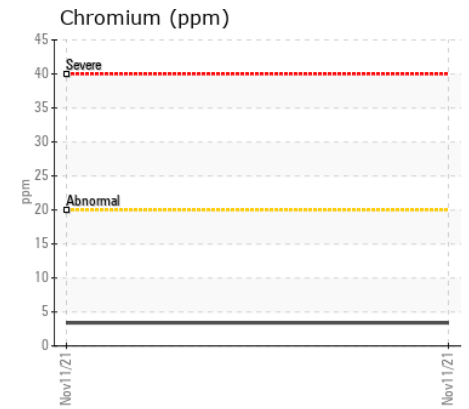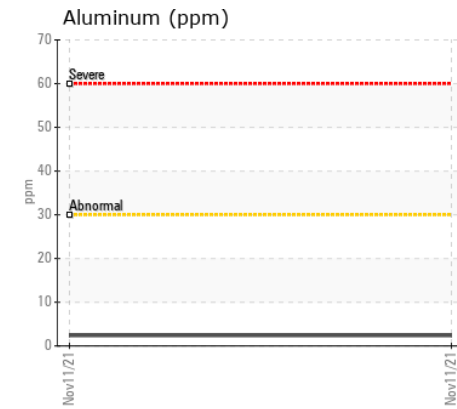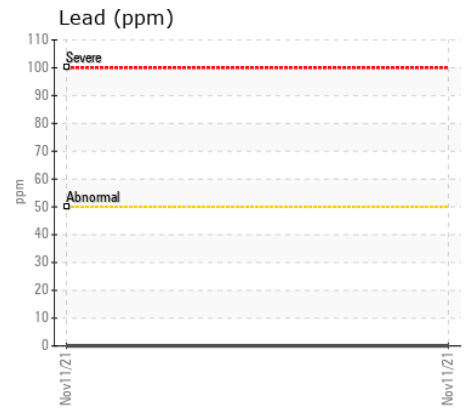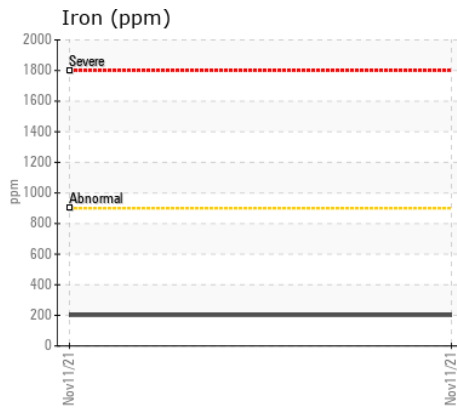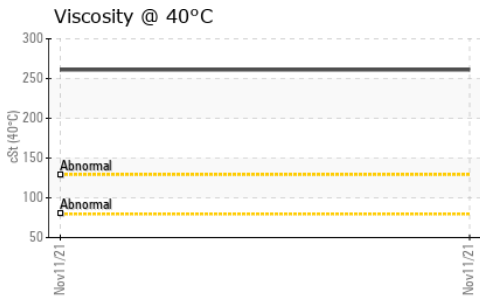

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP335323  
**Lab Number** : 05400000  
**Unique Number** : 9739150  
**Test Package** : MOB 1

**Received** : 12 Nov 2021  
**Tested** : 16 Nov 2021  
**Diagnosed** : 16 Nov 2021 - Don Baldrige

**CAROLINA EXCAVATING**  
 1036 BRANCHVIEW DR, SUITE 106  
 CONCORD, NC  
 US 28025  
 Contact: KEVIN LADGERWOOD  
 kevin@carlinaexcavation.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: