



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
[PMIAS2133091]
 Machine Id
GENERAC MD1000 8589423-A
 Component
Diesel Engine
 Fluid
DIESEL ENGINE OIL SAE 15W40 (--- QTS)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		DC0023425	---	---
Sample Date		Client Info		09 Sep 2022	---	---
Machine Age	hrs	Client Info		425	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185m	>100	2	---	---
Chromium	ppm	ASTM D5185m	>20	0	---	---
Nickel	ppm	ASTM D5185m	>4	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m	>3	0	---	---
Aluminum	ppm	ASTM D5185m	>20	0	---	---
Lead	ppm	ASTM D5185m	>40	<1	---	---
Copper	ppm	ASTM D5185m	>330	4	---	---
Tin	ppm	ASTM D5185m	>15	<1	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	5	---	---
Potassium	ppm	ASTM D5185m	>20	2	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0	---	---
Nitration	Abs/cm	*ASTM D7624	>20	6.4	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	16.6	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>158	<1	---	---
Boron	ppm	ASTM D5185m	250	6	---	---
Barium	ppm	ASTM D5185m	10	0	---	---
Molybdenum	ppm	ASTM D5185m	100	3	---	---
Manganese	ppm	ASTM D5185m		0	---	---
Magnesium	ppm	ASTM D5185m	450	50	---	---
Calcium	ppm	ASTM D5185m	3000	2450	---	---
Phosphorus	ppm	ASTM D5185m	1150	928	---	---
Zinc	ppm	ASTM D5185m	1350	1079	---	---
Sulfur	ppm	ASTM D5185m	4250	4432	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	10.7	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	8.5	8.9	---	---
Visc @ 100°C	cSt	ASTM D445	14.4	12.6	---	---

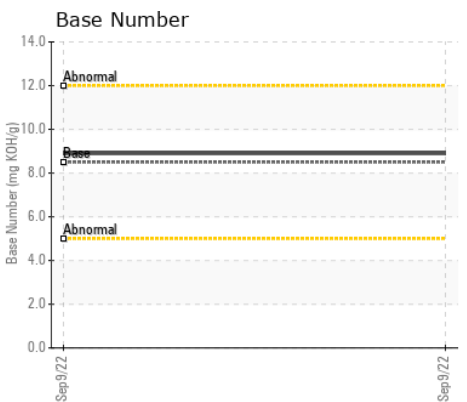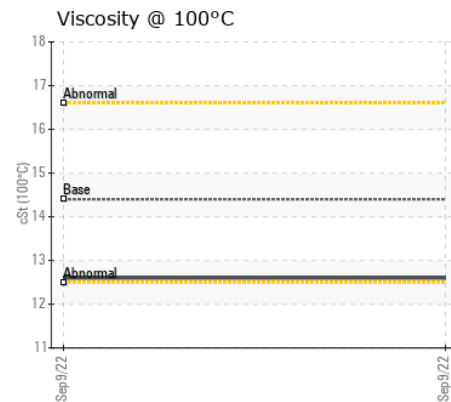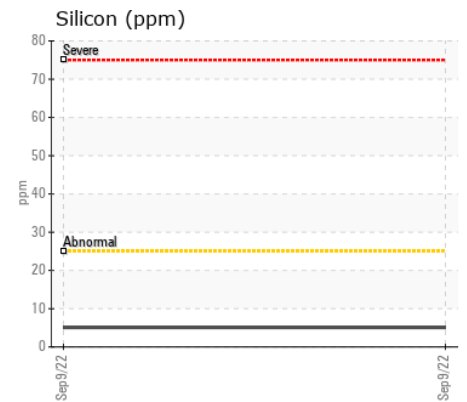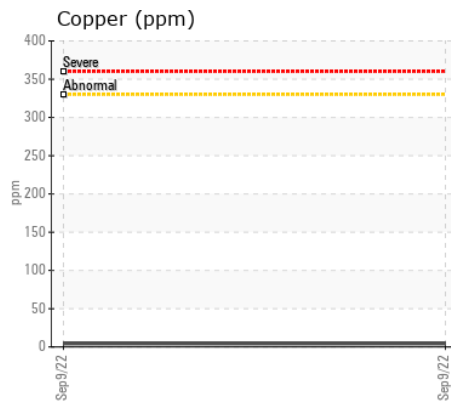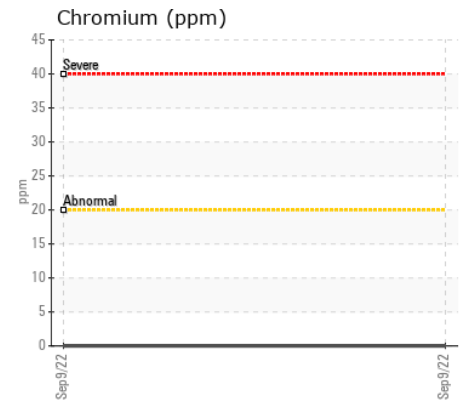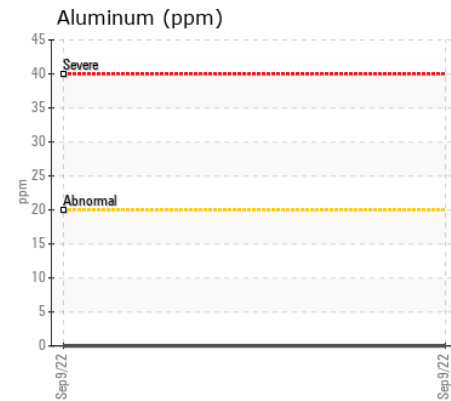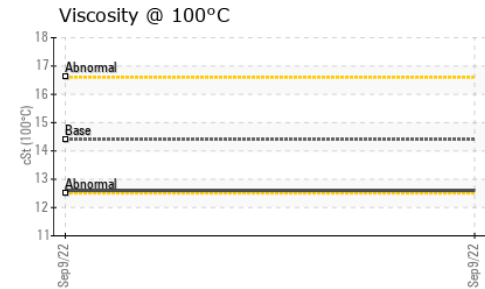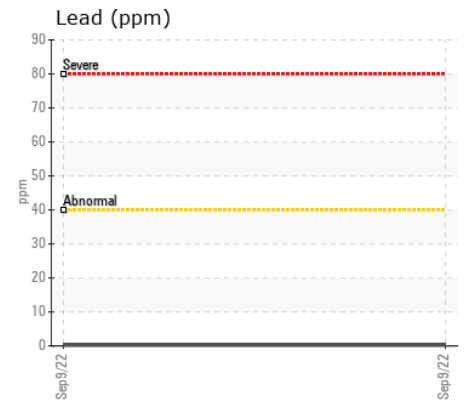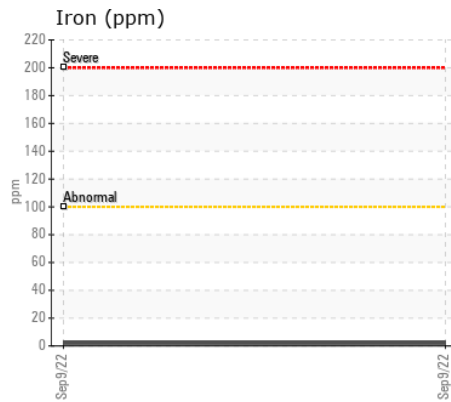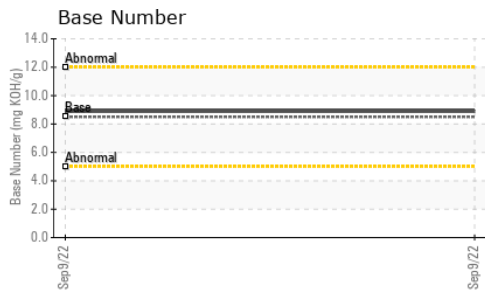

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : DC0023425
Lab Number : 05646432
Unique Number : 10140971
Test Package : MOB 1 (Additional Tests: TBN)

Received : 20 Sep 2022
Tested : 21 Sep 2022
Diagnosed : 21 Sep 2022 - Wes Davis

KELLY GENERATOR & EQUIPMENT INC
 1955 DALE LN
 OWINGS, MD
 US 20736
 Contact: LESLIE SNURR
 LSNURR@KGE.COM
 T: (410)257-5225
 F: (410)257-5227

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)