



# OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ATTENTION
FLUID CONDITION	NORMAL

Machine Id  
**JOHN DEERE 35G 293202**  
Component  
**Hydraulic System**  
Fluid  
**2905-050 (--- GAL)**

## RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>MT0005613</b>	---	---
Sample Date		Client Info		<b>14 Feb 2023</b>	---	---
Machine Age	hrs	Client Info		<b>502</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>ATTENTION</b>	---	---

## WEAR

All component wear rates are normal.

PQ		ASTM D8184		<b>12</b>	---	---
Iron	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>75	<b>2</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

## CONTAMINATION











There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185m	>20	<b>&lt;1</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>5000	<b>▲ 8854</b>	---	---
Particles >6µm		ASTM D7647	>1300	<b>▲ 1508</b>	---	---
Particles >14µm		ASTM D7647	>160	<b>80</b>	---	---
Particles >21µm		ASTM D7647	>40	<b>18</b>	---	---
Particles >38µm		ASTM D7647	>10	<b>0</b>	---	---
Particles >71µm		ASTM D7647	>3	<b>0</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>▲ 20/18/13</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---

## FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oils additive package is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>0</b>	---	---
Boron	ppm	ASTM D5185m		<b>0</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>0</b>	---	---
Manganese	ppm	ASTM D5185m		<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>5</b>	---	---
Calcium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>367</b>	---	---
Zinc	ppm	ASTM D5185m		<b>43</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>1248</b>	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.05</b>	---	---
Visc @ 40°C	cSt	ASTM D445		<b>46.0</b>	---	---

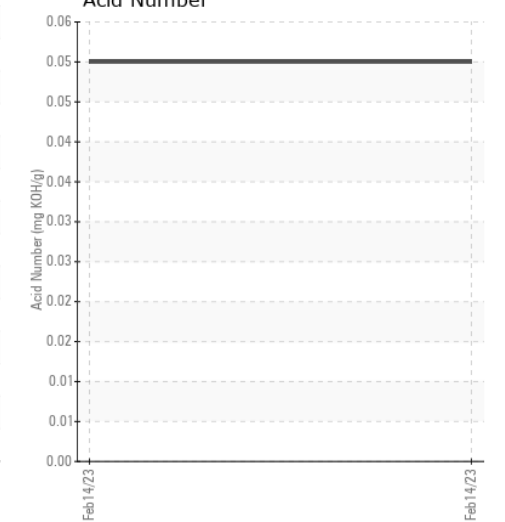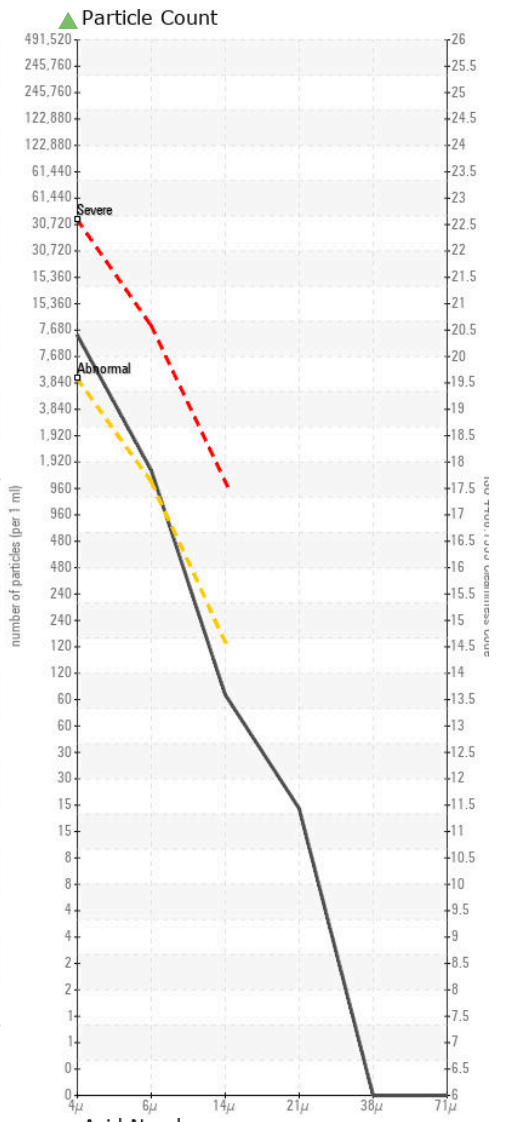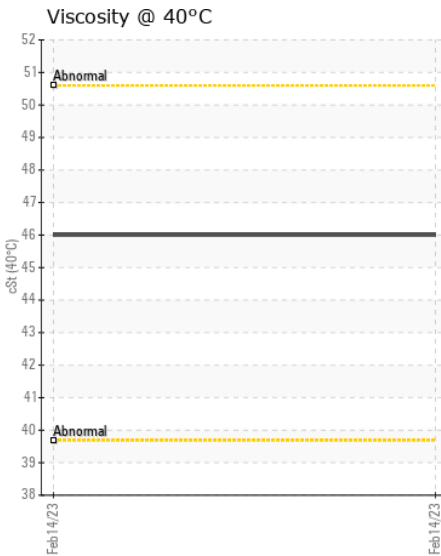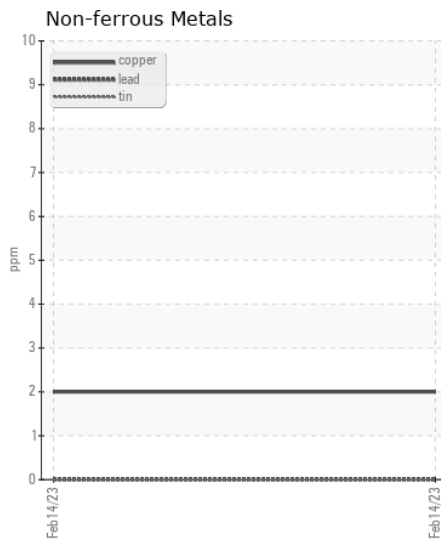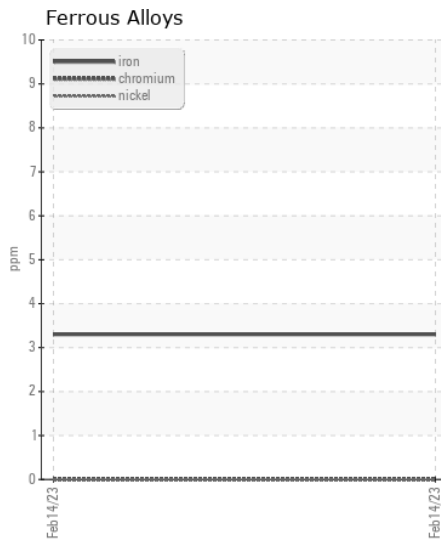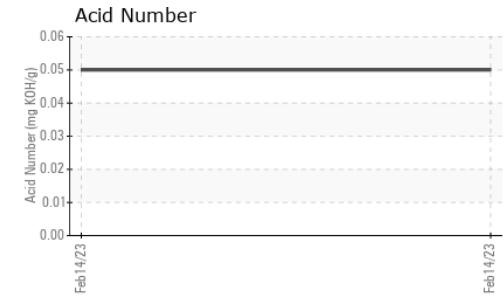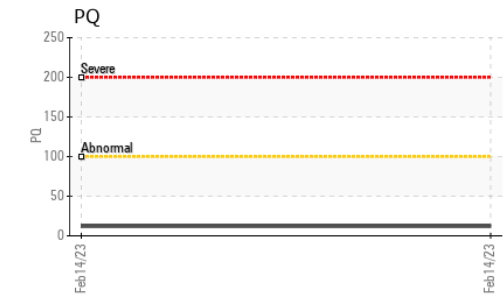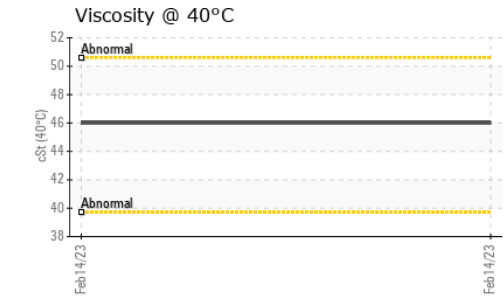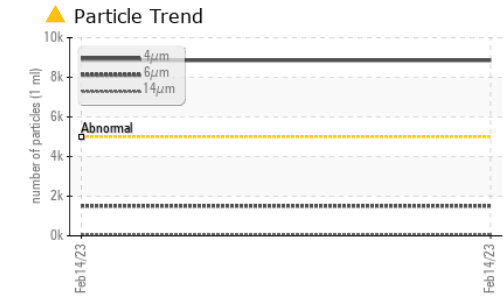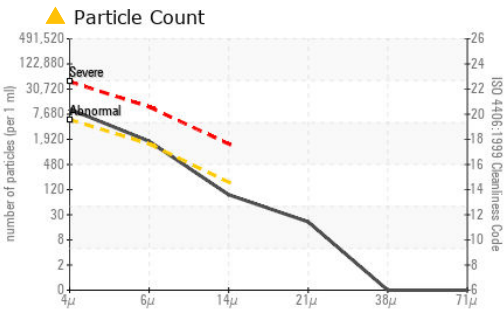

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : MT0005613 **Received** : 21 Feb 2023  
**Lab Number** : 05772754 **Diagnosed** : 27 Feb 2023  
**Unique Number** : 10347371 **Diagnostician** : Doug Bogart  
**Test Package** : MOBCE ( Additional Tests: PQ )

**MURPHY TRACTOR - CAMBRIDGE**  
 60611 HULSE DRIVE  
 CAMBRIDGE, OH  
 US 43725  
 Contact: DUSTIN DAILEY  
 DDAILEY@MURPHYTRACTOR.COM  
 T:  
 F: (740)439-2325

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)