

## SUSAN EIDE [CODY/501701] Wachine Id VOLVO PENTA 3940026444

# **Starboard IPS**

GEAR OIL SAE 75W90 (4 GAL)

	RECO	MMEN	IDATION	
--	------	------	---------	--

Resample at the next service interval to monitor.

#### **WEAR**

All component wear rates are normal.

#### **CONTAMINATION**


There is no indication of any contamination in the oil.


### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VPA045526		
Sample Date		Client Info		07 Mar 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Filter Changed		Client Info		Changed		
Sample Status				NORMAL		
<b>DO</b>				40		
PQ		ASTM D8184	000	18		
Iron	ppm	ASTM D5185m	>200	61		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m		<1		
Lead	ppm	ASTM D5185m		0		
Copper	ppm	ASTM D5185m		6		
Tin	ppm	ASTM D5185m		0		
Vanadium	ppm	ASTM D5185m		<1		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	3		
Water	le le	WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium	ppm	ASTM D5185m		2		
Boron	ppm	ASTM D5185m	400	277		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	2		
Manganese	ppm	ASTM D5185m		4		
Magnesium	ppm	ASTM D5185m	12	5		
Calcium	ppm	ASTM D5185m	150	11		
Phosphorus	ppm	ASTM D5185m	1650	1216		
Zinc	ppm	ASTM D5185m	125	0		
Sulfur	ppm	ASTM D5185m	22500	25056		
Visc @ 40°C	cSt	ASTM D445	109	107		

Contact/Location: WILLOW YANARELLA - VP794951

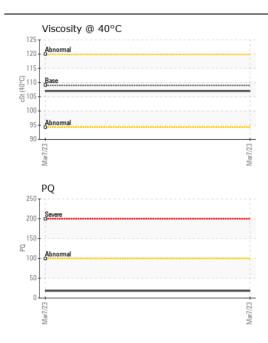

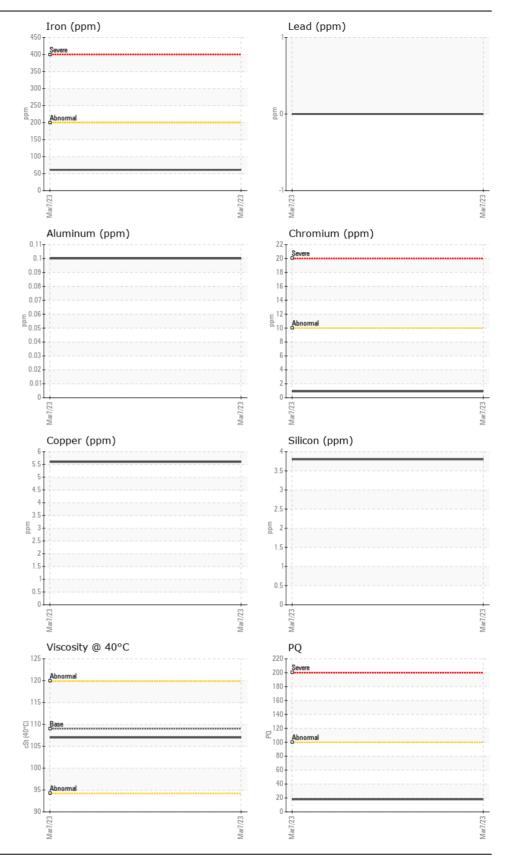

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Endor Marine LLC - Coastal Marine - 152124 Sample No. Received 4300 11th Ave. NW : VPA045526 : 16 Mar 2023 Lab Number : 05793707 Tested : 17 Mar 2023 SEATTLE, WA : 20 Mar 2023 - Sean Felton Unique Number : 10378378 US 98107 Diagnosed Test Package : MOB 1 (Additional Tests: PQ) Contact: WILLOW YANARELLA Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. service@coastalmarineengine.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (206)784-3703 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (206)784-8823

Contact/Location: WILLOW YANARELLA - VP794951