



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**CATERPILLAR 3508 CAT**  
Component  
**Starboard Diesel Engine**  
Fluid  
**CHEVRON DELO 400 SAE 30 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>KL0008793</b>	---	---
Sample Date		Client Info		<b>14 Mar 2023</b>	---	---
Machine Age	hrs	Client Info		<b>1049</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>10</b>	---	---
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m	>2	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m	>2	<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>25	<b>3</b>	---	---
Lead	ppm	ASTM D5185m	>40	<b>2</b>	---	---
Copper	ppm	ASTM D5185m	>330	<b>3</b>	---	---
Tin	ppm	ASTM D5185m	>15	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

## CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>6</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	*ASTM D7844	>3	<b>0.2</b>	---	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>7.5</b>	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>19.3</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>0</b>	---	---
Boron	ppm	ASTM D5185m		<b>363</b>	---	---
Barium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>34</b>	---	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>245</b>	---	---
Calcium	ppm	ASTM D5185m		<b>3096</b>	---	---
Phosphorus	ppm	ASTM D5185m	1160	<b>891</b>	---	---
Zinc	ppm	ASTM D5185m	1270	<b>1079</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>3659</b>	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>12.5</b>	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	10.2	<b>9</b>	---	---
Visc @ 100°C	cSt	ASTM D445	12.1	<b>11.7</b>	---	---

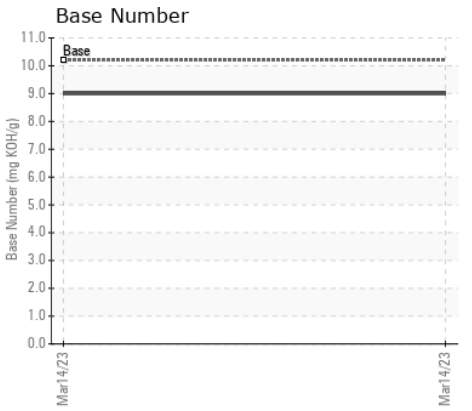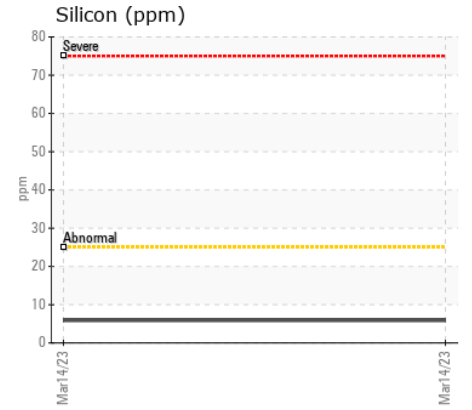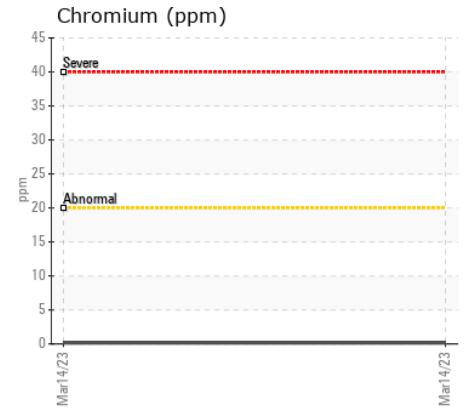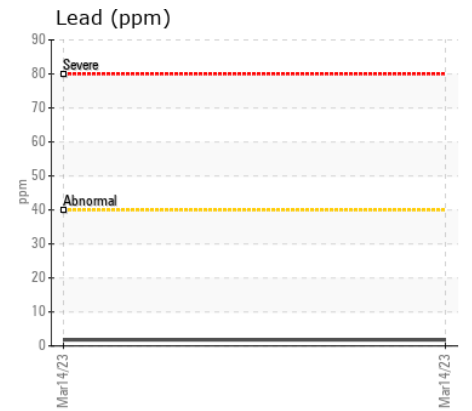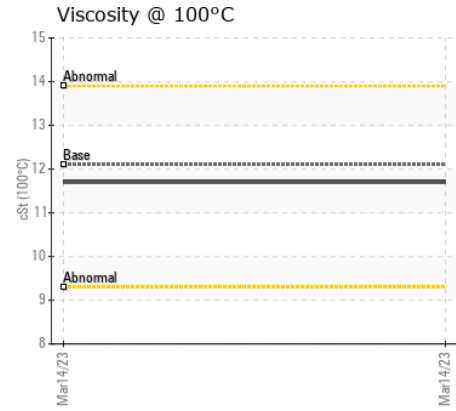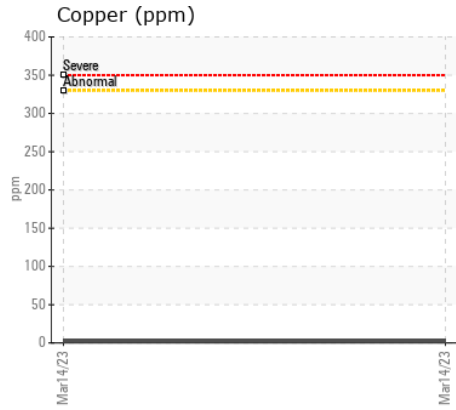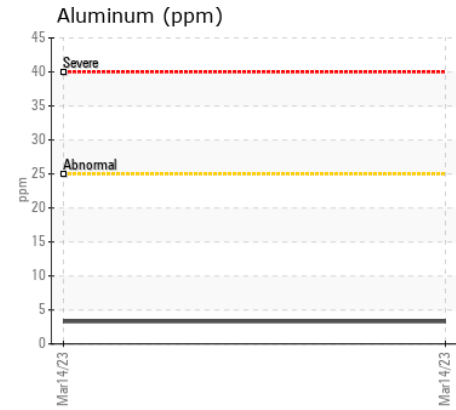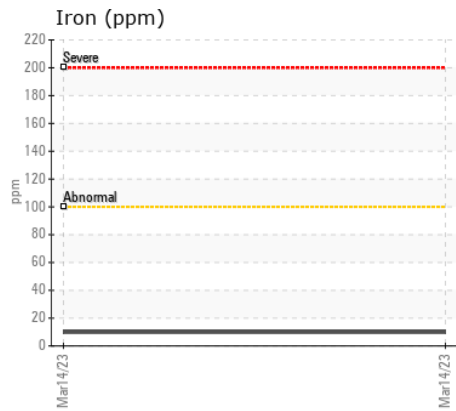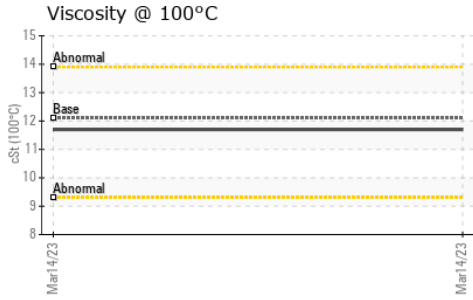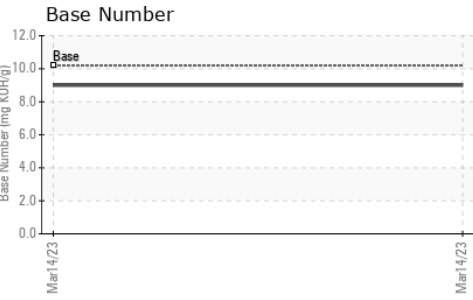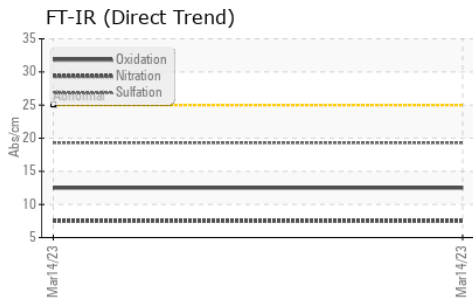

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : KL0008793  
**Lab Number** : 05806773  
**Unique Number** : 10404302  
**Test Package** : MOB1+

**Received** : 30 Mar 2023  
**Tested** : 31 Mar 2023  
**Diagnosed** : 31 Mar 2023 - Wes Davis

**VESTERAALEN LLC**  
 4225 23RD AVE WEST, SUITE 100  
 SEATTLE, WA  
 US 98199  
 Contact: TIM KING  
 tim@greatwestseafoods.com  
 T: (206)391-2773  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)