

WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**


Ascendum Machinery VOLVO A30G ORT-30 (S/N A30GV752549)


Component Rear Axle

VOLVO SUPER GEAR OIL 75W	V-80-GO102 ((7 GA	<u>.L)</u>		.,		
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		ASC0005482	VCP0000556	
	Sample Date		Client Info		12 Oct 2023	09 Jun 2022	
	Machine Age	hrs	Client Info		2594	681	
	Oil Age	hrs	Client Info		1913	681	
	Filter Age	hrs	Client Info		0	0	
	Oil Changed		Client Info		Not Changd	Changed	
	Filter Changed		Client Info		N/A	N/A	
	Sample Status				NORMAL	NORMAL	
WEAR	Iron	ppm	ASTM D5185m	>900	324	164	
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	6	5	
	Nickel	ppm	ASTM D5185m	>10	4	2	
	Titanium	ppm	ASTM D5185m		<1	<1	
	Silver	ppm	ASTM D5185m		0	0	
	Aluminum	ppm	ASTM D5185m	>30	0	<1	
	Lead	ppm	ASTM D5185m	>50	<1	<1	
	Copper	ppm	ASTM D5185m	>150	37	24	
	Tin	ppm	ASTM D5185m	>20	2	2	
	Vanadium	ppm	ASTM D5185m		0	0	
	White Metal	scalar	*Visual	NONE	NONE	MODER	
	Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	5	4	
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		4	2	
	Water	PP	WC Method		NEG	NEG	
	Silt	scalar	*Visual	NONE	NONE	NONE	
	Debris	scalar	*Visual	NONE	NONE	NONE	
	Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
	Appearance	scalar	*Visual	NORML	NORML	NORML	
	Odor	scalar	*Visual	NORML	NORML	NORML	
	Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	
FLUID CONDITION	Sodium	ppm	ASTM D5185m		<1	1	
	Boron	ppm	ASTM D5185m		234	323	
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0	0	
	Molybdenum	ppm	ASTM D5185m		8	6	
	Manganese	ppm	ASTM D5185m		15	11	
	Magnesium	ppm	ASTM D5185m		2	2	
	Calcium	ppm	ASTM D5185m		629	659	
	Phosphorus	ppm	ASTM D5185m		1278	1294	
	Zinc	ppm	ASTM D5185m		304	282	
	Sulfur	ppm	ASTM D5185m		22096	17883	
	Visc @ 40°C	cSt	ASTM D445		91.7	94.0	

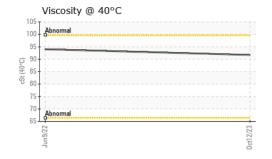

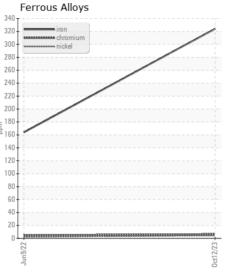

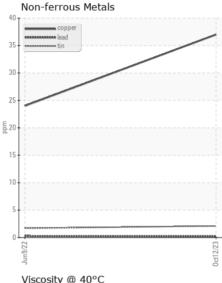

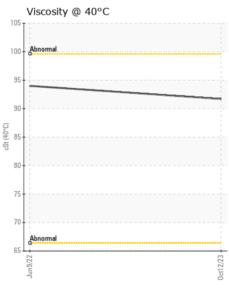





Certificate L2367

Laboratory Sample No.

Lab Number : 05978550 Unique Number : 10695845

Test Package : CONST

: ASC0005482

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 13 Oct 2023 **Tested**

: 15 Oct 2023 Diagnosed

: 17 Oct 2023 - Don Baldridge

PEDULLA EXCAVATING & PAVING

1275 SHINN FARM RD MOORESVILLE, NC US 28115

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: