**WEAR** CONTAMINATION **FLUID CONDITION** 


**NORMAL ABNORMAL NORMAL** 

Machine Id

## 015-0073 - TROLLEY

Component Gearbox

RECOMMENDATION  No corrective action is recommended at this time. Resample at the next service interval to monitor.	Test	UOM	Method	Limit/Abn	Current	History	History2
	Sample Number	UOIVI	Client Info	LIIIII/ADII	WC0868361	History1	
	Sample Date		Client Info		06 Nov 2023		
	Machine Age	hrs	Client Info		00 1407 2023		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed	0	Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ABNORMAL		
NEAD							
WEAR	Iron	ppm	ASTM D5185m		135		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		2		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m	05	0		
	Aluminum	ppm	ASTM D5185m		2		
	Lead	ppm	ASTM D5185m ASTM D5185m		<1 2		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m	>10	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	<u> </u>		
Elemental level of silicon (Si) above normal indicating ingress of dirt/seal material.	Potassium	ppm	ASTM D5185m	>20	3		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	MODER		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance Odor	scalar	*Visual	NORML NORML	NORML NORML		
	Emulsified Water	scalar		>0.2	NEG		
	Linuisineu water		*Visual	>0.2			
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		5		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		2		
	Manganese	ppm	ASTM D5185m		3		
	Magnesium	ppm	ASTM D5185m		1		
	Calcium	ppm	ASTM D5185m		21		
	Phosphorus	ppm	ASTM D5185m		233		
	Zinc	ppm	ASTM D5185m		45		
	Sulfur	ppm	ASTM D5185m		23708		

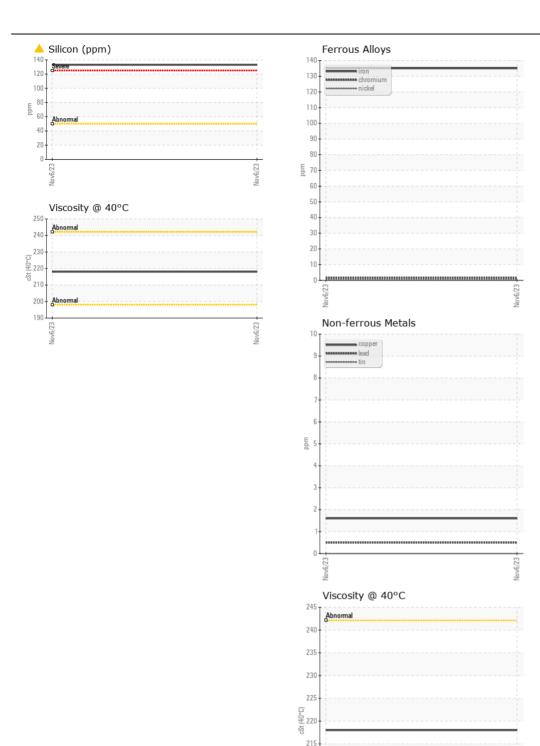





Certificate L2367

Laboratory Sample No.

: WC0868361 Lab Number : 06014664 Unique Number : 10753808 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Nov 2023 **Tested** : 23 Nov 2023

Diagnosed : 24 Nov 2023 - Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

205

195

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

SHIMMICK CONSTRUCTION

5535 TRAILHEAD DRIVE CHATTANOOGA, TN US 37415

Contact: DANIEL LISELLA daniel.lisella@shimmick.com

T:

Contact/Location: DANIEL LISELLA - AECCHATN