



VOLVO

OIL ANALYSIS REPORT

WEAR**NORMAL****CONTAMINATION****ABNORMAL****FLUID CONDITION****ABNORMAL**

Machine Id
VOLVO A40G 342661
Component
Diesel Engine
Fluid
{not provided} (--- GAL)

RECOMMENDATION

No corrective action is recommended at this time. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP0008128	---	---
Sample Date		Client Info		21 Dec 2023	---	---
Machine Age	hrs	Client Info		4650	---	---
Oil Age	hrs	Client Info		4650	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				ABNORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	3	---	---
Chromium	ppm	ASTM D5185m	>20	<1	---	---
Nickel	ppm	ASTM D5185m	>2	0	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m	>2	0	---	---
Aluminum	ppm	ASTM D5185m	>25	<1	---	---
Lead	ppm	ASTM D5185m	>40	0	---	---
Copper	ppm	ASTM D5185m	>330	11	---	---
Tin	ppm	ASTM D5185m	>15	<1	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION












Sodium and/or potassium levels are high. Test for glycol is negative.

Silicon	ppm	ASTM D5185m	>25	6	---	---
Potassium	ppm	ASTM D5185m	>20	▲ 70	---	---
Fuel		WC Method	>6.0	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol	%	*ASTM D2982		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.1	---	---
Nitration	Abs/cm	*ASTM D7624	>20	4.9	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	17.5	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		▲ 55	---	---
Boron	ppm	ASTM D5185m		7	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		57	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m		863	---	---
Calcium	ppm	ASTM D5185m		1164	---	---
Phosphorus	ppm	ASTM D5185m		1002	---	---
Zinc	ppm	ASTM D5185m		1218	---	---
Sulfur	ppm	ASTM D5185m		3269	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	12.7	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		10.1	---	---
Visc @ 100°C	cSt	ASTM D445		14.0	---	---

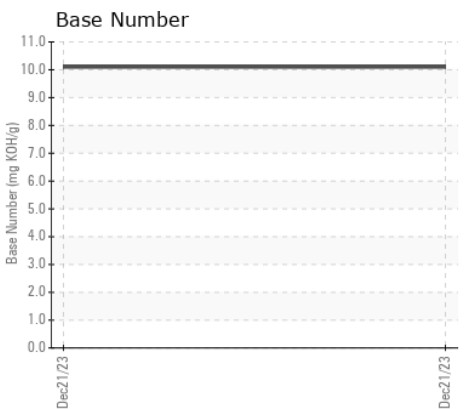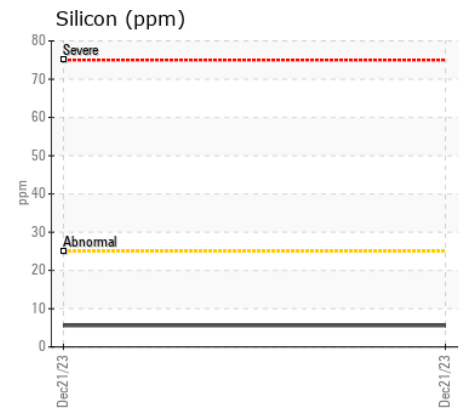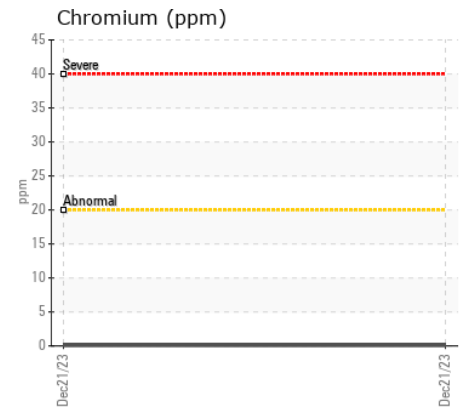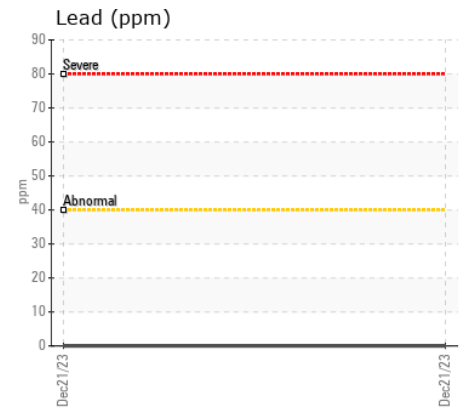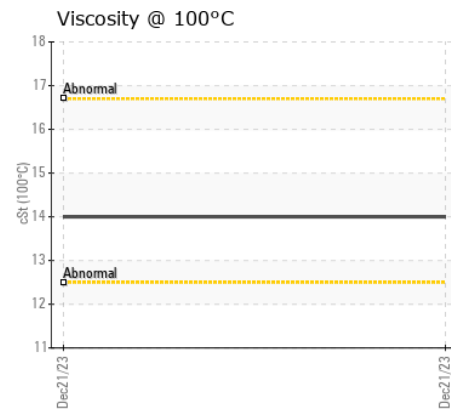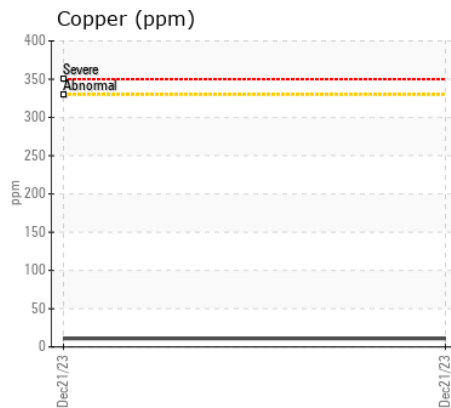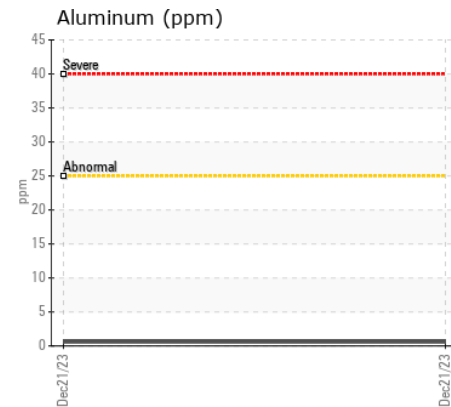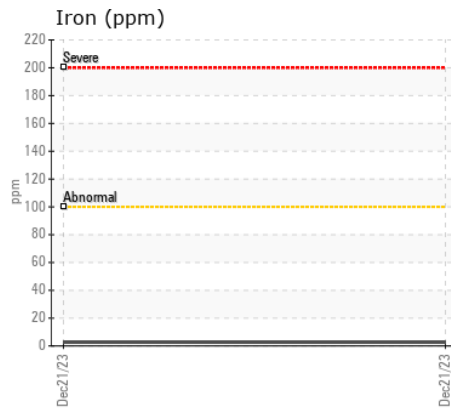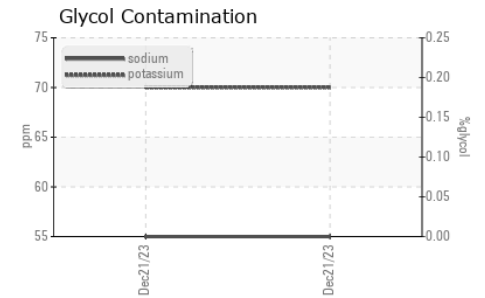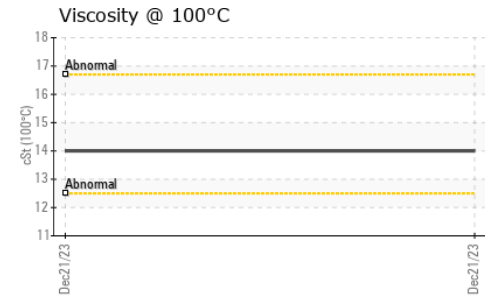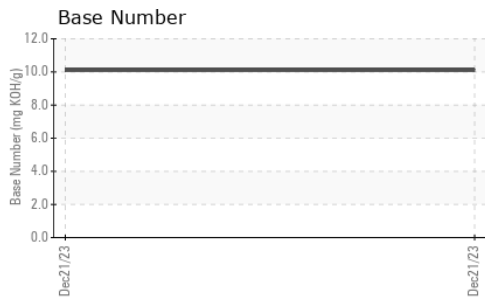

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP0008128 **Received** : 29 Dec 2023
Lab Number : 06048155 **Tested** : 03 Jan 2024
Unique Number : 10808763 **Diagnosed** : 03 Jan 2024 - Jonathan Hester
Test Package : MOBCE (Additional Tests: Glycol, TBN)

ALTA EQUIPMENT COMPANY
 8750 PHILIPS HWY
 JACKSONVILLE, FL
 US 32256

Contact: TECHNICIAN ACCOUNT
 catherine.anastasio@wearcheck.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (904)737-1260