



VOLVO

OIL ANALYSIS REPORT

| | |
|-----------------|--------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |



Machine Id
VOLVO A40G 342661
Component
Bogie/Center Axle
Fluid
{not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.










CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|------------------|--------|-------------|-----------|-------------|----------|----------|
| Sample Number | | Client Info | | VCP0008131 | --- | --- |
| Sample Date | | Client Info | | 21 Dec 2023 | --- | --- |
| Machine Age | hrs | Client Info | | 4650 | --- | --- |
| Oil Age | hrs | Client Info | | 4650 | --- | --- |
| Filter Age | hrs | Client Info | | 0 | --- | --- |
| Oil Changed | | Client Info | | N/A | --- | --- |
| Filter Changed | | Client Info | | N/A | --- | --- |
| Sample Status | | | | NORMAL | --- | --- |
| Iron | ppm | ASTM D5185m | >900 | 48 | --- | --- |
| Chromium | ppm | ASTM D5185m | >20 | <1 | --- | --- |
| Nickel | ppm | ASTM D5185m | >10 | <1 | --- | --- |
| Titanium | ppm | ASTM D5185m | | 0 | --- | --- |
| Silver | ppm | ASTM D5185m | | 0 | --- | --- |
| Aluminum | ppm | ASTM D5185m | >30 | <1 | --- | --- |
| Lead | ppm | ASTM D5185m | >50 | 0 | --- | --- |
| Copper | ppm | ASTM D5185m | >150 | 2 | --- | --- |
| Tin | ppm | ASTM D5185m | >20 | 0 | --- | --- |
| Vanadium | ppm | ASTM D5185m | | 0 | --- | --- |
| White Metal | scalar | *Visual | NONE | NONE | --- | --- |
| Yellow Metal | scalar | *Visual | NONE | NONE | --- | --- |
| Silicon | ppm | ASTM D5185m | >50 | 4 | --- | --- |
| Potassium | ppm | ASTM D5185m | >20 | 1 | --- | --- |
| Water | | WC Method | >0.2 | NEG | --- | --- |
| Silt | scalar | *Visual | NONE | NONE | --- | --- |
| Debris | scalar | *Visual | NONE | NONE | --- | --- |
| Sand/Dirt | scalar | *Visual | NONE | NONE | --- | --- |
| Appearance | scalar | *Visual | NORML | NORML | --- | --- |
| Odor | scalar | *Visual | NORML | NORML | --- | --- |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | --- | --- |
| Sodium | ppm | ASTM D5185m | | 2 | --- | --- |
| Boron | ppm | ASTM D5185m | | 190 | --- | --- |
| Barium | ppm | ASTM D5185m | | 0 | --- | --- |
| Molybdenum | ppm | ASTM D5185m | | 0 | --- | --- |
| Manganese | ppm | ASTM D5185m | | <1 | --- | --- |
| Magnesium | ppm | ASTM D5185m | | 3 | --- | --- |
| Calcium | ppm | ASTM D5185m | | 67 | --- | --- |
| Phosphorus | ppm | ASTM D5185m | | 1104 | --- | --- |
| Zinc | ppm | ASTM D5185m | | 21 | --- | --- |
| Sulfur | ppm | ASTM D5185m | | 29486 | --- | --- |
| Visc @ 40°C | cSt | ASTM D445 | | 321 | --- | --- |

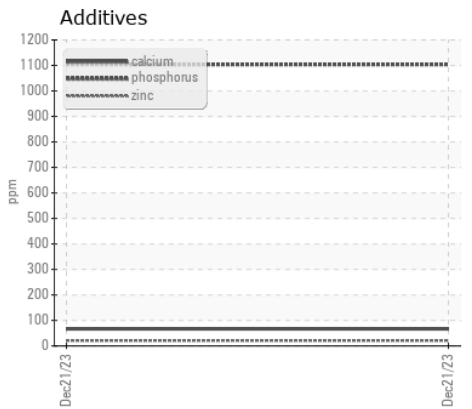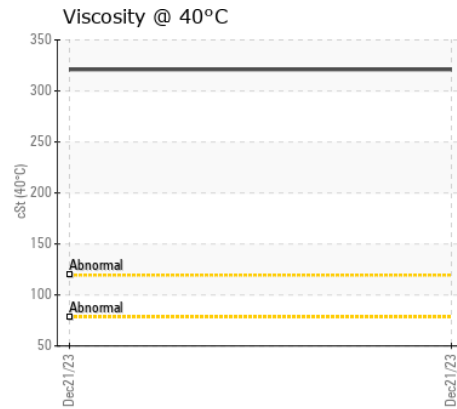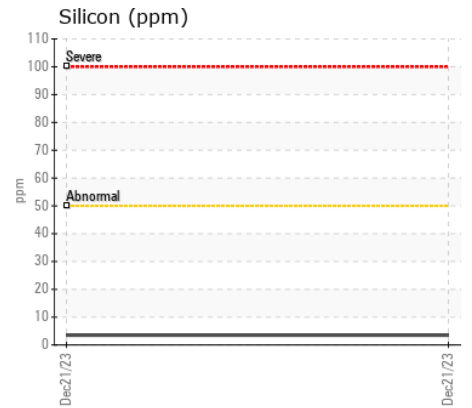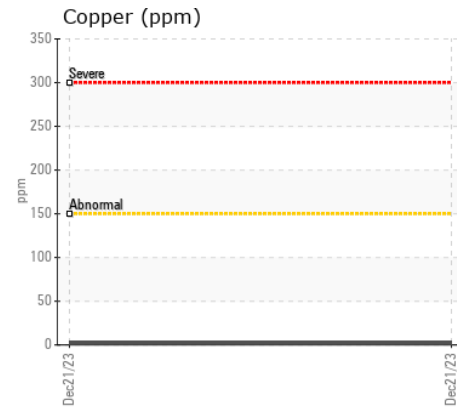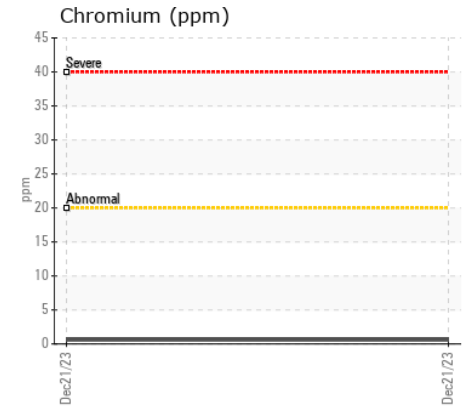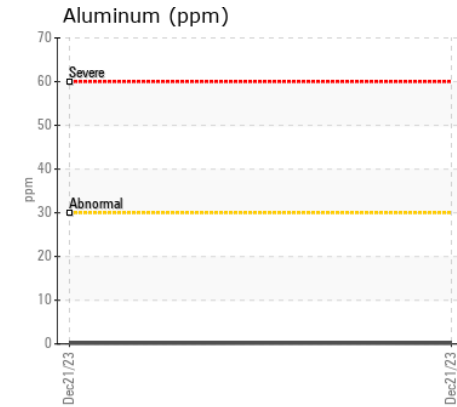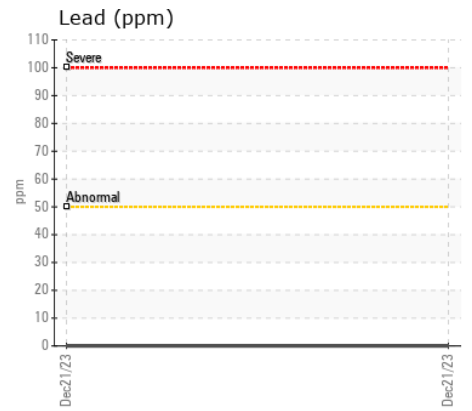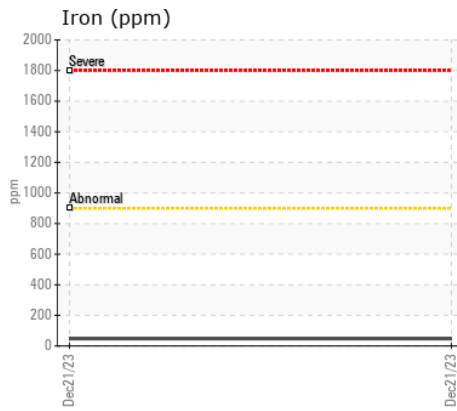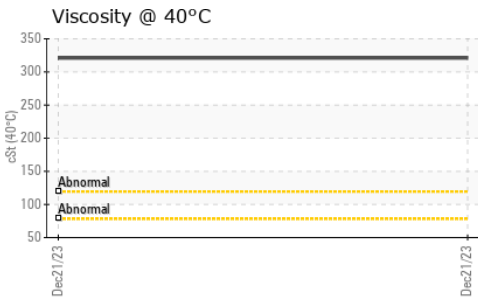

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513

Sample No. : VCP0008131

Lab Number : 06048470

Unique Number : 10809078

Test Package : MOBCE

Received : 29 Dec 2023

Tested : 02 Jan 2024

Diagnosed : 03 Jan 2024 - Don Baldrige

ALTA EQUIPMENT COMPANY

8750 PHILIPS HWY

JACKSONVILLE, FL

US 32256

Contact: TECHNICIAN ACCOUNT

catherine.anastasio@wearcheck.com

T:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (904)737-1260