



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[RSO036579]**  
Machine Id  
**VOLVO A45G 352532**  
Component  
**Front Axle**  
Fluid  
**COWIN 80W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP430860</b>	---	---
Sample Date		Client Info		<b>02 Jan 2024</b>	---	---
Machine Age	hrs	Client Info		<b>5101</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>162</b>	---	---
Chromium	ppm	ASTM D5185m	>20	<b>2</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>30	<b>2</b>	---	---
Lead	ppm	ASTM D5185m	>50	<b>&lt;1</b>	---	---
Copper	ppm	ASTM D5185m	>150	<b>1</b>	---	---
Tin	ppm	ASTM D5185m	>20	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>MODER</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>4</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>0</b>	---	---
Boron	ppm	ASTM D5185m		<b>208</b>	---	---
Barium	ppm	ASTM D5185m		<b>7</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>7</b>	---	---
Manganese	ppm	ASTM D5185m		<b>6</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>25</b>	---	---
Calcium	ppm	ASTM D5185m		<b>80</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>1016</b>	---	---
Zinc	ppm	ASTM D5185m		<b>60</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>23108</b>	---	---
Visc @ 40°C	cSt	ASTM D445		<b>132</b>	---	---

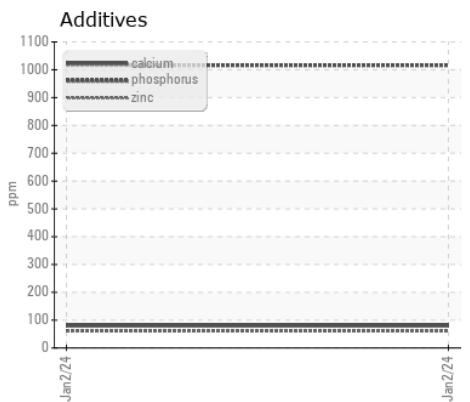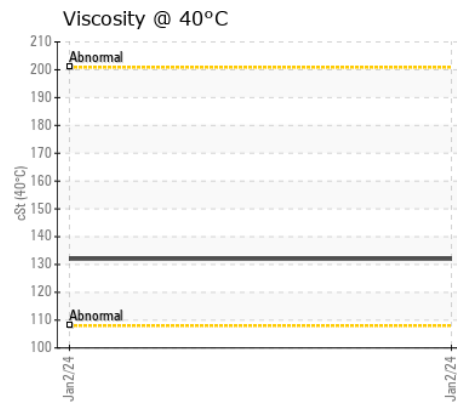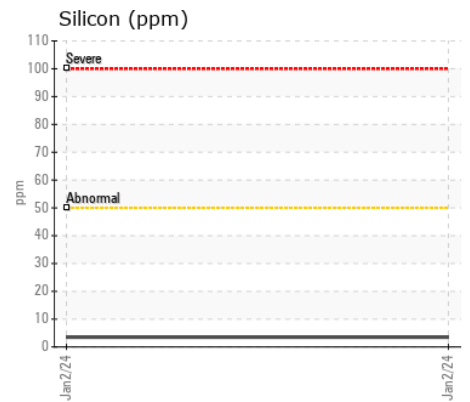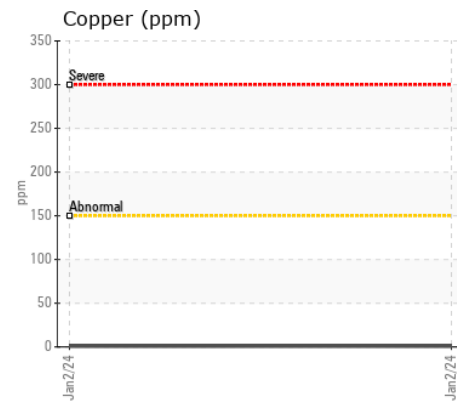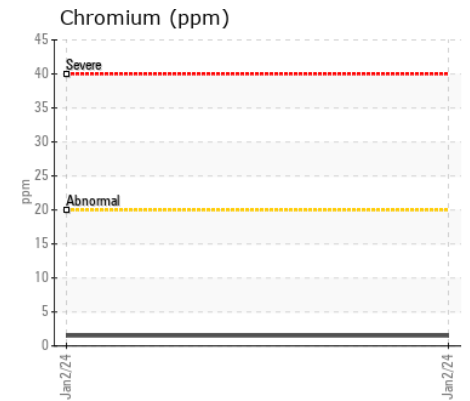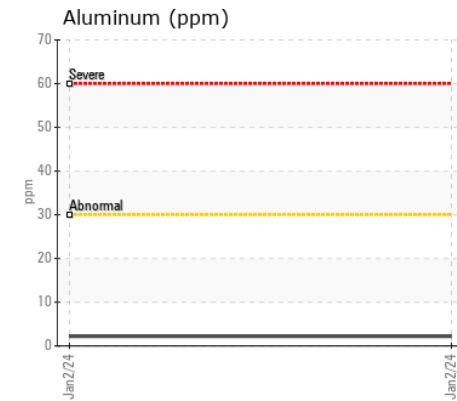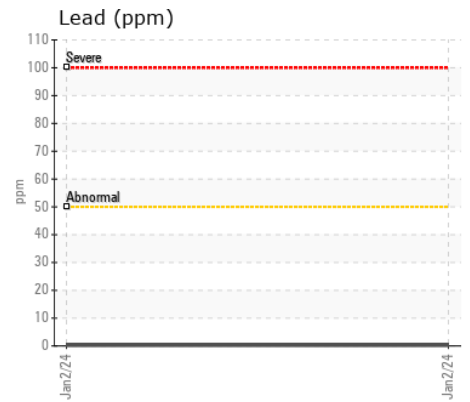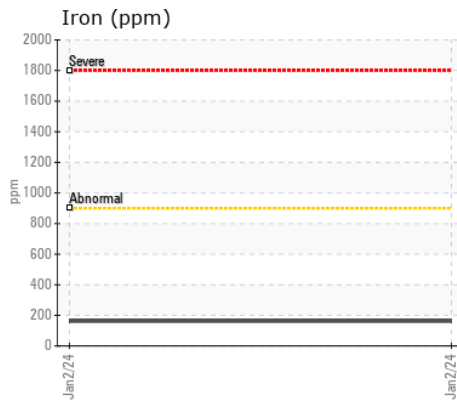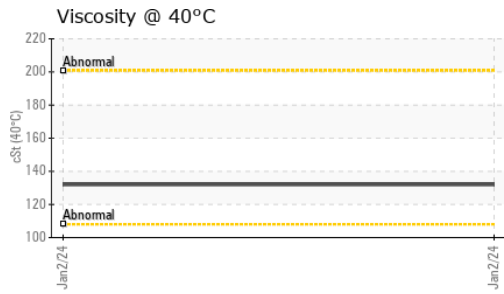

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
 Sample No. : VCP430860 Recieved : 08 Jan 2024  
 Lab Number : 06054362 Diagnosed : 09 Jan 2024  
 Unique Number : 10820311 Diagnostician : Wes Davis  
 Test Package : MOB 1

**COWIN EQUIPMENT COMPANY**  
 7950 PITTMAN AVE  
 PENSACOLA, FL  
 US 32534  
 Contact: HUGH DOBBS  
 HDOBBS@COWIN.COM  
 T: (850)479-3004  
 F: (850)474-1602

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)