

Area  
**KEMP QUARRIES / RIVER VALLEY BACKBONE**

Machine Id  
**WL079**

Component  
**Transmission (Manual)**

Fluid  
**MOBIL MOBILTRANS HD 30 (--- GAL)**

**RECOMMENDATION**

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PCA0084783</b>	PCA0085849	PCA0085851
Sample Date		Client Info		<b>28 Dec 2023</b>	13 Oct 2023	09 Aug 2023
Machine Age	hrs	Client Info		<b>48609</b>	48226	47885
Oil Age	hrs	Client Info		<b>383</b>	1200	900
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changd</b>	Changed	Not Changd
Filter Changed		Client Info		<b>Not Changd</b>	Changed	Not Changd
Sample Status				<b>ABNORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>200	<b>3</b>	<1	4
Chromium	ppm	ASTM D5185m	>5	<b>&lt;1</b>	<1	0
Nickel	ppm	ASTM D5185m	>5	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Silver	ppm	ASTM D5185m	>7	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>25	<b>2</b>	2	2
Lead	ppm	ASTM D5185m	>45	<b>&lt;1</b>	<1	<1
Copper	ppm	ASTM D5185m	>225	<b>2</b>	2	1
Tin	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	LIGHT	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**











There is a light concentration of water present in the fluid.

Silicon	ppm	ASTM D5185m	>125	<b>6</b>	6	6
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	2	1
Water	%	ASTM D6304	>0.1	<b>▲ 0.184</b>	---	---
ppm Water	ppm	ASTM D6304	>1000	<b>▲ 1840</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>0.2%</b>	NEG	NEG

**FLUID CONDITION**

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>0</b>	0	0
Boron	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Barium	ppm	ASTM D5185m		<b>0</b>	9	0
Molybdenum	ppm	ASTM D5185m		<b>1</b>	<1	1
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Magnesium	ppm	ASTM D5185m		<b>15</b>	15	19
Calcium	ppm	ASTM D5185m		<b>3307</b>	3285	3258
Phosphorus	ppm	ASTM D5185m		<b>939</b>	901	921
Zinc	ppm	ASTM D5185m		<b>1149</b>	1126	1106
Sulfur	ppm	ASTM D5185m		<b>4369</b>	4349	3681
Visc @ 40°C	cSt	ASTM D445	100	<b>84.5</b>	85.7	84.8

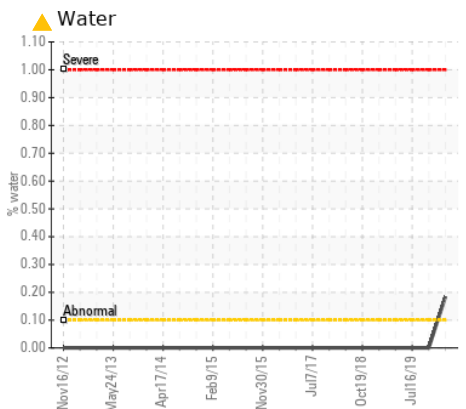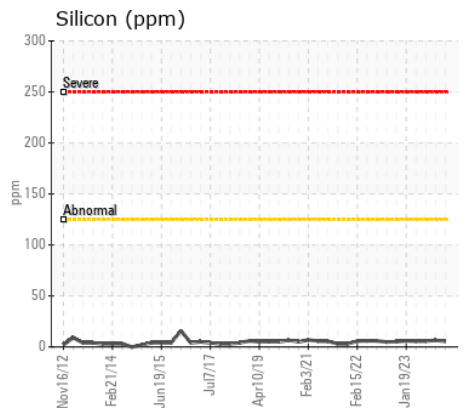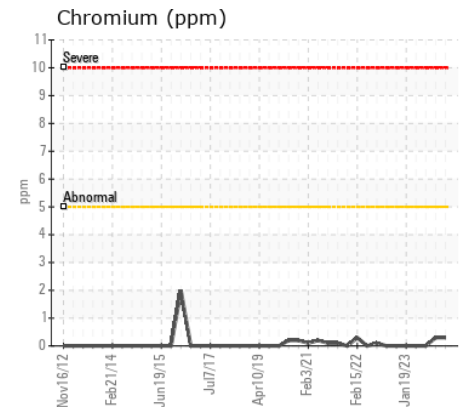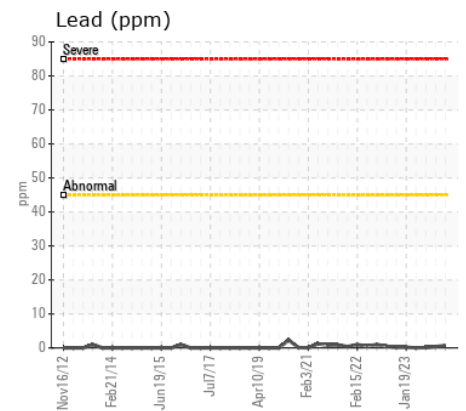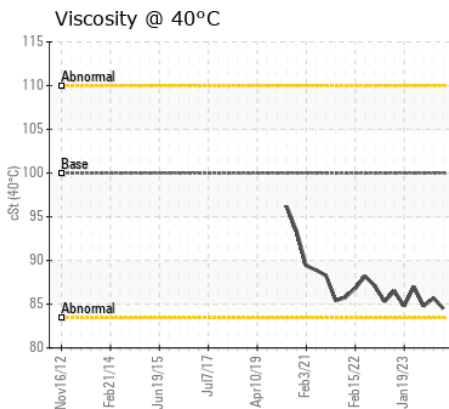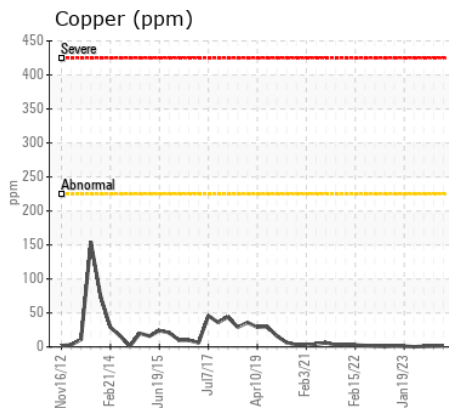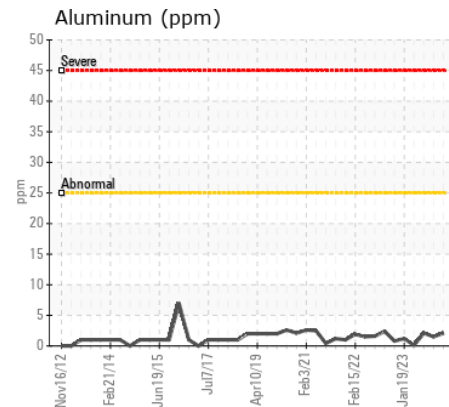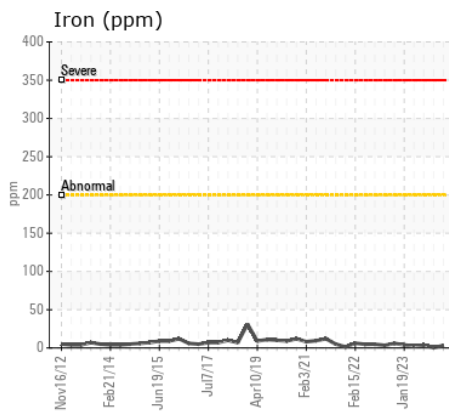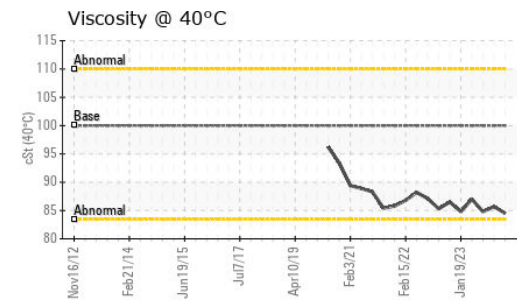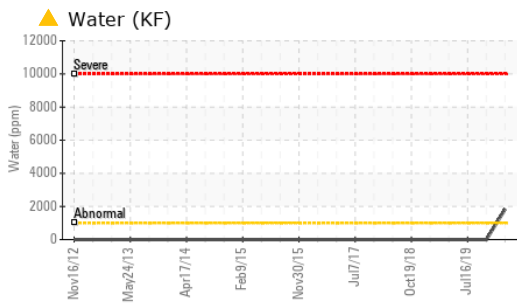

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : PCA0084783 **Received** : 08 Jan 2024  
**Lab Number** : 06054445 **Diagnosed** : 10 Jan 2024  
**Unique Number** : 10820394 **Diagnostician** : Jonathan Hester  
**Test Package** : MOB 1 ( Additional Tests: KF )

**Kemp Quarries - River Valley - Backbone**  
 5600 S Hwy 253  
 Huntington, AR  
 US 72940  
 Contact:  
 backbone@rivervalleyquarries.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)