



PacLease

# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**857-4216**  
 Component  
**Diesel Engine**  
 Fluid  
**CHEVRON DELO 400 SAE 10W30 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>RPL0014048</b>	RPL0005134	---
Sample Date		Client Info		<b>11 Dec 2023</b>	21 Dec 2022	---
Machine Age	hrs	Client Info		<b>9674</b>	138222	---
Oil Age	hrs	Client Info		<b>0</b>	0	---
Filter Age	hrs	Client Info		<b>0</b>	0	---
Oil Changed		Client Info		<b>N/A</b>	Changed	---
Filter Changed		Client Info		<b>N/A</b>	Changed	---
Sample Status				<b>NORMAL</b>	ABNORMAL	---

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>61</b>	▲ 103	---
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	---
Nickel	ppm	ASTM D5185m	>4	<b>0</b>	<1	---
Titanium	ppm	ASTM D5185m		<b>0</b>	0	---
Silver	ppm	ASTM D5185m	>3	<b>0</b>	0	---
Aluminum	ppm	ASTM D5185m	>20	<b>5</b>	9	---
Lead	ppm	ASTM D5185m	>40	<b>0</b>	<1	---
Copper	ppm	ASTM D5185m	>330	<b>6</b>	8	---
Tin	ppm	ASTM D5185m	>15	<b>0</b>	<1	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---

## CONTAMINATION







There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>6</b>	7	---
Potassium	ppm	ASTM D5185m	>20	<b>13</b>	19	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	---
Water		WC Method	>0.2	<b>NEG</b>	NEG	---
Glycol		WC Method		<b>NEG</b>	NEG	---
Soot %	%	*ASTM D7844	>3	<b>0.5</b>	0.8	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>12.0</b>	14.5	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>26.1</b>	30.2	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	---

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>3</b>	4	---
Boron	ppm	ASTM D5185m		<b>24</b>	16	---
Barium	ppm	ASTM D5185m		<b>0</b>	0	---
Molybdenum	ppm	ASTM D5185m		<b>17</b>	8	---
Manganese	ppm	ASTM D5185m		<b>0</b>	<1	---
Magnesium	ppm	ASTM D5185m		<b>732</b>	689	---
Calcium	ppm	ASTM D5185m		<b>1430</b>	1439	---
Phosphorus	ppm	ASTM D5185m	1260	<b>748</b>	718	---
Zinc	ppm	ASTM D5185m	1400	<b>867</b>	887	---
Sulfur	ppm	ASTM D5185m		<b>3151</b>	3178	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>23.1</b>	29.6	---
Base Number (BN)	mg KOH/g	ASTM D2896	10.1	<b>4.9</b>	3.9	---
Visc @ 100°C	cSt	ASTM D445	11.1	<b>12.3</b>	▲ 13.6	---

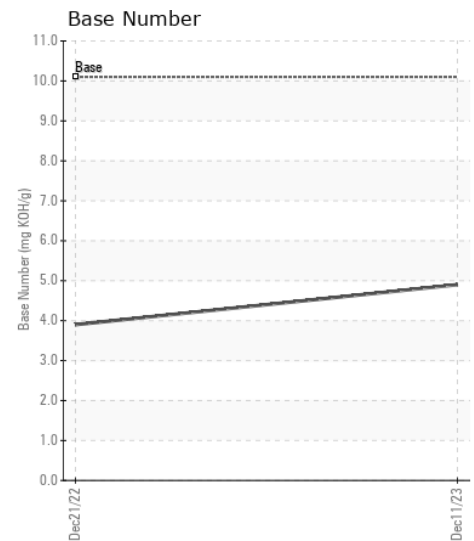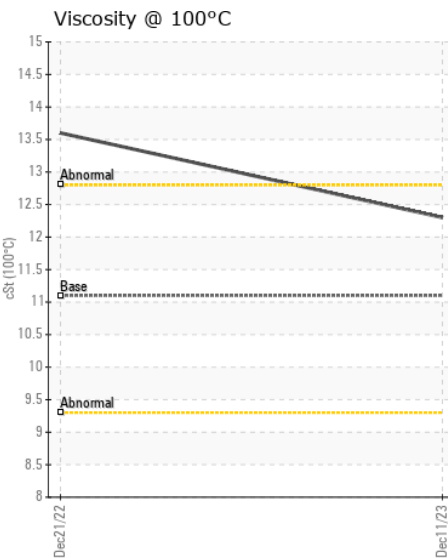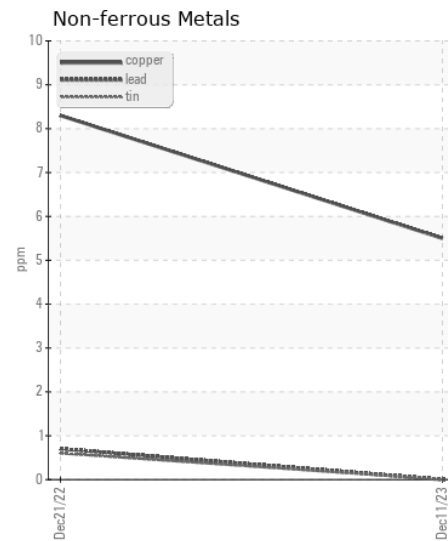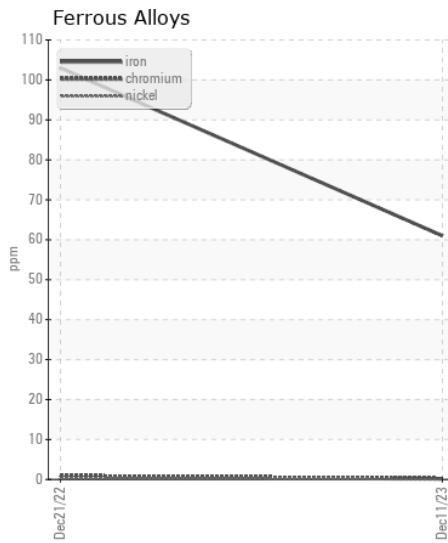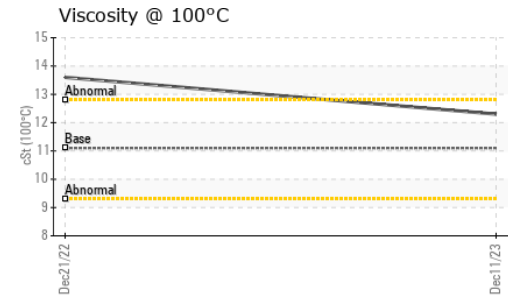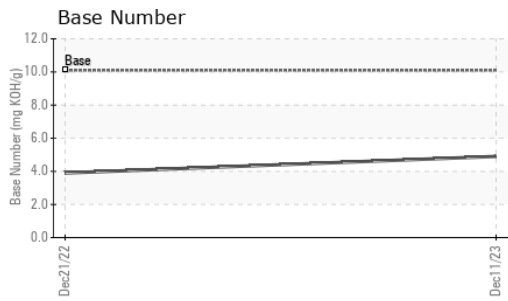

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : RPL0014048 **Received** : 10 Jan 2024  
**Lab Number** : 06056225 **Diagnosed** : 11 Jan 2024  
**Unique Number** : 10822174 **Diagnostician** : Wes Davis  
**Test Package** : FLEET

**RTL PACLEASE - 7001 - Houston**  
 6300 N. Loop East  
 Houston, TX  
 US 77026  
 Contact: RODNEY BRIGGS  
 briggsr@rushenterprises.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: