



# VOLVO

## OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area  
**[9465]**  
Machine Id  
**3424016 VOLVO L35G 3424016**  
Component  
**Hydraulic System**  
Fluid  
**VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP438149	VCP396667	VCP376954
Sample Date		Client Info		08 Jan 2024	10 Mar 2023	27 Jul 2022
Machine Age	hrs	Client Info		8828	7996	7458
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Filter Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	7	7	7
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	2	1	1
Lead	ppm	ASTM D5185m	>20	<1	0	0
Copper	ppm	ASTM D5185m	>150	1	1	1
Tin	ppm	ASTM D5185m	>20	<1	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

### CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	3	3	2
Potassium	ppm	ASTM D5185m	>20	1	0	0
Water		WC Method	>0.1	NEG	NEG	NEG
Particles >4µm		ASTM D7647		10249	1005	1302
Particles >6µm		ASTM D7647	>2500	721	201	180
Particles >14µm		ASTM D7647	>80	22	20	27
Particles >21µm		ASTM D7647	>20	4	5	10
Particles >38µm		ASTM D7647	>4	0	0	0
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>-/18/13	21/17/12	17/15/11	18/15/12
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		0	2	2
Boron	ppm	ASTM D5185m	14	0	<1	0
Barium	ppm	ASTM D5185m	0.0	0	0	2
Molybdenum	ppm	ASTM D5185m	0.0	3	5	7
Manganese	ppm	ASTM D5185m	0.0	0	0	0
Magnesium	ppm	ASTM D5185m	2.6	5	5	7
Calcium	ppm	ASTM D5185m	49	66	82	93
Phosphorus	ppm	ASTM D5185m	354	352	317	329
Zinc	ppm	ASTM D5185m	419	414	381	411
Sulfur	ppm	ASTM D5185m	3719	1964	1941	1888
Acid Number (AN)	mg KOH/g	ASTM D8045		0.39	0.35	0.39
Visc @ 40°C	cSt	ASTM D445	46	48.2	44.8	42.5

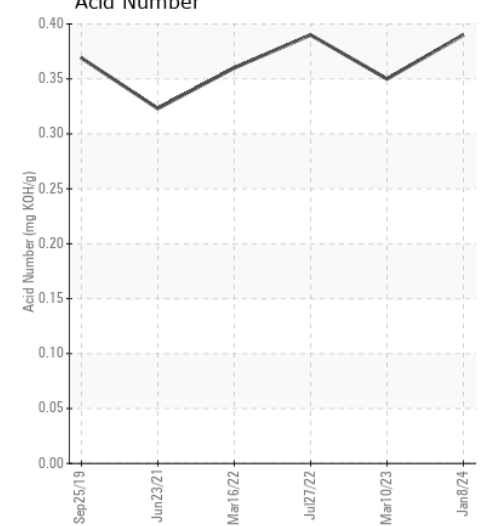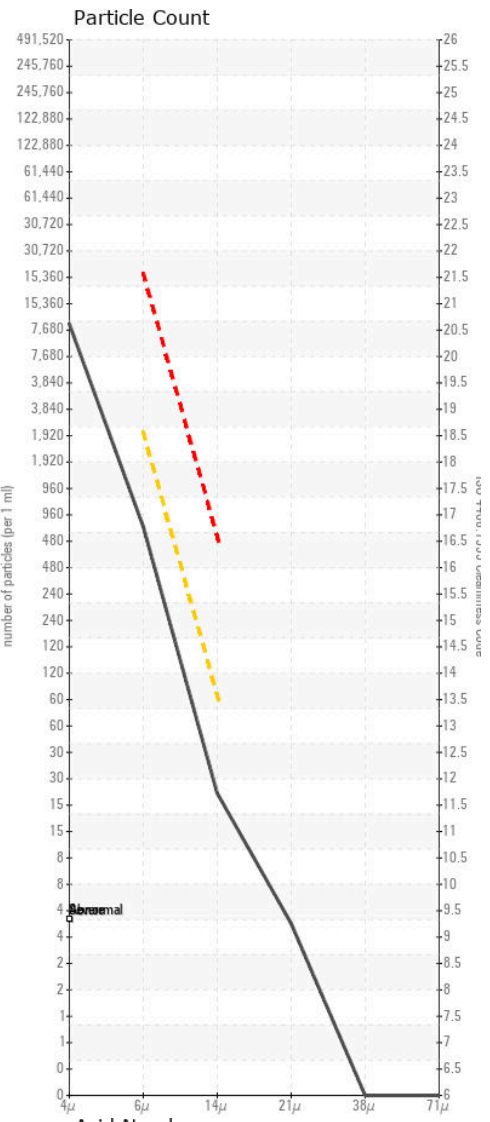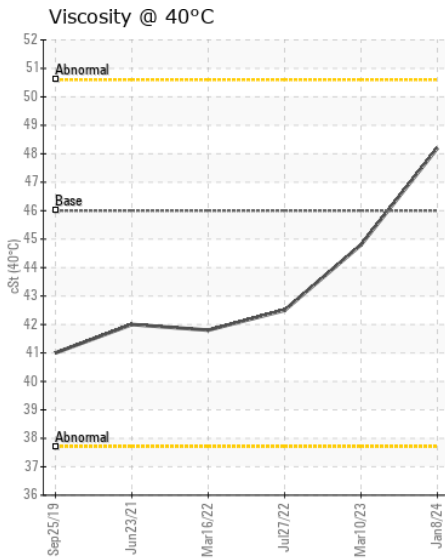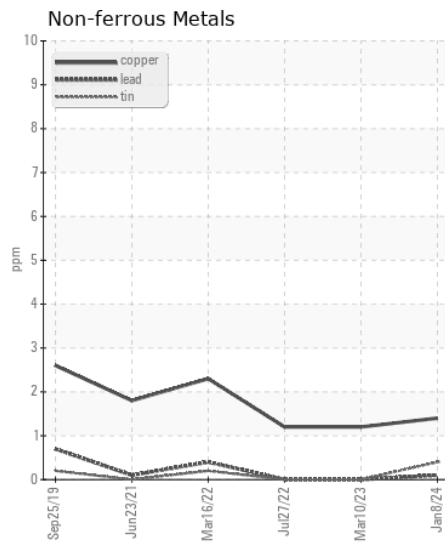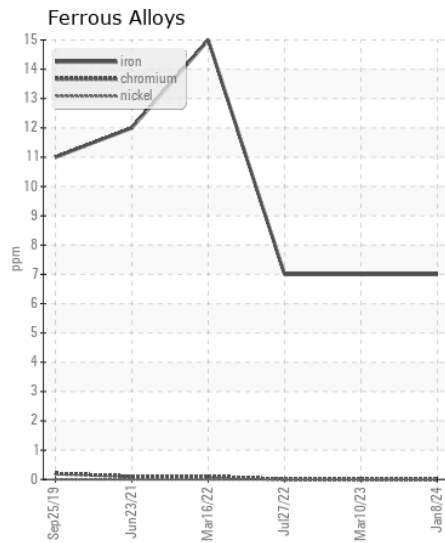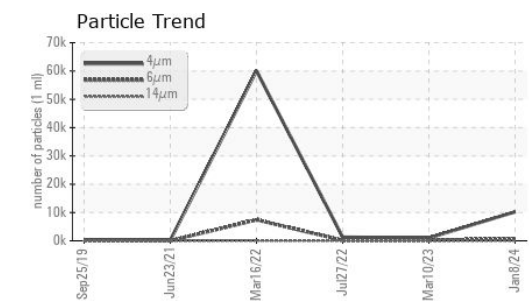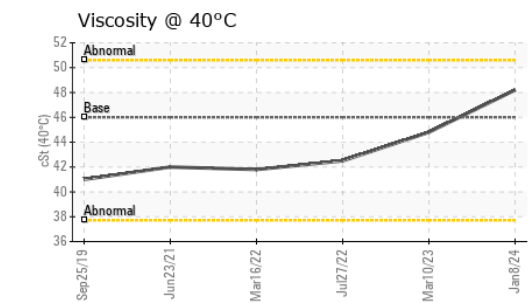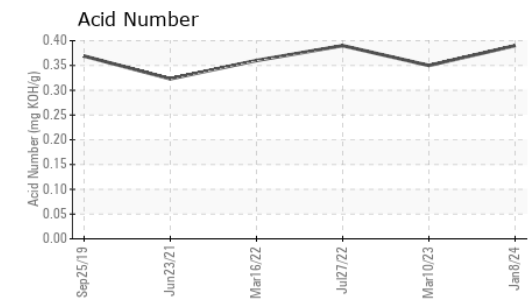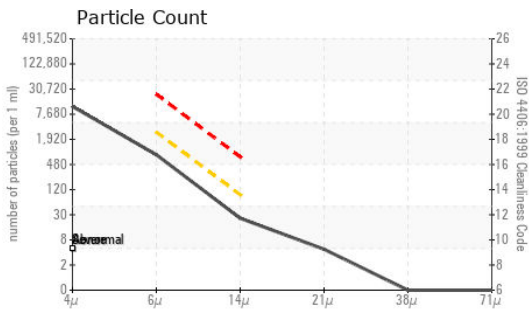

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP438149 **Received** : 11 Jan 2024  
**Lab Number** : 06058021 **Diagnosed** : 12 Jan 2024  
**Unique Number** : 10829403 **Diagnostician** : Wes Davis  
**Test Package** : MOB 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**U-PULL-AND-PAY LLC - ORLANDO**

1157 JETSTREAM DRIVE  
 ORLANDO, FL  
 US 32824

Contact: NILDA RIOS  
 nilda.rios@upullandpay.com  
 T: (407)473-3798  
 F: (407)856-4029