




VOLVO A45G 353449


Component
Brake Cooling System
Fluid

{not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		ASC0006331		
Resample at the next service interval to monitor.	Sample Date		Client Info		04 Jan 2024		
	Machine Age	hrs	Client Info		1406		
	Oil Age	hrs	Client Info		1406		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>50	13		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	0		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	2		
	Lead	ppm	ASTM D5185m	>50	0		
	Copper	ppm	ASTM D5185m	>200	153		
	Tin	ppm	ASTM D5185m	>20	<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	12		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		2		
		1-1-					
There is no indication of any contamination in the oil.	Water		WC Method	>0.2	NEG		
There is no indication of any contamination in the oil.	Water Silt	scalar		>0.2 NONE	NEG NONE		
There is no indication of any contamination in the oil.		scalar scalar	WC Method *Visual *Visual	>0.2 NONE NONE	NEG NONE NONE		
There is no indication of any contamination in the oil.	Silt		*Visual	NONE	NONE		
There is no indication of any contamination in the oil.	Silt Debris	scalar	*Visual	NONE NONE	NONE NONE		
There is no indication of any contamination in the oil.	Silt Debris Sand/Dirt	scalar scalar	*Visual *Visual *Visual	NONE NONE	NONE NONE		
There is no indication of any contamination in the oil.	Silt Debris Sand/Dirt Appearance	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NORML	NONE NONE NONE NORML		
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual *ASTM D5185m	NONE NONE NORML NORML	NONE NONE NONE NORML		
	Silt Debris Sand/Dirt Appearance Odor Emulsified Water	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML	NONE NONE NORML NORML NEG	 	
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium	scalar scalar scalar scalar scalar ppm	*Visual *Visual *Visual *Visual *Visual *Visual *ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG	 	
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum	scalar scalar scalar scalar scalar ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 5 104 0 <1	 	
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese	scalar scalar scalar scalar scalar ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 5 104 0 <1 <1	 	
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium	scalar scalar scalar scalar scalar ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 5 104 0 <1 <1 <1	 	
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium	scalar scalar scalar scalar scalar ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 5 104 0 <1 <1 14 3233		
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	scalar scalar scalar scalar scalar ppm ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 5 104 0 <1 <1 14 3233 1285		
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	scalar scalar scalar scalar scalar ppm ppm ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 5 104 0 <1 <1 14 3233 1285 1497		
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	scalar scalar scalar scalar scalar ppm ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 5 104 0 <1 <1 14 3233 1285		

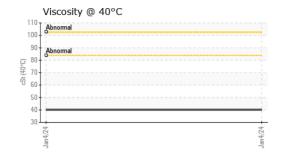

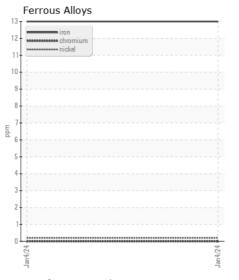

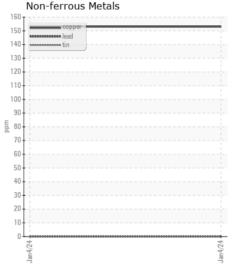

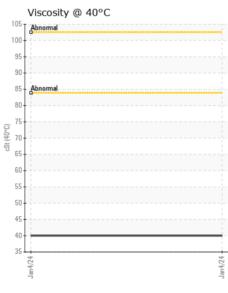





Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10829823

: ASC0006331 : 06058441 Test Package : CONST

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 11 Jan 2024 Diagnosed : 14 Jan 2024 Diagnostician : Don Baldridge

117 - ASCENDUM MACHINERY INC - GREENVILLE

2002 N GREENE ST GREENVILLE, NC US 27834

Contact: HUNTER DOLIVE

hunter.dolive@ascendummachinery.com T:

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (704)494-8197