WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL NORMAL



JOHN DEERE 755K 1T0755KXTPF438589

Component Left Outer Final Drive

JOHN DEERE HY-GARD HYD/	IRANS (G	iAL)			.,		
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		JR0199192	JR0190368	
	Sample Date		Client Info		10 Jan 2024	18 Oct 2023	
	Machine Age	hrs	Client Info		987	488	
	Oil Age	hrs	Client Info		987	488	
	Filter Age	hrs	Client Info		0	0	
	Oil Changed		Client Info		Changed	N/A	
	Filter Changed		Client Info		N/A	N/A	
	Sample Status				NORMAL	NORMAL	
WEAR	PQ		ASTM D8184	>1250	54	35	
	Iron	ppm	ASTM D5185m	>750	38	34	
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1	<1	
	Nickel	ppm	ASTM D5185m		<1	<1	
	Titanium	ppm	ASTM D5185m		<1	<1	
	Silver	ppm	ASTM D5185m		0	0	
	Aluminum	ppm	ASTM D5185m	>40	2	2	
	Lead	ppm	ASTM D5185m	>15	<1	<1	
	Copper	ppm	ASTM D5185m	>40	<1	<1	
	Tin	ppm	ASTM D5185m	>10	<1	0	
	Vanadium	ppm	ASTM D5185m		0	0	
	White Metal	scalar	*Visual	NONE	NONE	MODER	
	Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
CONTAMINATION	Silicon	ppm	ASTM D5185m	\75	12	11	
	Potassium	ppm	ASTM D5185m		2	2	
There is no indication of any contamination in the oil.	Water	ррпп	WC Method	>0.075	NEG	NEG	
	Silt	scalar	*Visual	NONE	NONE	NONE	
	Debris	scalar	*Visual	NONE	NONE	NONE	
	Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
	Appearance	scalar	*Visual	NORML	NORML	NORML	
	Odor	scalar	*Visual	NORML	NORML	NORML	
	Emulsified Water	scalar	*Visual	>0.075	NEG	NEG	
FLUID CONDITION	Sodium	ppm	ASTM D5185m	<u></u>	0	0	
	Boron	ppm	ASTM D5185m		0	0	
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m		6	2	
	Molybdenum	ppm	ASTM D5185m		<1	<1	
	Manganese	ppm	ASTM D5185m		<1	<1	
	Magnesium	ppm	ASTM D5185m	145	108	104	
	Calcium	ppm	ASTM D5185m		3727	3642	
	Phosphorus	ppm	ASTM D5185m	1290	1072	1130	
	Zinc	ppm	ASTM D5185m		1271	1274	
	Sulfur	ppm	ASTM D5185m		4085	4752	
	Visc @ 40°C	cSt	ASTM D445	57.0	54.7	56.4	
Report Id: IAMMAN [WI ISCAR] 06058887 (Generated: 01/12/2024 10:00:04) Rev: 1				Cule	resists and Dr. v. Ti	ECHNICIAN	A C C C L IN IT

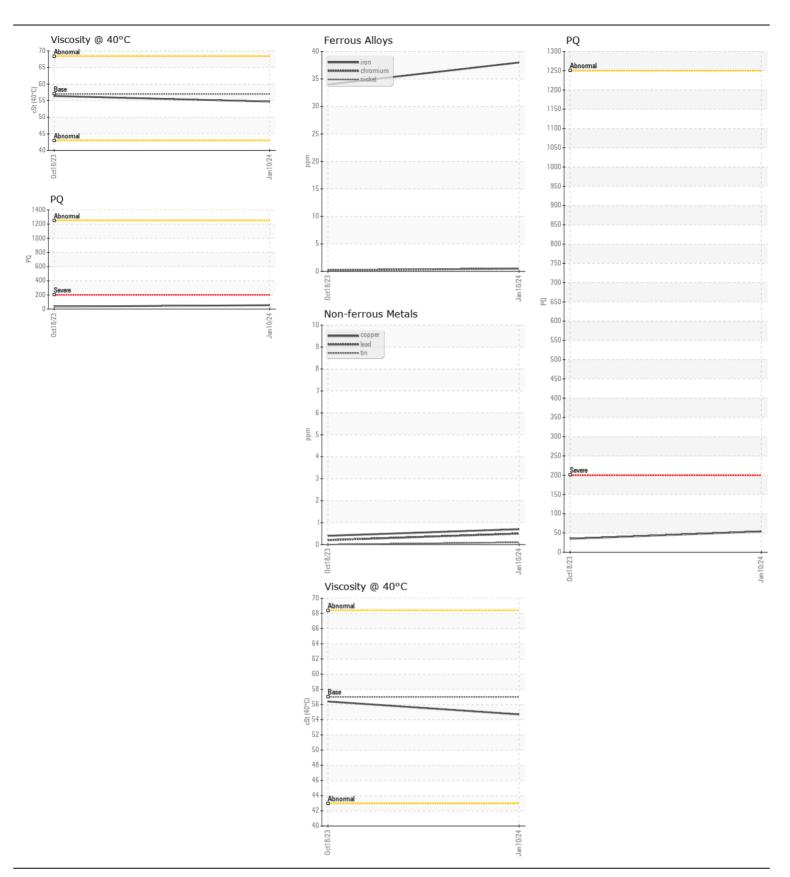





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: JR0199192 : 06058887

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved Diagnosed : 10830269

: 11 Jan 2024 : 12 Jan 2024 Diagnostician : Wes Davis

Test Package : CONST (Additional Tests: PQ)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

9107 OWENS DRIVE MANASSAS PARK, VA US 20111 Contact: DON VEST

JRE - MANASSAS PARK

dvest@jamesriverequipment.com T: (703)631-8500

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (703)631-4715