



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**INTERNATIONAL 625112**  
Component  
**Diesel Engine**  
Fluid  
**VALVOLINE 15W40 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>IL0034278</b>	IL05887249	IL05743871
Sample Date		Client Info		<b>12 Dec 2023</b>	21 Jun 2023	30 Dec 2022
Machine Age	mls	Client Info		<b>120214</b>	105348	90469
Oil Age	mls	Client Info		<b>0</b>	0	0
Filter Age	mls	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	N/A	N/A
Filter Changed		Client Info		<b>Changed</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>18</b>	20	27
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>4	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	0
Silver	ppm	ASTM D5185m	>3	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>20	<b>6</b>	6	12
Lead	ppm	ASTM D5185m	>40	<b>1</b>	0	<1
Copper	ppm	ASTM D5185m	>330	<b>&lt;1</b>	1	2
Tin	ppm	ASTM D5185m	>15	<b>1</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION







There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>5</b>	5	6
Potassium	ppm	ASTM D5185m	>20	<b>4</b>	7	11
Fuel		WC Method	>2.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.5</b>	0.5	0.7
Nitration	Abs/cm	*ASTM D7624	>20	<b>10.3</b>	10.3	10.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>22.2</b>	23.4	22.6
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>2</b>	1	2
Boron	ppm	ASTM D5185m	39	<b>83</b>	124	130
Barium	ppm	ASTM D5185m	1	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	49	<b>78</b>	80	77
Manganese	ppm	ASTM D5185m	1	<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m	616	<b>683</b>	534	535
Calcium	ppm	ASTM D5185m	1554	<b>1469</b>	1330	1336
Phosphorus	ppm	ASTM D5185m	899	<b>925</b>	898	851
Zinc	ppm	ASTM D5185m	1069	<b>1180</b>	1116	1069
Sulfur	ppm	ASTM D5185m	2624	<b>3174</b>	2940	3195
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>18.6</b>	18.8	17.9
Base Number (BN)	mg KOH/g	ASTM D2896	6.9	<b>6.3</b>	6.5	7.0
Visc @ 100°C	cSt	ASTM D445	13.6	<b>12.6</b>	12.6	12.7

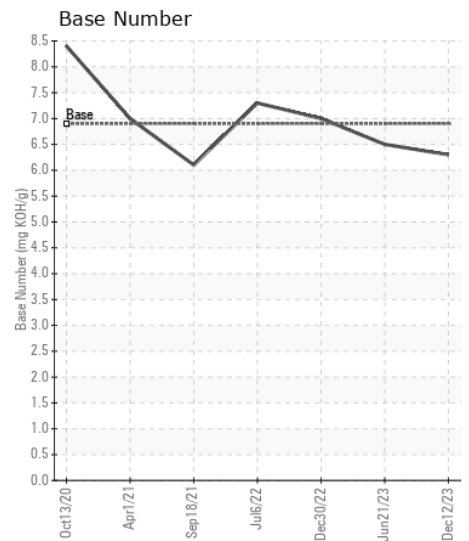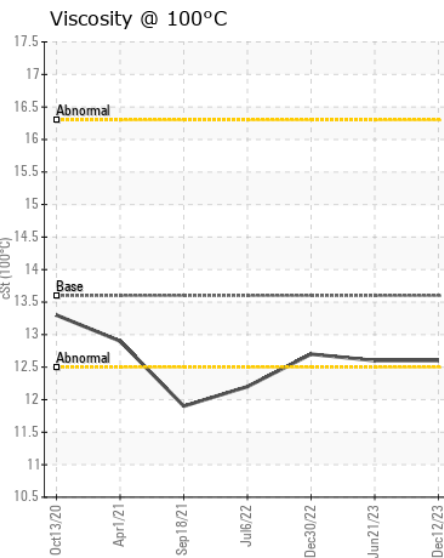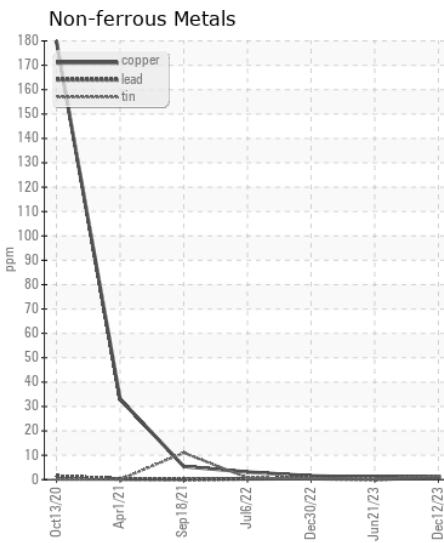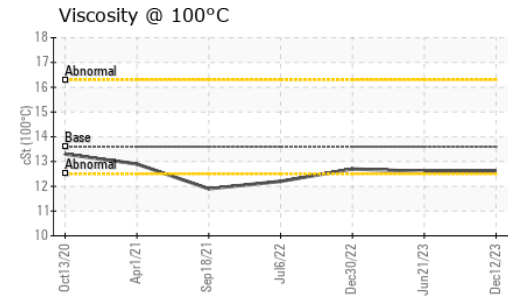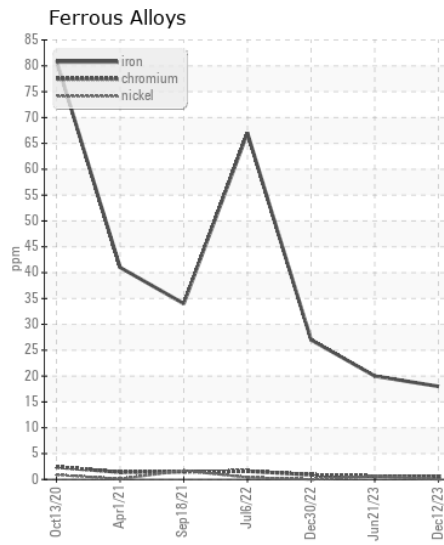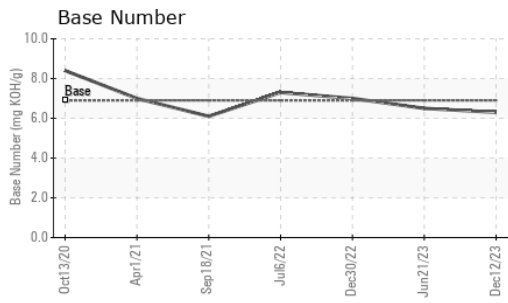

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : IL0034278 **Received** : 12 Jan 2024  
**Lab Number** : 06058960 **Diagnosed** : 12 Jan 2024  
**Unique Number** : 10830342 **Diagnostician** : Wes Davis  
**Test Package** : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**TAMPA IDEALEASE**  
 5951 ORIENT ROAD  
 TAMPA, FL  
 US 33610-9565  
 Contact: Russ Cook  
 russcook@idealease.com  
 T: (813)626-9285  
 F: (844)270-1356