



**OIL ANALYSIS REPORT**

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**CAMERON P14289**  
 Component  
**Compressor**  
 Fluid  
**CT 46 (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>CCSI2007881</b>	CCSI2007924	CCSI2008666
Sample Date		Client Info		<b>22 Dec 2023</b>	23 Jun 2021	14 Dec 2020
Machine Age	hrs	Client Info		<b>9617</b>	4380	4070
Oil Age	hrs	Client Info		<b>9617</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	<b>&lt;1</b>	0	0
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m		<b>0</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	<1	0
Aluminum	ppm	ASTM D5185m	>25	<b>0</b>	0	0
Lead	ppm	ASTM D5185m	>25	<b>0</b>	<1	0
Copper	ppm	ASTM D5185m	>50	<b>0</b>	<1	0
Tin	ppm	ASTM D5185m	>15	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**










There is no indication of any contamination in the fluid. The amount and size of particulates present in the system are acceptable.

Silicon	ppm	ASTM D5185m	>25	<b>&lt;1</b>	0	<1
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	0	0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>10000	<b>4986</b>	352	54
Particles >6µm		ASTM D7647	>2500	<b>1211</b>	100	27
Particles >14µm		ASTM D7647	>320	<b>69</b>	10	7
Particles >21µm		ASTM D7647	>80	<b>22</b>	3	4
Particles >38µm		ASTM D7647	>20	<b>2</b>	0	0
Particles >71µm		ASTM D7647	>4	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15	<b>19/17/13</b>	16/14/10	13/12/10
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>LIGHT</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Boron	ppm	ASTM D5185m		<b>0</b>	<1	0
Barium	ppm	ASTM D5185m		<b>0</b>	1	0
Molybdenum	ppm	ASTM D5185m		<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m		<b>0</b>	0	0
Calcium	ppm	ASTM D5185m		<b>0</b>	26	0
Phosphorus	ppm	ASTM D5185m		<b>92</b>	217	15
Zinc	ppm	ASTM D5185m		<b>2</b>	271	0
Sulfur	ppm	ASTM D5185m		<b>621</b>	481	12
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.22</b>	0.250	0.106
Visc @ 40°C	cSt	ASTM D445		<b>48.0</b>	45.0	45.2

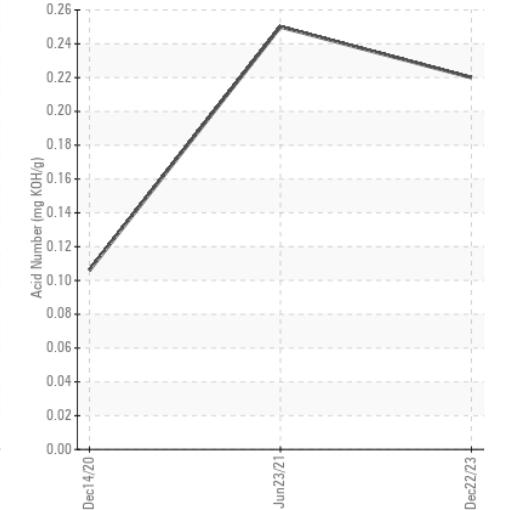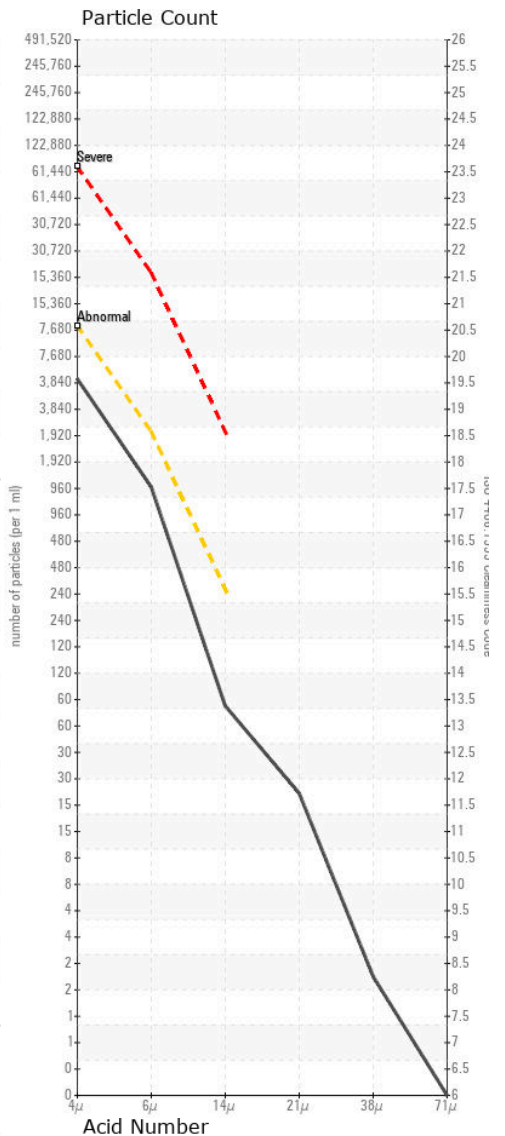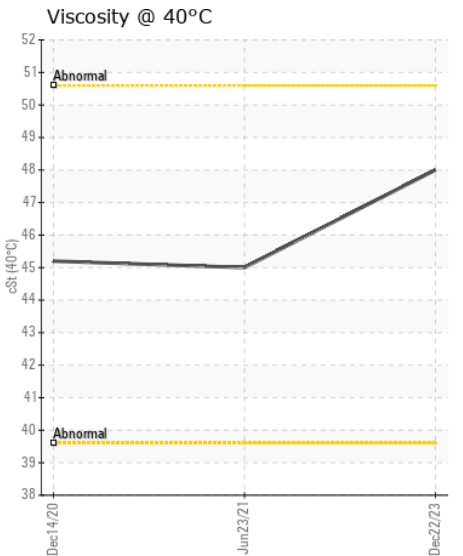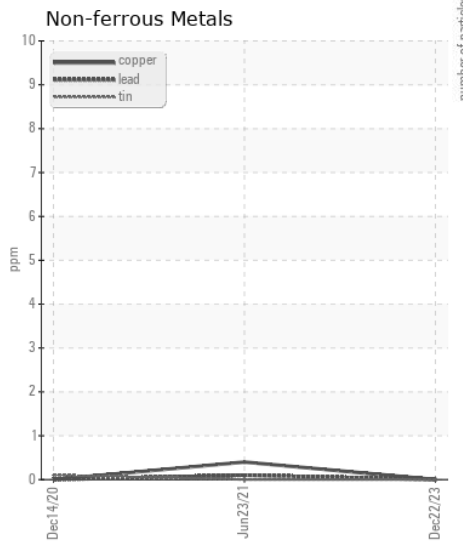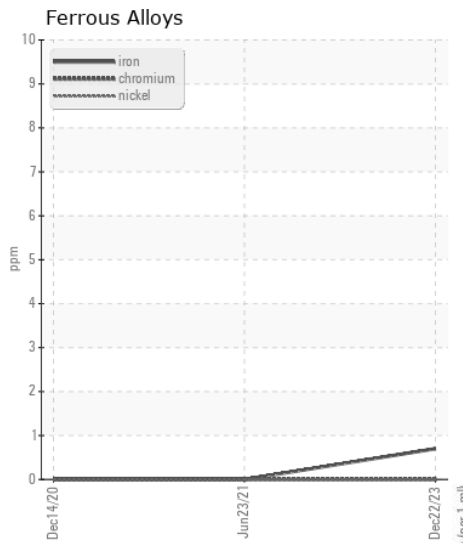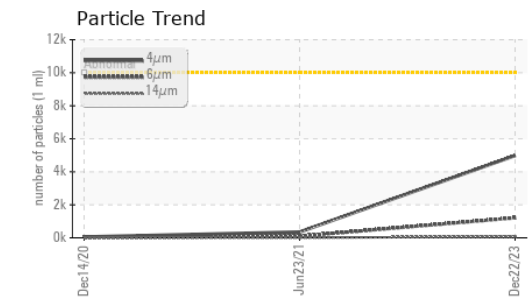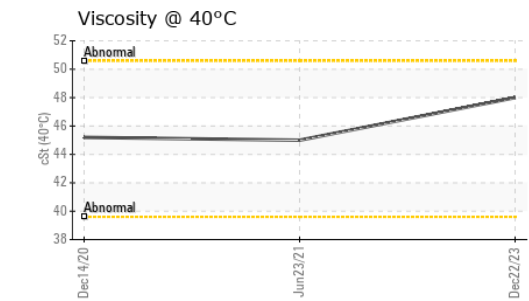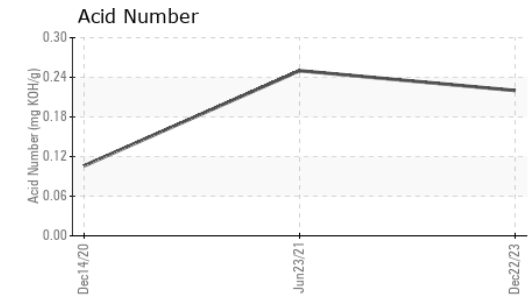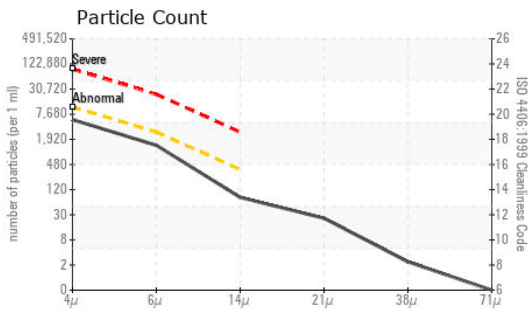

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : CCSI2007881 **Received** : 16 Jan 2024  
**Lab Number** : 06061033 **Diagnosed** : 17 Jan 2024  
**Unique Number** : 10832415 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: PrtCount )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**CISCO AIR SYSTEMS**  
 2373 LINCOLN AVE  
 HAYWARD, CA  
 US 94545  
 Contact: Service Manager

T: (916)414-0331

F: