


WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**

Machine Id **2609**

Component Diesel Engine							
{not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number	OOW	Client Info	LITTIO7 COTT	WC0847898		
	Sample Date		Client Info		19 Dec 2023		
	Machine Age	hrs	Client Info		23163		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed	1113	Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status		Oliciti IIIIO		NORMAL		
					·····		
WEAR	Iron	ppm	ASTM D5185m	>100	20		
	Chromium	ppm	ASTM D5185m	>20	<1		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m	>4	<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>3	0		
	Aluminum	ppm	ASTM D5185m		2		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		3		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m	710	<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal		*Visual	NONE	NONE		
		scalar	Visuai	NONE	INOINE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	6		
	Potassium	ppm	ASTM D5185m		4		
There is no indication of any contamination in the oil.	Fuel	ρρ	WC Method		<1.0		
	Water		WC Method		NEG		
	Glycol		WC Method	70.L	NEG		
	Soot %	%	*ASTM D7844	~3	0.3		
	Nitration	Abs/cm	*ASTM D7624	>20	9.5		
	Sulfation	Abs/.1mm	*ASTM D7024		22.1		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt		*Visual	NONE	NONE		
	Appearance	scalar scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water				NEG		
		Scalai	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		15		
	Boron	ppm	ASTM D5185m		6		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		67		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		836		
	Calcium	ppm	ASTM D5185m		1275		
	Phosphorus	ppm	ASTM D5185m		927		
	Zinc		ASTM D5185m		1186		
	Sulfur	ppm	ASTM D5185m		2425		
	Oxidation	ppm Abs/1mm		> 2F			
		Abs/.1mm	*ASTM D7414	>20	19.9		
	Base Number (BN)		ASTM D2896		5.6		
	Visc @ 100°C	cSt	ASTM D445		12.6		



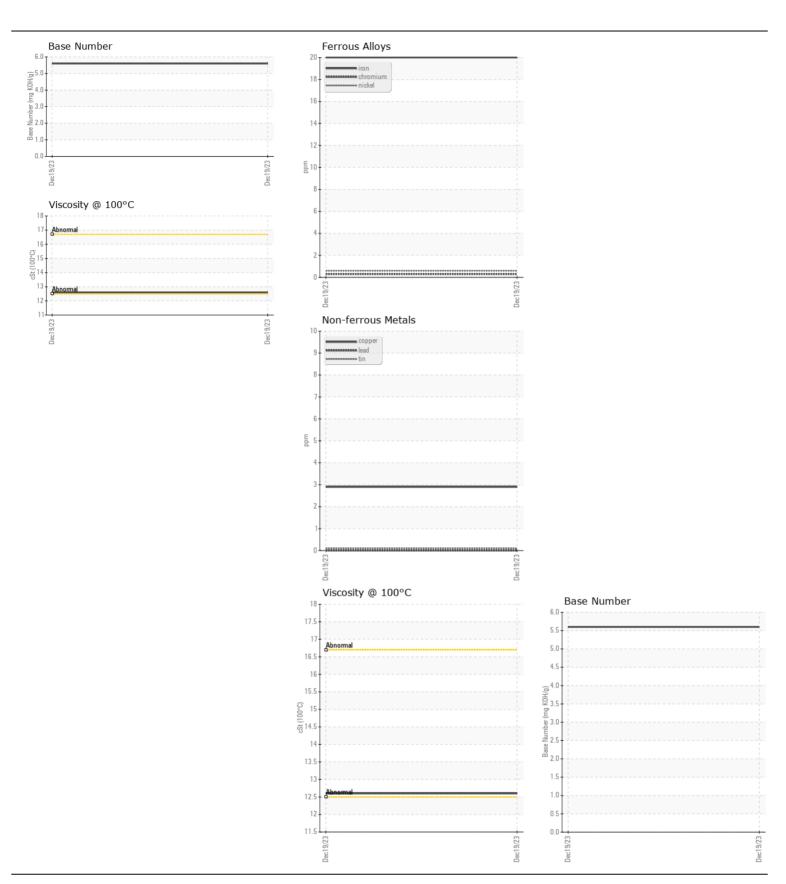



Laboratory

Sample No. Lab Number **Unique Number**

: WC0847898 : 06061807

: 10833189

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 16 Jan 2024

Diagnosed : 18 Jan 2024 Diagnostician : Wes Davis

Test Package : CONST (Additional Tests: TBN)

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Apple Valley Waste - Chambersburg Location

5436 Sunset Pike Chambersburg, PA US 17202

Contact: Service Manager

T:

F: