

WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL

Area

## GARY MERMELSTIEN [6506] Washine Id VOLVO PENTA IPS-10 3200000915

Port IPS

RECOMMENDATION	Toot	LIONA	Mathad	Limit/Ala.	C	I liete4	I linta m O
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number Sample Date		Client Info		VPA060557 11 Jan 2024		
	Machine Age	hrs	Client Info		180		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed	1113	Client Info		Not Changd		
	Filter Changed		Client Info		Not Change		
	Sample Status		Oliciti iiilo		NORMAL		
WEAR	PQ		ASTM D8184		15		
All component wear rates are normal.	Iron	ppm	ASTM D5185m	>200	<1		
	Chromium	ppm	ASTM D5185m	>10	0		
	Nickel	ppm	ASTM D5185m	>10	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		<1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		4		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION  There is no indication of any contamination in the fluid.	Silicon	ppm	ASTM D5185m		1		
	Potassium	ppm	ASTM D5185m	>20	0		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		359		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		112		
	Calcium	ppm	ASTM D5185m		17		
	Phosphorus	ppm	ASTM D5185m		1466		
	Zinc	ppm	ASTM D5185m		12		
	Sulfur	ppm	ASTM D5185m		24083		
	Visc @ 40°C	cSt	ASTM D445		105		

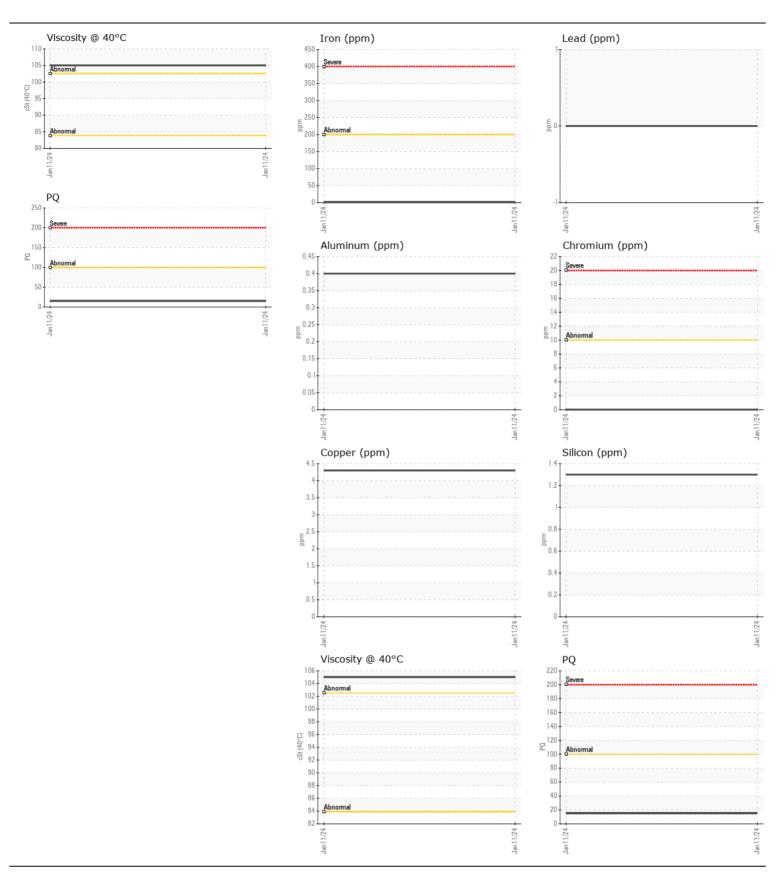



Laboratory Sample No. Lab Number **Unique Number** 

: VPA060557 : 06062219 : 10833601

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 16 Jan 2024 Diagnosed : 18 Jan 2024

Diagnostician : Don Baldridge

Test Package : MOB 1 ( Additional Tests: PQ ) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) **Northwest Diesel Power** 

1325 ROEDER AVE SUITE 103 BELLINGHAM, WA

US 98225

Contact: BRANDON ROBERTSON parts@nwdieselpower.com

T: F: