



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area  
**[6137003]**  
 Machine Id  
**GOULDS 1026-P03B**  
 Component  
**Pump**  
 Fluid  
**SHELL OMALA 68 (1 PNT)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0851151</b>	WC0737415	WC0737402
Sample Date		Client Info		<b>15 Jan 2024</b>	19 Jul 2023	12 Jan 2023
Machine Age	hrs	Client Info		<b>149397</b>	237632	233831
Oil Age	hrs	Client Info		<b>246296</b>	140733	136941
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	<b>0</b>	0	1
Chromium	ppm	ASTM D5185m	>7	<b>&lt;1</b>	0	0
Nickel	ppm	ASTM D5185m		<b>0</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>25	<b>2</b>	0	0
Lead	ppm	ASTM D5185m	>35	<b>0</b>	<1	0
Copper	ppm	ASTM D5185m	>50	<b>0</b>	0	2
Tin	ppm	ASTM D5185m	>5	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>2</b>	5	16
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	0
Water		WC Method	>.1	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>.1	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>0</b>	0	6
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>3</b>	2	0
Molybdenum	ppm	ASTM D5185m		<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185m		<b>0</b>	<1	0
Calcium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Phosphorus	ppm	ASTM D5185m		<b>393</b>	336	317
Zinc	ppm	ASTM D5185m		<b>0</b>	2	75
Sulfur	ppm	ASTM D5185m		<b>1061</b>	818	1174
Visc @ 40°C	cSt	ASTM D445	68.0	<b>71.3</b>	69.1	68.8

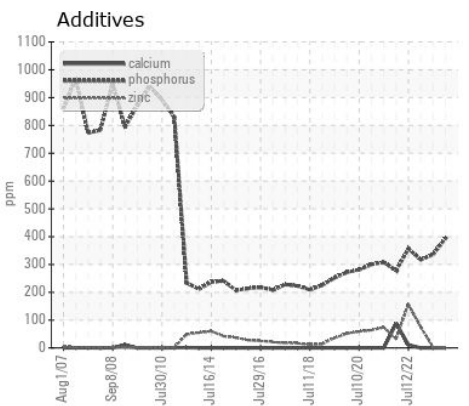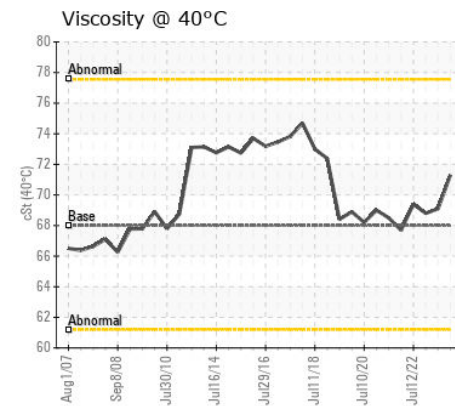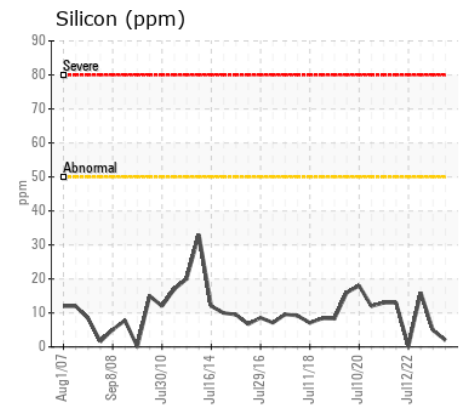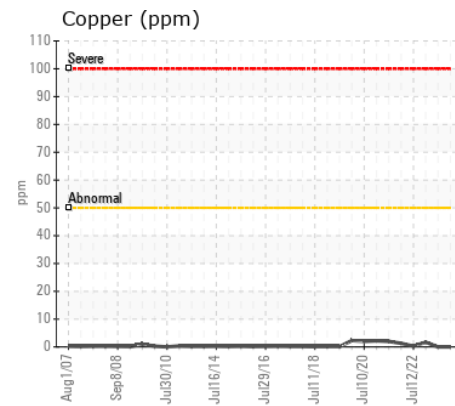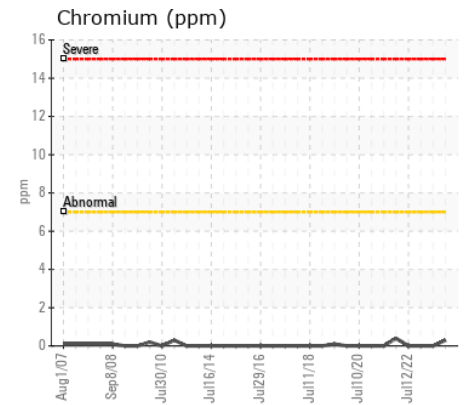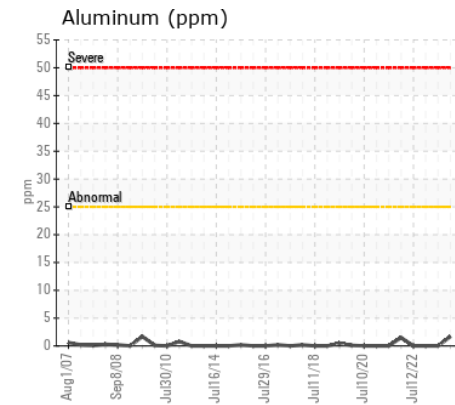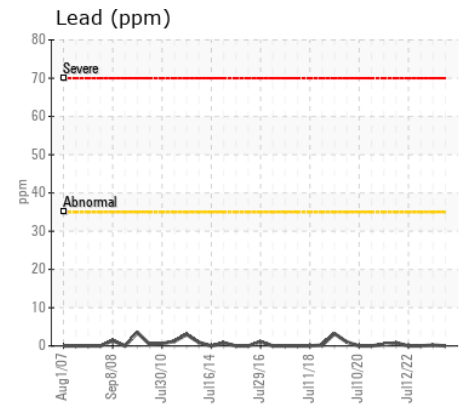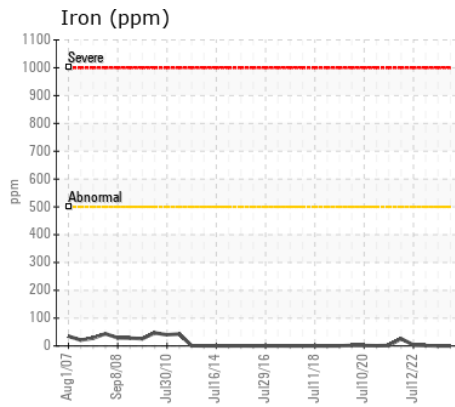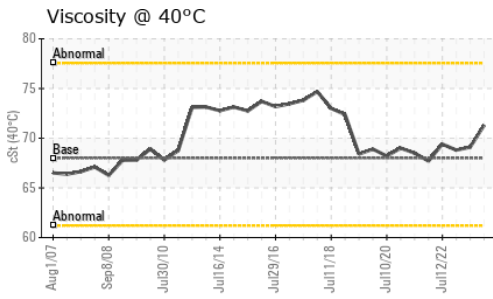

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0851151 **Received** : 17 Jan 2024  
**Lab Number** : 06063193 **Diagnosed** : 18 Jan 2024  
**Unique Number** : 10834575 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**DAK AMERICAS LLC**  
 3216 CEDAR CREEK RD.  
 FAYETTEVILLE, NC  
 US 28312

Contact: RONNIE HUDSON  
 rhudson@alpepolyester.com  
 T: (910)433-8361  
 F: (910)433-8218