WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


Machine Ic

JOHN DEERE 1025 3007452

Component Diesel Engine

Fluid

ECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History
Resample at the next service interval to monitor.	Sample Number		Client Info		JR0158852		
	Sample Date		Client Info		16 Jan 2024		
	Machine Age	hrs	Client Info		110		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
/EAR	Iron	ppm	ASTM D5185m	>51	8		
	Chromium	ppm	ASTM D5185m		0		
Metal levels are typical for a new component breaking in.	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m	75	<1		
	Silver	ppm	ASTM D5185m	~3	0		
	Aluminum	ppm	ASTM D5185m		5		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		3		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m	24	<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
	T CHOW IVICIAL		Visuai	NONE	·····		
ONTAMINATION	Silicon	ppm	ASTM D5185m	>22	36		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	2		
	Fuel		WC Method	>2.1	<1.0		
	Water		WC Method	>0.21	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	7.0		
	Sulfation	Abs/.1mm	*ASTM D7415	>30	18.7		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.21	NEG		
LUID CONDITION	Sodium	nnm	ASTM D5185m	>31	4		
<u></u>	Boron	ppm	ASTM D5185m	- 31	269		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		254		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		826		
	Calcium	ppm	ASTM D5185m		1451		
	Phosphorus	ppm	ASTM D5185m		967		
	Zinc	ppm	ASTM D5185m		1128		
	Sulfur	ppm	ASTM D5185m		3218		
	Oxidation	Abs/.1mm	*ASTM D3163111	>25	14.2		
	Base Number (BN)				9.1		
	Dase Mulliber (DIV)	my Norly	10 LINI D5030	10.0	3.1		

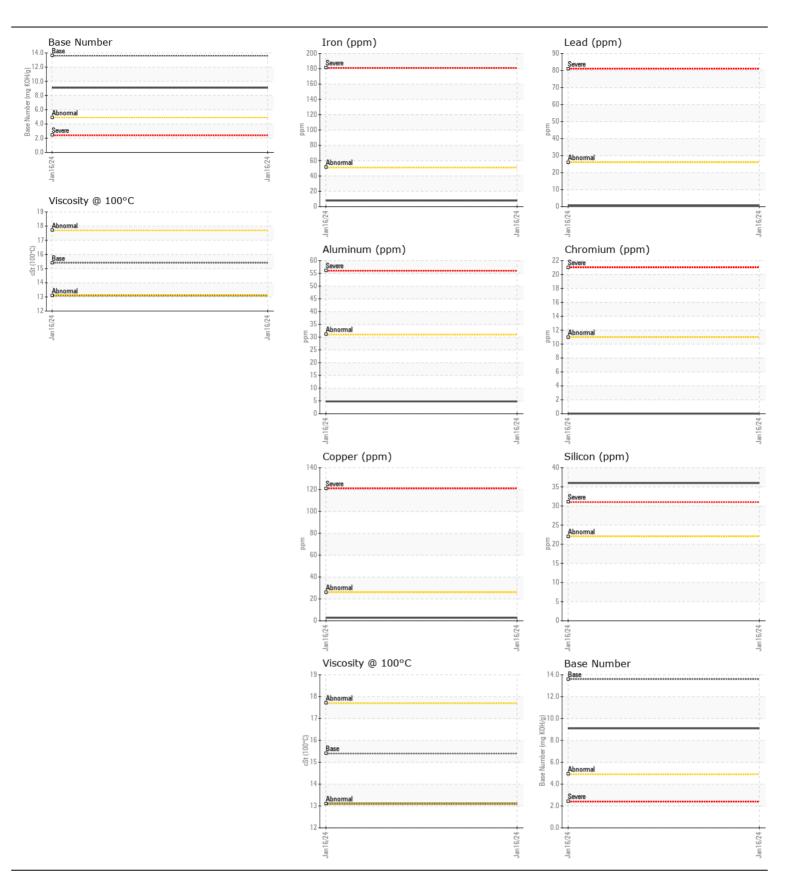



Report Id: JAMFIS [WUSCAR] 06063300 (Generated: 01/19/2024 20:36:53) Rev: 1

Laboratory Sample No. Lab Number

Unique Number

: JR0158852 : 06063300 : 10834682

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 17 Jan 2024 Diagnosed : 18 Jan 2024 Diagnostician : Wes Davis

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Test Package : MOBCE (Additional Tests: TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

JRE - FISHERSVILLE 98 EXPO ROAD FISHERSVILLE, VA

US 22939 Contact: ZAN ERSKINE

zerskine@jamesriverequipment.com

T: (540)337-3057 F: x: