WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL

Machine Id

8117061

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number	2 0	Client Info		IL0034901		
Resample at the next service interval to monitor.	Sample Date		Client Info		11 Jan 2024		
	Machine Age	mls	Client Info		190982		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>100	5		
	Chromium	ppm	ASTM D5185m	>20	<1		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>3	0		
	Aluminum	ppm	ASTM D5185m		2		
	Lead	ppm	ASTM D5185m	>40	- <1		
	Copper	ppm	ASTM D5185m		0		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
ONTAMINATION	Silicon	ppm	ASTM D5185m	>25	8		
	Potassium	ppm	ASTM D5185m	>20	3		
There is no indication of any contamination in the oil.	Fuel	%	ASTM D3524	>5	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	6.6		
	Sulfation	Abs/.1mm	*ASTM D7415	>30	21.6		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		2		
	Boron	ppm	ASTM D5185m		49		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		38		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		495		
	Calcium	ppm	ASTM D5185m		1517		
	Phosphorus	ppm	ASTM D5185m		762		
	Zinc	ppm	ASTM D5185m		865		
	Sulfur	ppm	ASTM D5185m		2355		
	Oxidation	Abs/.1mm	*ASTM D7414	>25	20.3		
	Base Number (BN)				9.6		
	Visc @ 100°C	cSt	ASTM D445		10.3		

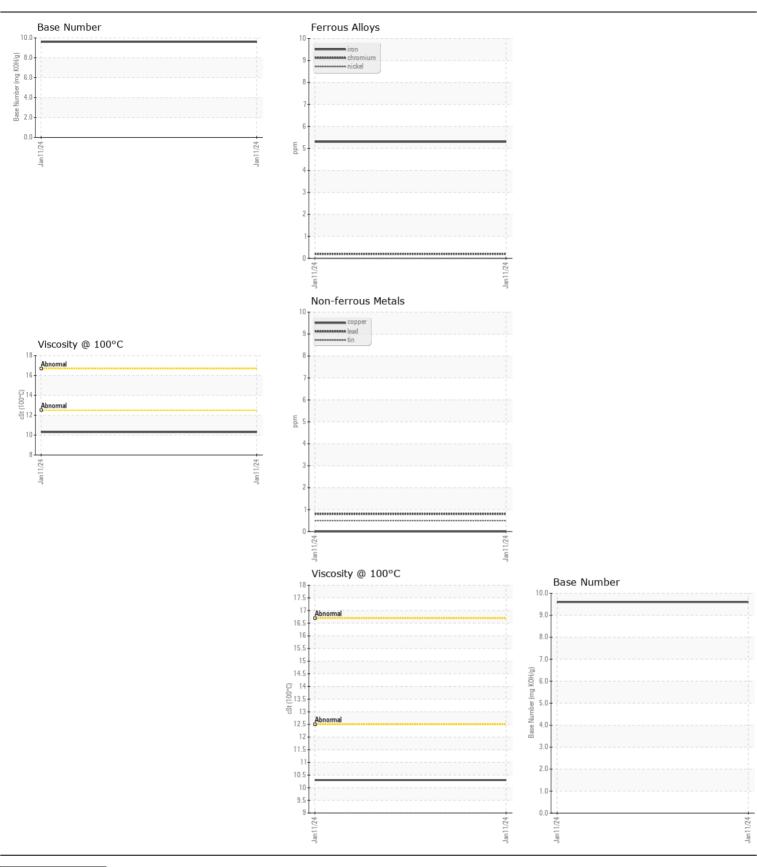





Laboratory Sample No. Lab Number

Unique Number : 10834715

: IL0034901 : 06063333

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved Diagnosed

: 17 Jan 2024 : 19 Jan 2024

Diagnostician : Don Baldridge Test Package : FLEET (Additional Tests: FuelDilution)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

IDEALEASE OF ATLANTA - FULTON

4675 BAKERS FERRY ROAD ATLANTA, GA US 30331

Contact: DAVID JOHNS davidjohns@idealease.com T: (404)699-5571

F: (404)699-7420