
WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**

Machine Id 7739L

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		IL06063993		
	Sample Date		Client Info		07 Dec 2023		
	Machine Age	mls	Client Info		0		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>100	51		
VEAIL	Chromium	ppm	ASTM D5185m		6		
All component wear rates are normal.	Nickel	ppm			0		
	Titanium	ppm	ASTM D5185m	24	0		
	Silver		ASTM D5185m	~3	0		
	Aluminum	ppm	ASTM D5185m		6		
	Lead	ppm	ASTM D5185m		9		
	Copper	ppm	ASTM D5185m		8		
	Tin	ppm	ASTM D5185m		2		
	Vanadium	ppm	ASTM D5185m	/10	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
<u></u>			Visuai	NONE			
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	12		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	19		
	Fuel		WC Method	>5	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>3	0.3		
	Nitration	Abs/cm	*ASTM D7624	>20	11.8		
	Sulfation	Abs/.1mm	*ASTM D7415	>30	26.9		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Boron	ppm	ASTM D5185m		6		
	Barium	ppm	ASTM D5185m		4		
	Molybdenum	ppm	ASTM D5185m		61		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m		958		
	Calcium	ppm	ASTM D5185m		1172		
	Phosphorus	ppm	ASTM D5185m		967		
	Zinc	ppm	ASTM D5185m		1243		
	Sulfur	ppm	ASTM D5185m		3393		
	Oxidation	Abs/.1mm	*ASTM D7414	>25	27.5		
	Base Number (BN)			/20	4.6		
	Visc @ 100°C	cSt	ASTM D2030		12.9		



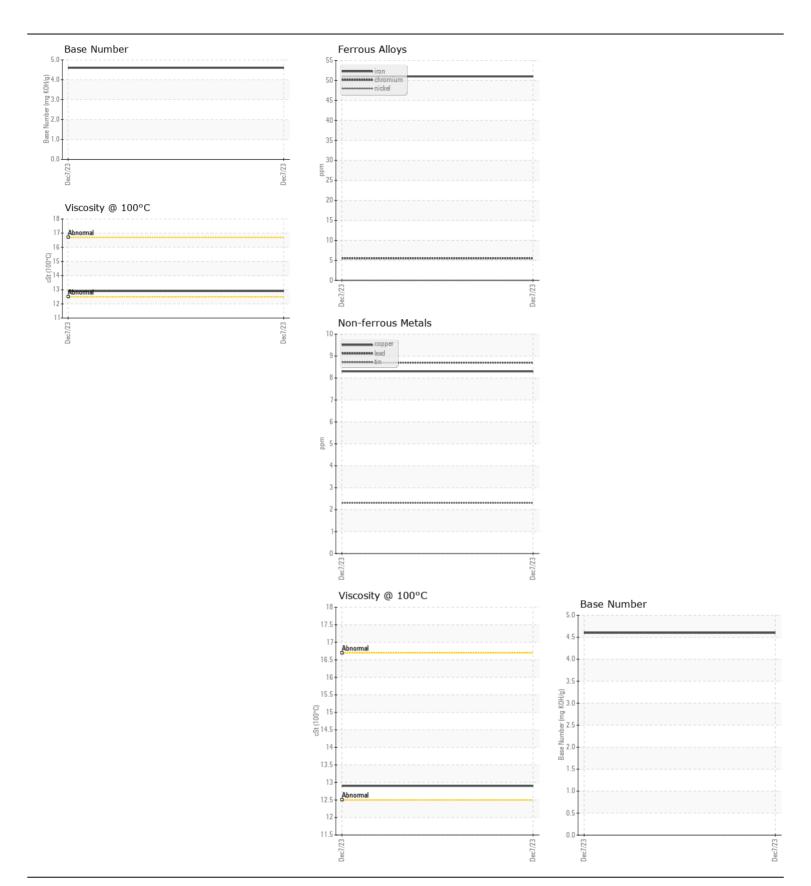



Certificate L2367

Laboratory Sample No. Lab Number

: IL06063993 : 06063993 Unique Number : 10835375 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 18 Jan 2024 Diagnosed : 20 Jan 2024

Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

RUSH TRUCK CENTER - CHICAGO IDEALEASE

4655 SOUTH CENTRAL AVENUE CHICAGO, IL

US 60638 Contact: MIKE LINLEY

linleym@rushtruckcenters.com T: (708)496-7500

F: (708)496-8818

Contact/Location: MIKE LINLEY - IDECHIIL