



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area

[W63135]

Machine Id

JOHN DEERE 470G 1FF470GXAFE471337

Component

Hydraulic System

Fluid

HITACHI HYDRAULIC SUPER EX 46HN (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. (Customer Sample Comment: W63135)

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		JR0188424	JR0177377	JR0161941
Sample Date		Client Info		16 Jan 2024	16 Aug 2023	18 Apr 2023
Machine Age	hrs	Client Info		10095	9557	8986
Oil Age	hrs	Client Info		8974	9007	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	Not Changd	N/A
Filter Changed		Client Info		Changed	Not Changd	N/A
Sample Status				NORMAL	NORMAL	ABNORMAL

WEAR

All component wear rates are normal.

PQ		ASTM D8184	>50	14	10	5
Iron	ppm	ASTM D5185m	>32	3	4	2
Chromium	ppm	ASTM D5185m	>9	0	0	0
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>9	1	1	<1
Lead	ppm	ASTM D5185m	>28	0	0	0
Copper	ppm	ASTM D5185m	>50	<1	<1	<1
Tin	ppm	ASTM D5185m	>5	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION

















The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>11	2	2	<1
Potassium	ppm	ASTM D5185m	>20	0	0	0
Water		WC Method	>0.075	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>80000	5602	7750	---
Particles >6µm		ASTM D7647	>20000	802	1654	---
Particles >14µm		ASTM D7647	>640	62	103	---
Particles >21µm		ASTM D7647	>160	14	22	---
Particles >38µm		ASTM D7647	>40	1	0	---
Particles >71µm		ASTM D7647	>10	1	0	---
Oil Cleanliness		ISO 4406 (c)	>23/21/16	20/17/13	20/18/14	---
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.075	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>21	<1	0	<1
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	<1	<1
Manganese	ppm	ASTM D5185m		<1	0	<1
Magnesium	ppm	ASTM D5185m		2	2	4
Calcium	ppm	ASTM D5185m		6	6	5
Phosphorus	ppm	ASTM D5185m	827	531	505	494
Zinc	ppm	ASTM D5185m	0	7	17	14
Sulfur	ppm	ASTM D5185m	13	529	601	689
Acid Number (AN)	mg KOH/g	ASTM D8045	0.06	0.21	0.20	0.20
Visc @ 40°C	cSt	ASTM D445	47	46.4	45.7	46.1

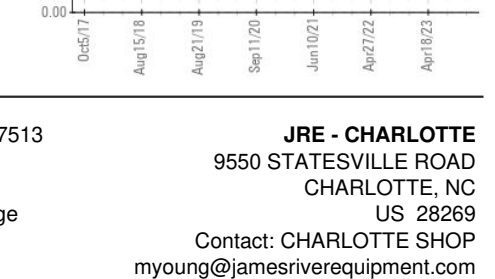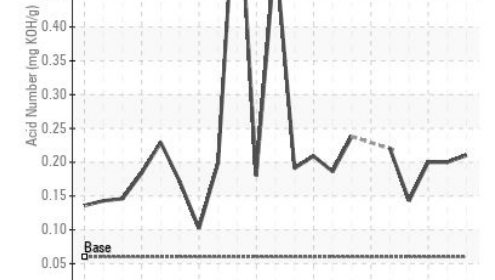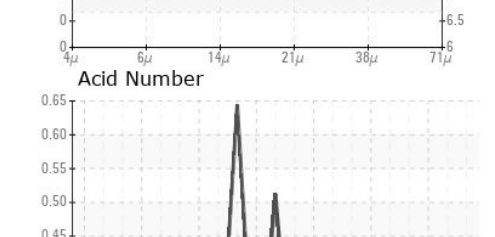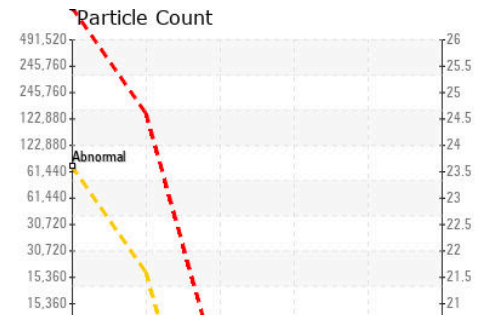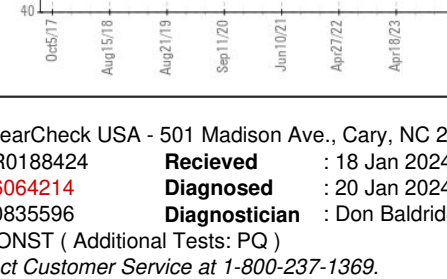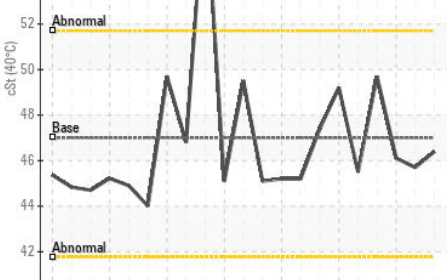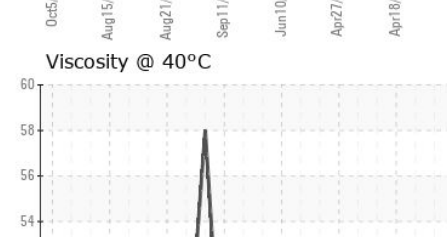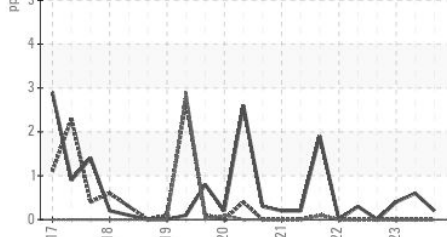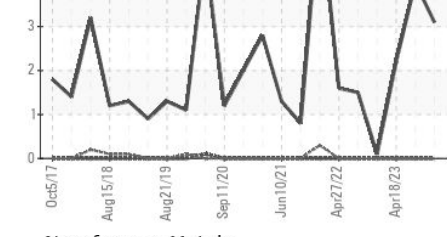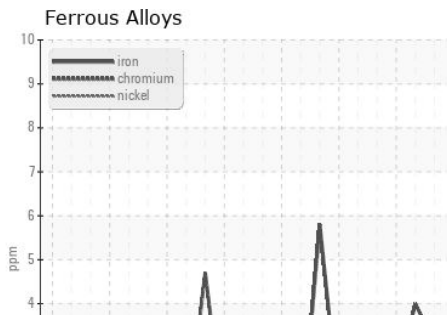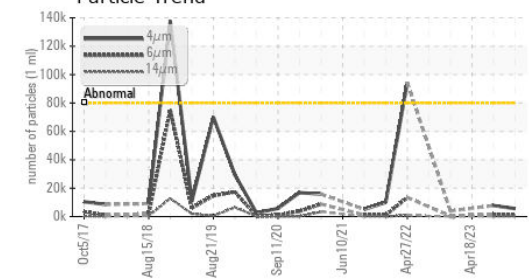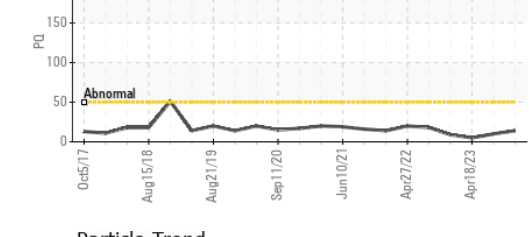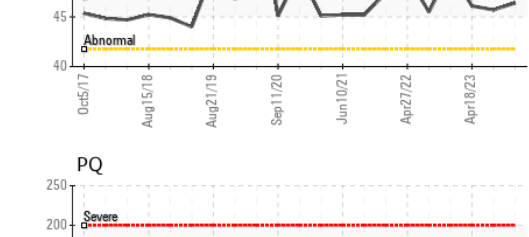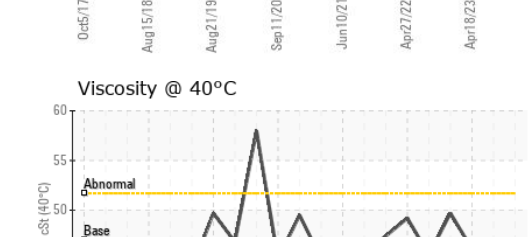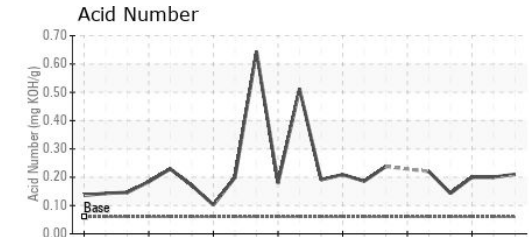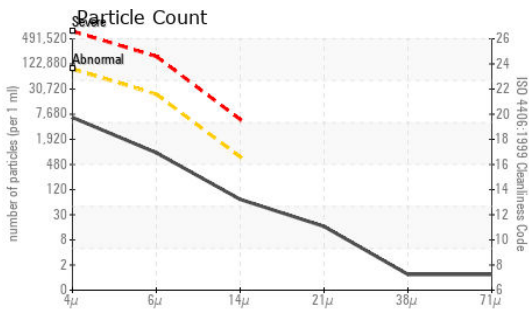

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : JR0188424 **Received** : 18 Jan 2024
Lab Number : 06064214 **Diagnosed** : 20 Jan 2024
Unique Number : 10835596 **Diagnostician** : Don Baldrige
Test Package : CONST (Additional Tests: PQ)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

JRE - CHARLOTTE
 9550 STATESVILLE ROAD
 CHARLOTTE, NC
 US 28269
 Contact: CHARLOTTE SHOP
 myoung@jamesriverequipment.com
 T: (704)597-0211
 F: (704)596-6198