



OIL ANALYSIS REPORT

| | |
|-----------------|--------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Area

[CMC]

Machine Id

SENNEBOGEN 850 850.0.3186

Component

Rear Axle

Fluid

VOLVO PREMIUM GEAR OIL 80W-90 GL-5 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|-------------|----------|----------|
| Sample Number | | Client Info | | VCP438014 | --- | --- |
| Sample Date | | Client Info | | 02 Jan 2024 | --- | --- |
| Machine Age | hrs | Client Info | | 1899 | --- | --- |
| Oil Age | hrs | Client Info | | 1000 | --- | --- |
| Filter Age | hrs | Client Info | | 0 | --- | --- |
| Oil Changed | | Client Info | | Changed | --- | --- |
| Filter Changed | | Client Info | | Not Changed | --- | --- |
| Sample Status | | | | NORMAL | --- | --- |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|------|-----|-----|
| Iron | ppm | ASTM D5185m | >500 | 25 | --- | --- |
| Chromium | ppm | ASTM D5185m | >10 | <1 | --- | --- |
| Nickel | ppm | ASTM D5185m | >10 | 0 | --- | --- |
| Titanium | ppm | ASTM D5185m | | 0 | --- | --- |
| Silver | ppm | ASTM D5185m | | 0 | --- | --- |
| Aluminum | ppm | ASTM D5185m | >25 | 2 | --- | --- |
| Lead | ppm | ASTM D5185m | >25 | 0 | --- | --- |
| Copper | ppm | ASTM D5185m | >50 | 6 | --- | --- |
| Tin | ppm | ASTM D5185m | >10 | 0 | --- | --- |
| Vanadium | ppm | ASTM D5185m | | 0 | --- | --- |
| White Metal | scalar | *Visual | NONE | NONE | --- | --- |
| Yellow Metal | scalar | *Visual | NONE | NONE | --- | --- |

CONTAMINATION










There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|--------|-------------|-------|-------|-----|-----|
| Silicon | ppm | ASTM D5185m | >75 | 3 | --- | --- |
| Potassium | ppm | ASTM D5185m | >20 | 1 | --- | --- |
| Water | | WC Method | >0.2 | NEG | --- | --- |
| Silt | scalar | *Visual | NONE | NONE | --- | --- |
| Debris | scalar | *Visual | NONE | NONE | --- | --- |
| Sand/Dirt | scalar | *Visual | NONE | NONE | --- | --- |
| Appearance | scalar | *Visual | NORML | NORML | --- | --- |
| Odor | scalar | *Visual | NORML | NORML | --- | --- |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | --- | --- |

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

| | | | | | | |
|-------------|-----|-------------|-------|-------|-----|-----|
| Sodium | ppm | ASTM D5185m | | 0 | --- | --- |
| Boron | ppm | ASTM D5185m | 379 | 36 | --- | --- |
| Barium | ppm | ASTM D5185m | 0.0 | 3 | --- | --- |
| Molybdenum | ppm | ASTM D5185m | 0.8 | 1 | --- | --- |
| Manganese | ppm | ASTM D5185m | 0.0 | 0 | --- | --- |
| Magnesium | ppm | ASTM D5185m | 31 | 10 | --- | --- |
| Calcium | ppm | ASTM D5185m | 38 | 30 | --- | --- |
| Phosphorus | ppm | ASTM D5185m | 1077 | 991 | --- | --- |
| Zinc | ppm | ASTM D5185m | 46 | 0 | --- | --- |
| Sulfur | ppm | ASTM D5185m | 23526 | 33284 | --- | --- |
| Visc @ 40°C | cSt | ASTM D445 | 139 | 143 | --- | --- |

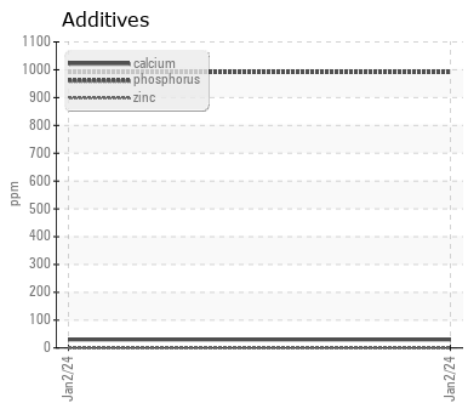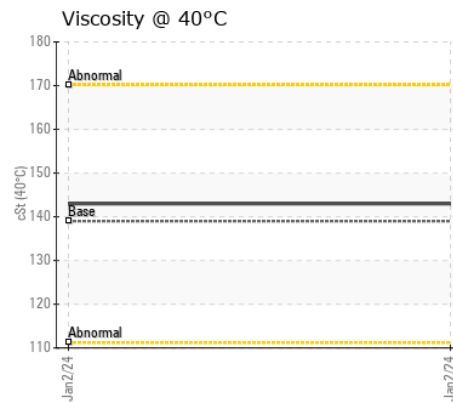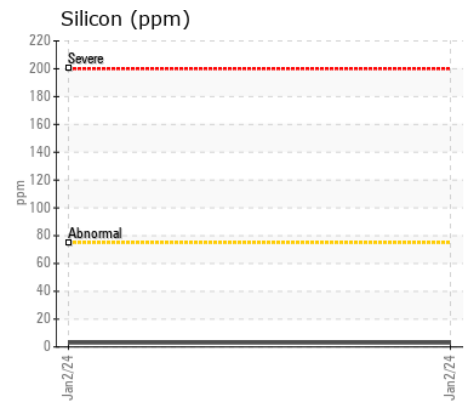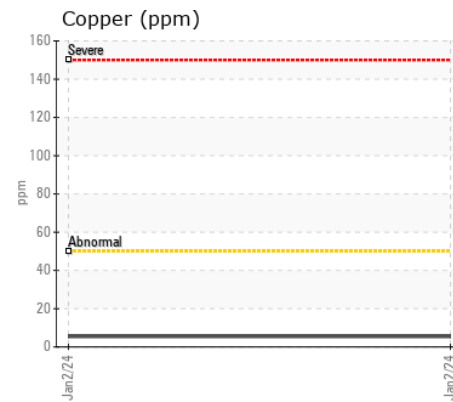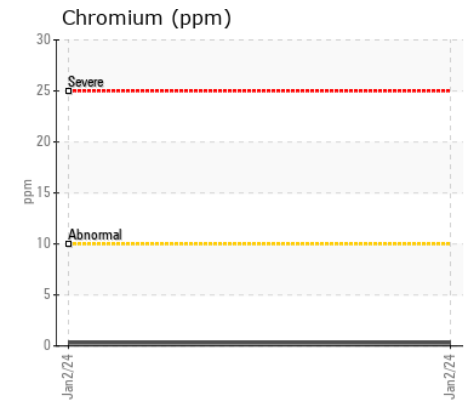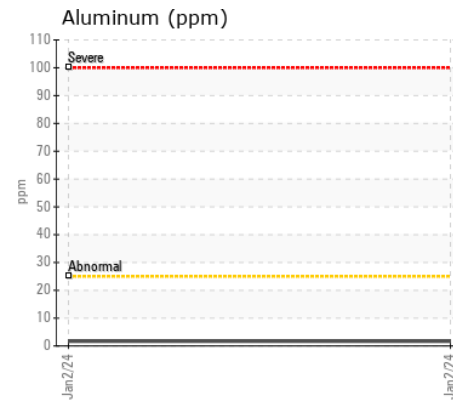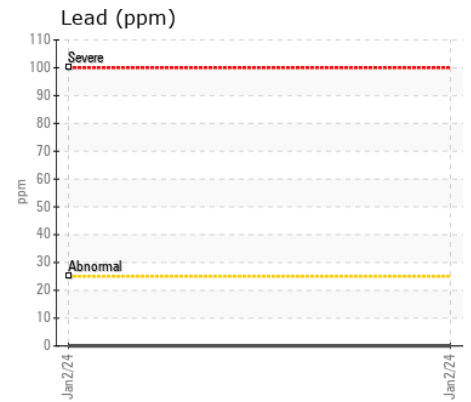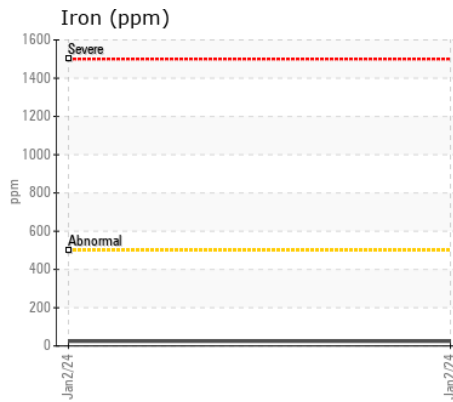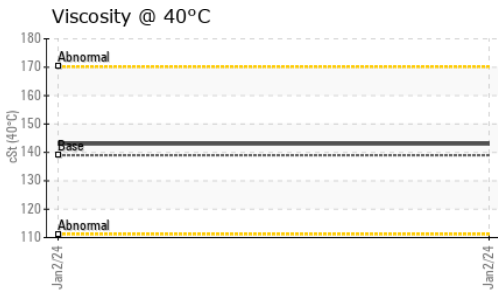

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP438014 **Recieved** : 18 Jan 2024
Lab Number : 06064603 **Diagnosed** : 21 Jan 2024
Unique Number : 10835985 **Diagnostician** : Don Baldrige
Test Package : MOB 1

GREEN MACHINE SERVICES LLC
 13 SPYROS DRIVE
 SOUTH AMBOY, NJ
 US 08879
 Contact: JOE GRZANKOWSKI
 JOE@GREENMSRV.COM
 T: (732)673-5920
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)