
WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**


Machine Id


CR-6609 - INNER


Component Rear Left Track Drive

GEAR OIL ISO 220 (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		WC0873308		
	Sample Date		Client Info		08 Jan 2024		
	Machine Age	hrs	Client Info		17421		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR			ACTM DE10Em	1000	00		
All component wear rates are normal.	Iron	ppm	ASTM D5185m		23		
	Chromium Nickel	ppm	ASTM D5185m		<1		
		ppm	ASTM D5185m ASTM D5185m	>1	0		
	Titanium Silver	ppm	ASTM D5185m		<1 0		
	Aluminum	ppm	ASTM D5185m	\25	2		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		7		
	Tin	ppm	ASTM D5185m		, <1		
	Vanadium	ppm	ASTM D5185m	//	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
			Vioudi				
CONTAMINATION	Silicon	ppm	ASTM D5185m	>150	<1		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
	Boron	ppm	ASTM D5185m	50	7		
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		0		
	Magnesium	ppm	ASTM D5185m	50	<1		
	Calcium	ppm	ASTM D5185m		<1		
	Phosphorus	ppm	ASTM D5185m	350	347		
	Zinc	ppm	ASTM D5185m		0		
	Sulfur	ppm	ASTM D5185m	12500	6360		
	Visc @ 40°C	cSt	ASTM D445	220	215		
Report Id: BLICGRA [WUSCAR] 06074201 (Generated: 01/31/2024 04:32:29) Rev: 1			Conta	ct/Locat	ion: MICHAF		I BLICGE.

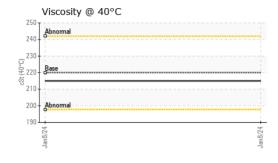

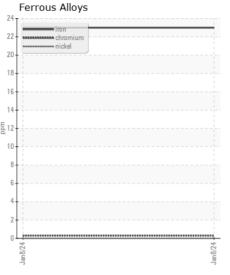

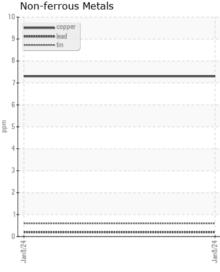

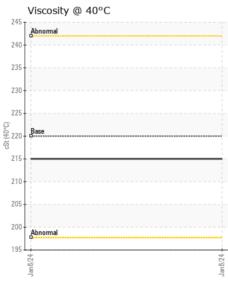



Certificate L2367

Laboratory Sample No. Lab Number

Unique Number : 10856292

: WC0873308 : 06074201 Test Package : CONST

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 30 Jan 2024 Diagnosed : 31 Jan 2024 Diagnostician : Wes Davis

BUCKNER HEAVY LIFT 4732 NC 54 EAST GRAHAM, NC US 27253-9215

Contact: MICHAEL LAWSON michaell@bucknercompanies.com T: (336)376-8888

Contact/Location: MICHAEL LAWSON - BUCGRA

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (336)376-4090