**WEAR** CONTAMINATION **FLUID CONDITION** 


**NORMAL NORMAL NORMAL** 


Machine Id


1640


Component Transmission (Auto)

TRANS CREST ( GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		WC0858184		
	Sample Date		Client Info		24 Jan 2024		
	Machine Age	hrs	Client Info		12064		
	Oil Age	hrs	Client Info		3300		
	Filter Age	hrs	Client Info		3300		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>160	51		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>5	0		
	Nickel	ppm	ASTM D5185m	>5	<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>5	0		
	Aluminum	ppm	ASTM D5185m	>50	19		
	Lead	ppm	ASTM D5185m	>50	4		
	Copper	ppm	ASTM D5185m	>225	17		
	Tin	ppm	ASTM D5185m	>10	2		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	4		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m		<1		
	Water	PPIII	WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	LIGHT		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	nnm	ASTM D5185m		4		
	Boron	ppm	ASTM D5185m		113		
The condition of the fluid is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		3		
	Calcium	ppm	ASTM D5185m		134		
	Phosphorus	ppm	ASTM D5185m		280		
	Zinc	ppm	ASTM D5185m		3		
	Sulfur	ppm	ASTM D5185m		1437		
	Visc @ 40°C	cSt	ASTM D445		34.9		

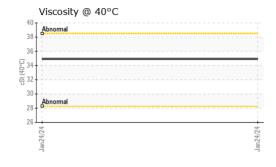

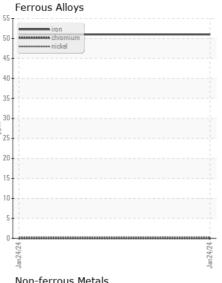

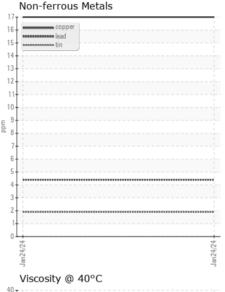

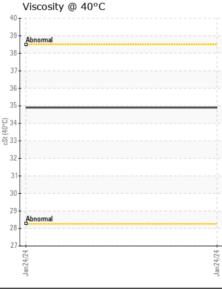



Certificate L2367

Laboratory Sample No. Lab Number

: WC0858184 : 06074250 Unique Number : 10856341

Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 30 Jan 2024 Diagnosed : 31 Jan 2024 Diagnostician : Don Baldridge

Apple Valley Waste - Hometown Location 155 Airport Road

Selinsgrove, PA US 17870

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: