



# VOLVO

## OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area  
**[GROUT]**  
Machine Id  
**VOLVO EC750EL 310059**  
Component  
**Front Axle**  
Fluid  
**VOLVO WET BRAKE TRANSAXLE OIL (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP433255	---	---
Sample Date		Client Info		29 Jan 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	46	---	---
Chromium	ppm	ASTM D5185m	>10	<1	---	---
Nickel	ppm	ASTM D5185m	>10	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>25	1	---	---
Lead	ppm	ASTM D5185m	>25	<1	---	---
Copper	ppm	ASTM D5185m	>50	0	---	---
Tin	ppm	ASTM D5185m	>10	<1	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	MODER	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>75	11	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Water		WC Method	>0.2	NEG	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		0	---	---
Boron	ppm	ASTM D5185m	100	5	---	---
Barium	ppm	ASTM D5185m	0	0	---	---
Molybdenum	ppm	ASTM D5185m	0	<1	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m	0	3	---	---
Calcium	ppm	ASTM D5185m	3800	3248	---	---
Phosphorus	ppm	ASTM D5185m	1200	1125	---	---
Zinc	ppm	ASTM D5185m	1500	1459	---	---
Sulfur	ppm	ASTM D5185m	6500	4587	---	---
Visc @ 40°C	cSt	ASTM D445	52.0	41.6	---	---

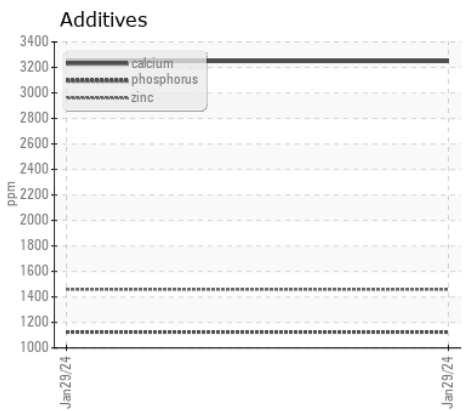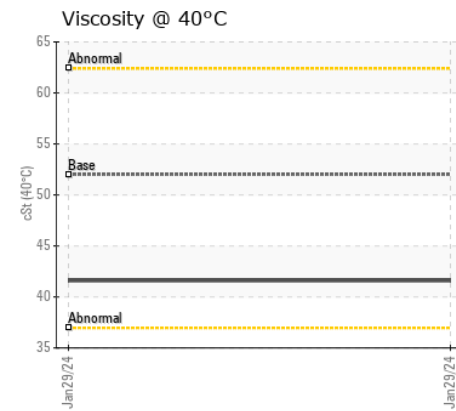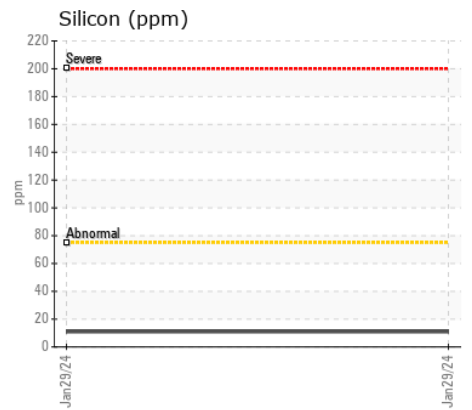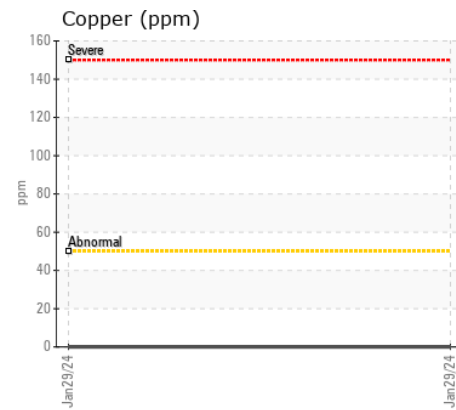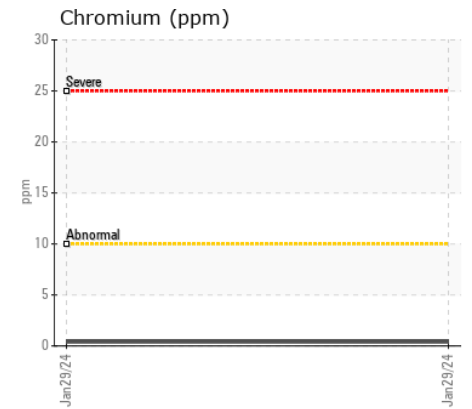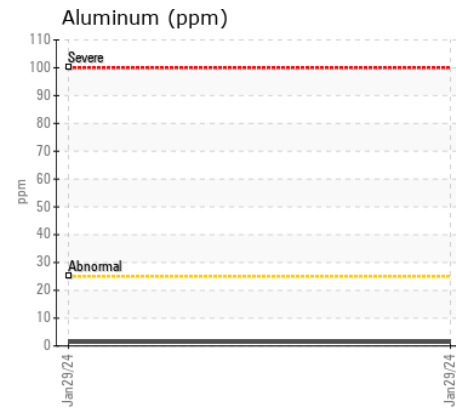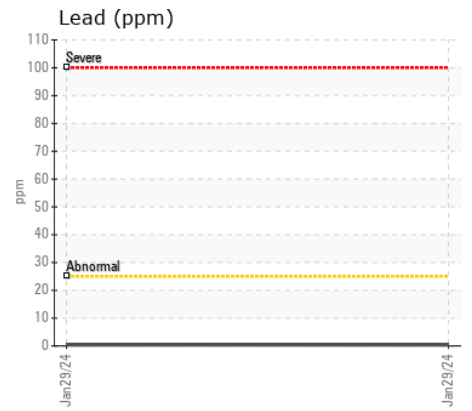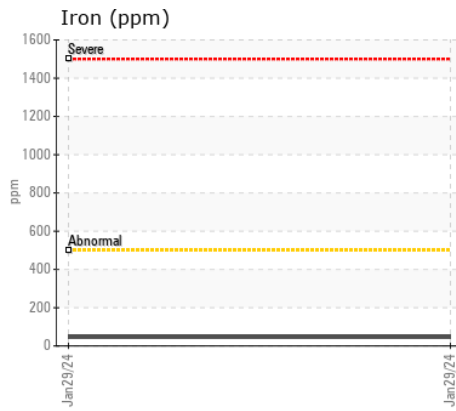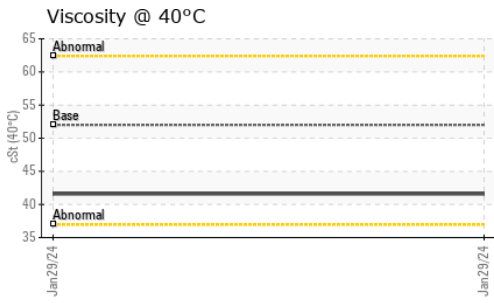

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP433255 **Received** : 30 Jan 2024  
**Lab Number** : 06075206 **Diagnosed** : 31 Jan 2024  
**Unique Number** : 10857297 **Diagnostician** : Wes Davis  
**Test Package** : MOBCE

**ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC**  
 9601 BOGGY CREEK RD  
 ORLANDO, FL  
 US 32824  
 Contact: Robert LaPlante  
 robert.laplante@altg.com  
 T: (407)508-9736  
 F: (407)659-8720

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)