



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
[0330 WM]
Machine Id
VOLVO L90H 624438
Component
Rear Axle
Fluid
VOLVO WB 102 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP437653	VCP431529	VCP432310
Sample Date		Client Info		26 Jan 2024	15 Dec 2023	27 Oct 2023
Machine Age	hrs	Client Info		13382	12918	12363
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changed	Changed	Not Changed
Filter Changed		Client Info		Not Changed	Not Changed	Not Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	33	90	61
Chromium	ppm	ASTM D5185m	>20	<1	<1	0
Nickel	ppm	ASTM D5185m	>10	<1	1	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>30	2	1	<1
Lead	ppm	ASTM D5185m	>50	0	1	0
Copper	ppm	ASTM D5185m	>120	1	4	2
Tin	ppm	ASTM D5185m	>20	0	0	0
Vanadium	ppm	ASTM D5185m		0	<1	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	10	12	11
Potassium	ppm	ASTM D5185m	>20	1	0	0
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		0	0	0
Boron	ppm	ASTM D5185m		124	134	149
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		4	5	3
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		39	18	31
Calcium	ppm	ASTM D5185m		3652	3474	3587
Phosphorus	ppm	ASTM D5185m		1219	1100	1091
Zinc	ppm	ASTM D5185m		1553	1442	1472
Sulfur	ppm	ASTM D5185m		4136	3519	3474
Visc @ 40°C	cSt	ASTM D445	55	48.9	43.4	43.3

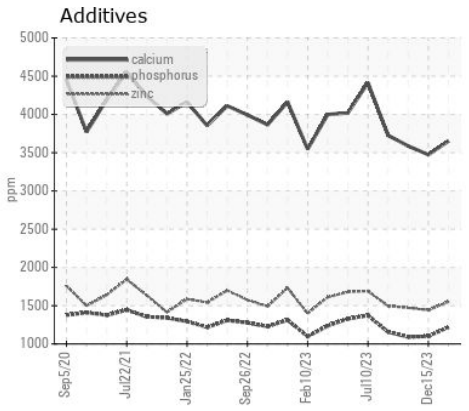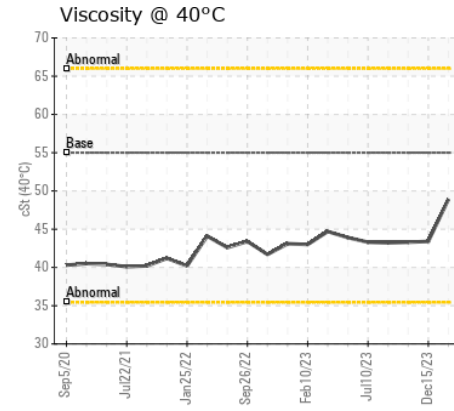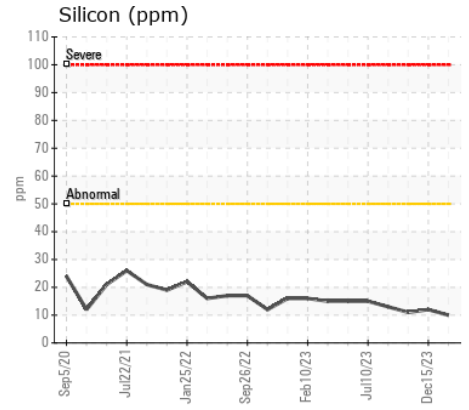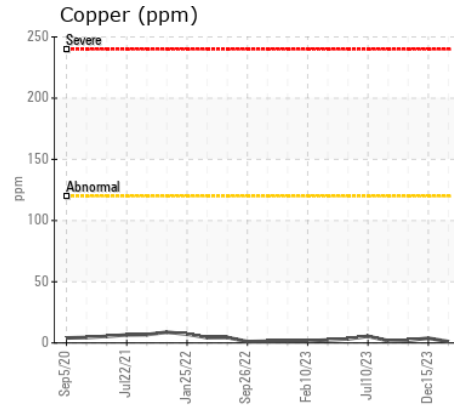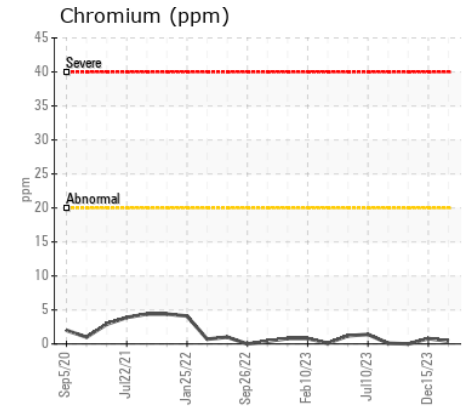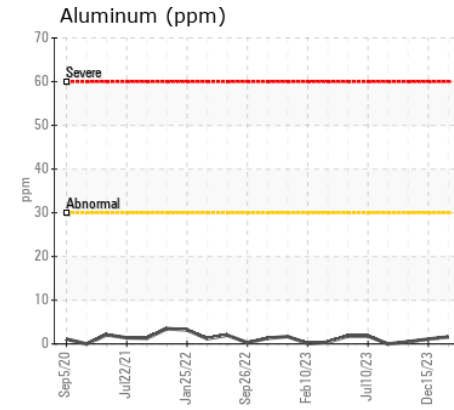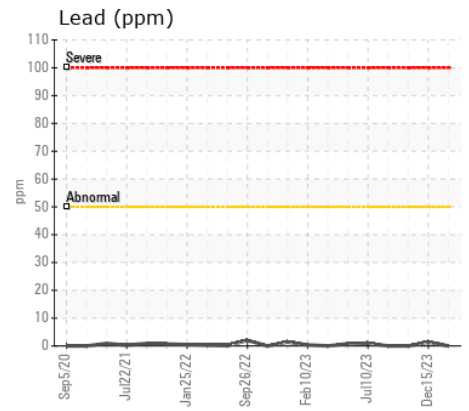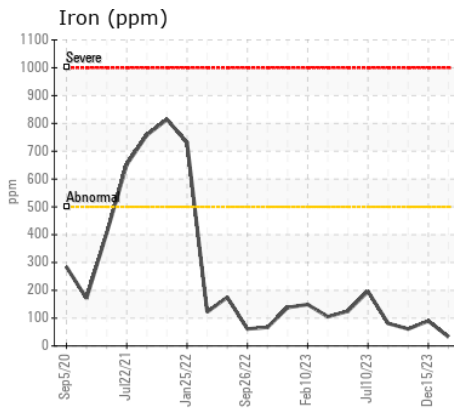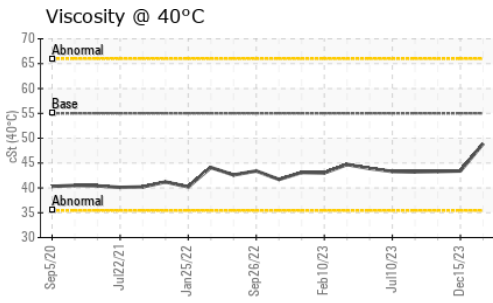

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP437653 **Received** : 01 Feb 2024
Lab Number : 06077208 **Diagnosed** : 02 Feb 2024
Unique Number : 10859299 **Diagnostician** : Wes Davis
Test Package : MOB 1

ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC
 9601 BOGGY CREEK RD
 ORLANDO, FL
 US 32824
 Contact: Robert LaPlante
 robert.laplante@altg.com
 T: (407)508-9736
 F: (407)659-8720

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)