


VOLVO A45G 436634

Component Diesel Engine

		· · · · · · · · · · · · · · · · · · ·	S-3 (G	·:- :- /			
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP442689		
	Sample Date		Client Info		07 Feb 2024		
	Machine Age	hrs	Client Info		4358		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	nnm	ASTM D5185m	× 100	9		
WEAN		ppm					
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m	>2	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		1		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		19		
	Tin	ppm	ASTM D5185m	>15	2		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	5		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	0		
	Fuel		WC Method	>6.0	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>3	0.6		
	Nitration	Abs/cm	*ASTM D7624	>20	8.0		
	Sulfation	Abs/.1mm	*ASTM D7415		22.3		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.2	NEG		
THE CONDITION							
FLUID CONDITION	Sodium	ppm	ASTM D5185m	0.5	4		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Boron	ppm	ASTM D5185m		32		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		49		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		493		
	Calcium	ppm	ASTM D5185m		1602		
	Phosphorus	ppm	ASTM D5185m		877		
	Zinc	ppm	ASTM D5185m		1043		
	Sulfur	ppm	ASTM D5185m		2702		
	Oxidation	Abs/.1mm	*ASTM D7414		19.3		
	Base Number (BN)	ma KOH/a	ASTM D2896	10	9.5		
	Baco Hambol (BH)	0 - 0					



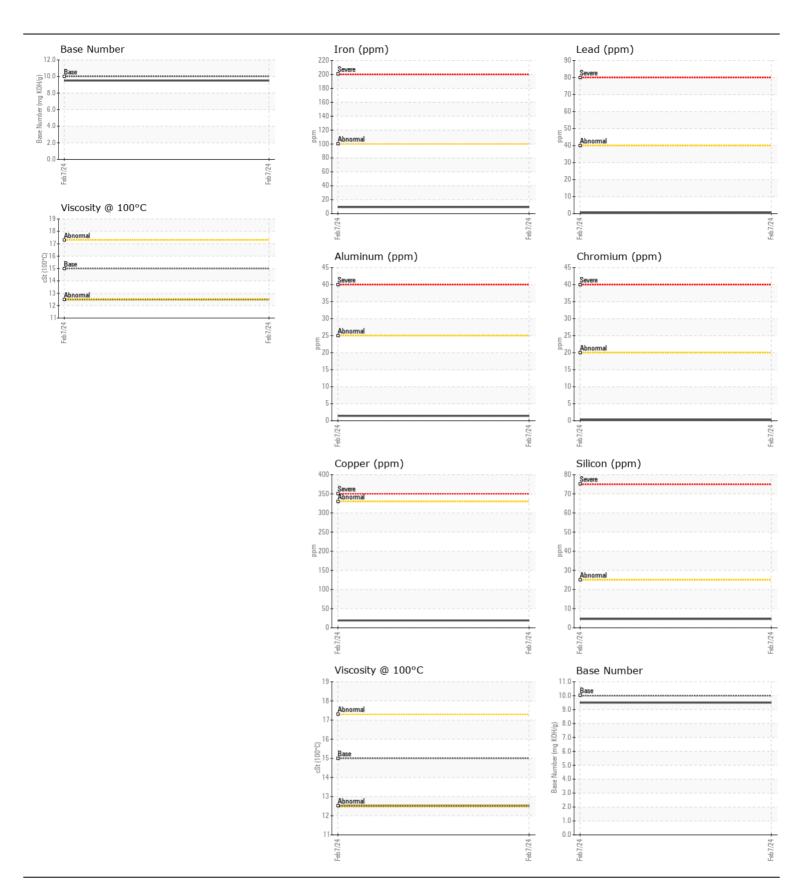



Report Id: VOLVO0090 [WUSCAR] 06083219 (Generated: 02/08/2024 19:10:17) Rev: 1

Laboratory

Sample No.

: VCP442689 Lab Number : 06083219

Unique Number : 10870664

Test Package : MOB 1 (Additional Tests: TBN)

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 08 Feb 2024 : 08 Feb 2024 **Tested** Diagnosed

: 08 Feb 2024 - Wes Davis

5151 DR MARTIN LUTHER KING BLVD FORT MYERS, FL

ALTA EQUIPMENT COMPANY

US 33905 Contact: TODD LARK tlark@altaequipfl.com

F: (239)481-3302

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: TODD LARK - VOLVO0090

T: