



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[CITRUS CITY]**  
Machine Id  
**VOLVO L110H 632401**  
Component  
**Diesel Engine**  
Fluid  
**VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP431748</b>	VCP433370	VCP420930
Sample Date		Client Info		<b>07 Feb 2024</b>	18 Oct 2023	26 Jul 2023
Machine Age	hrs	Client Info		<b>3072</b>	2627	2194
Oil Age	hrs	Client Info		<b>0</b>	500	500
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>10</b>	11	16
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Silver	ppm	ASTM D5185m	>2	<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185m	>10	<b>6</b>	6	8
Lead	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	1
Copper	ppm	ASTM D5185m	>15	<b>3</b>	3	3
Tin	ppm	ASTM D5185m	>10	<b>1</b>	<1	2
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>20	<b>5</b>	5	6
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	3	2
Fuel		WC Method	>6.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.3</b>	0.4	0.5
Nitration	Abs/cm	*ASTM D7624	>20	<b>7.0</b>	6.9	7.1
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>21.6</b>	21.5	21.3
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>0</b>	1	2
Boron	ppm	ASTM D5185m	2.5	<b>40</b>	38	30
Barium	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	7	0
Molybdenum	ppm	ASTM D5185m	0.7	<b>36</b>	46	43
Manganese	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	0	<1
Magnesium	ppm	ASTM D5185m	256	<b>448</b>	485	530
Calcium	ppm	ASTM D5185m	2057	<b>1761</b>	1607	1703
Phosphorus	ppm	ASTM D5185m	935	<b>971</b>	923	969
Zinc	ppm	ASTM D5185m	1223	<b>1100</b>	1101	1190
Sulfur	ppm	ASTM D5185m	4079	<b>3250</b>	3473	3687
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>19.6</b>	19.4	19.4
Base Number (BN)	mg KOH/g	ASTM D2896	10	<b>10.5</b>	10.0	9.9
Visc @ 100°C	cSt	ASTM D445	15.0	<b>13.0</b>	12.9	13.1

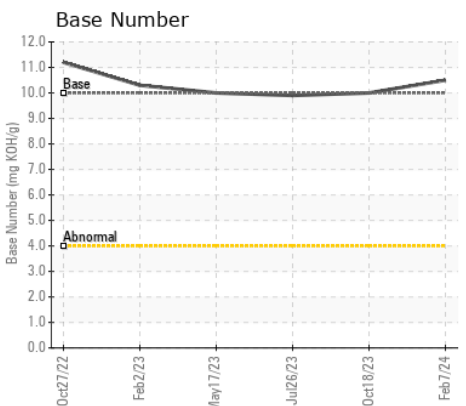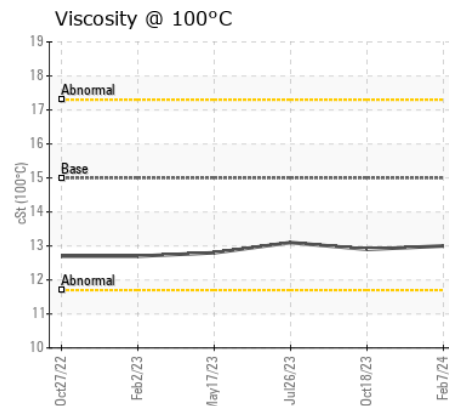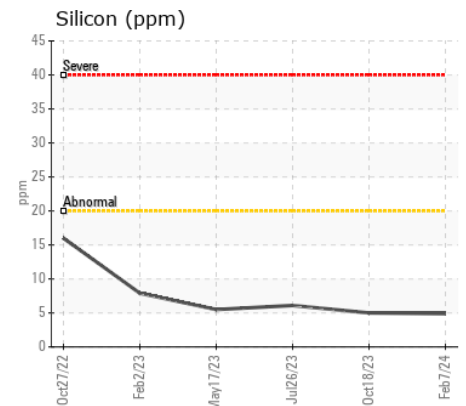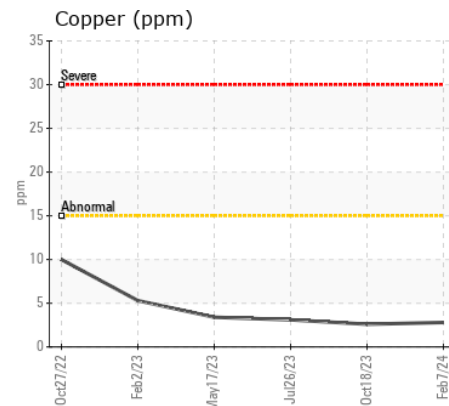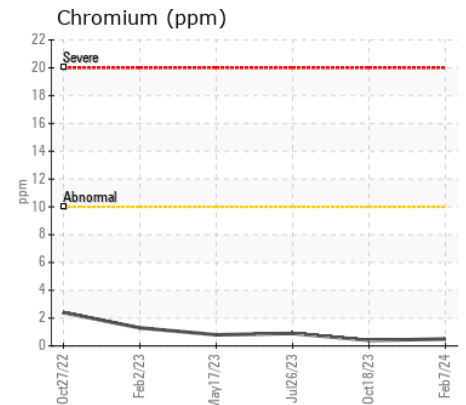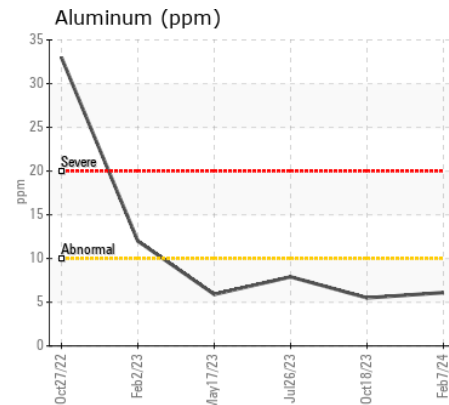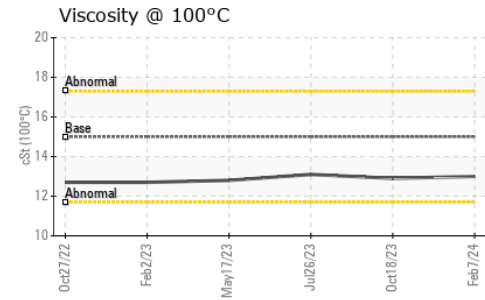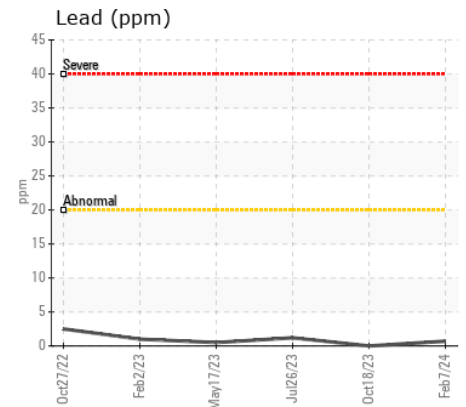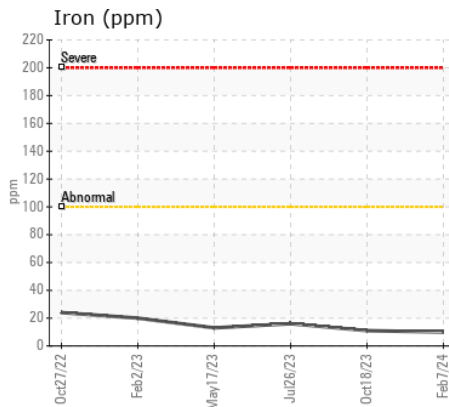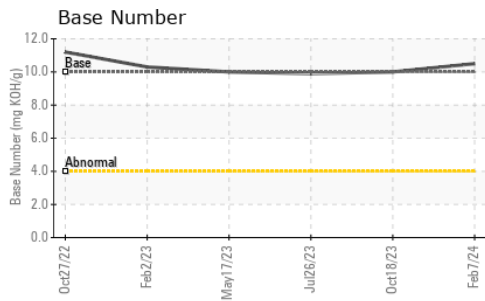

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP431748 **Received** : 08 Feb 2024  
**Lab Number** : 06083318 **Tested** : 08 Feb 2024  
**Unique Number** : 10870763 **Diagnosed** : 08 Feb 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: TBN )

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC  
 8418 PALM RIVER ROAD  
 TAMPA, FL  
 US 33619  
 Contact: KENNY HANEY  
 khaney@flaglerce.com  
 T: (813)630-0077  
 F: (813)630-2233

Certificate L2367  
 To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)