

## WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

## Area [HERC RENTALS] Machine Id VOLVO L70H 624421

Component Diesel Engine

DIESEL ENGINE OIL SAE 40 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DIESEL ENGINE OIL SAE 40. Please confirm.	Sample Number		Client Info		VCP435947		
	Sample Date		Client Info		30 Nov 2023		
	Machine Age	hrs	Client Info		718		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed	1110	Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR Metal levels are typical for a new component breaking in.	Iron	ppm	ASTM D5185m	>100	4		
	Chromium	ppm	ASTM D5185m	>10	<1		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m	>2	0		
	Aluminum	ppm	ASTM D5185m	>10	7		
	Lead	ppm	ASTM D5185m	>20	<1		
	Copper	ppm	ASTM D5185m	>15	<1		
	Tin	ppm	ASTM D5185m	>10	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon		ASTM D5185m	. 20	4		
CONTAMINATION	Potassium	ppm ppm	ASTM D5185m		2		
There is no indication of any contamination in the oil.	Fuel	ppm	WC Method		<1.0		
	Water		WC Method		NEG		
	Glycol		WC Method	20.1	NEG		
	Soot %	%	*ASTM D7844	>3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	5.4		
	Sulfation	Abs/.1mm	*ASTM D7415		19.2		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Boron	ppm	ASTM D5185m		362		
	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m	100	85		
	Manganese	ppm	ASTM D5185m	450	<1		
	Magnesium	ppm	ASTM D5185m		350		
	Calcium	ppm	ASTM D5185m	3000	1297		
	Phosphorus	ppm	ASTM D5185m		903		
	Zinc	ppm	ASTM D5185m		1159		
	Sulfur	ppm	ASTM D5185m		3012		
	Oxidation	ADS/.1mm	*ASTM D7414	>25	13.3		


Base Number (BN) mg KOH/g ASTM D2896 8.5


ASTM D445 14.4

Visc @ 100°C cSt

7.8

13.0

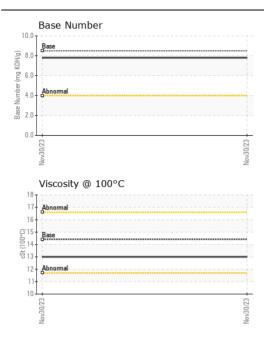

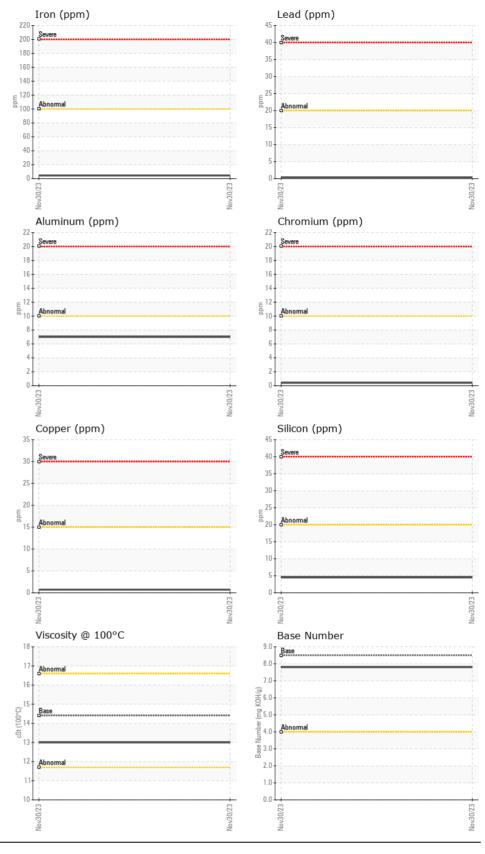

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : VCP435947 Received 8418 PALM RIVER ROAD :08 Feb 2024 Lab Number : 06083331 Tested :08 Feb 2024 TAMPA, FL Unique Number : 10870776 : 08 Feb 2024 - Wes Davis US 33619 Diagnosed Test Package : MOB 1 (Additional Tests: TBN) Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

23