

WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL



[HERC RENTALS] Machine Id VOLVO L70H 624598

Component Rear Axle

TRANSAXLE OIL SAE 75W80	(GAL)						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) TRANSAXLE OIL SAE 75W80. Please confirm.	Sample Number		Client Info		VCP454401		
	Sample Date		Client Info		26 Jan 2024		
	Machine Age	hrs	Client Info		2796		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>900	86		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		4		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m	,	0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	<1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m	>150	18		
	Tin	ppm	ASTM D5185m		2		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	12		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	<1		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		10		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	160	132		
	Barium	ppm	ASTM D5185m	10	<1		
	Molybdenum	ppm	ASTM D5185m	25	2		
	Manganese	ppm	ASTM D5185m		10		
	Magnesium	ppm	ASTM D5185m	12	13		
	Calcium	ppm	ASTM D5185m	3750	3763		
	Phosphorus	ppm	ASTM D5185m	1200	1362		
	Zinc	ppm	ASTM D5185m	1500	1570		
	Sulfur	ppm	ASTM D5185m	6000	4108		
	Visc @ 40°C	cSt	ASTM D445	48	40.6		

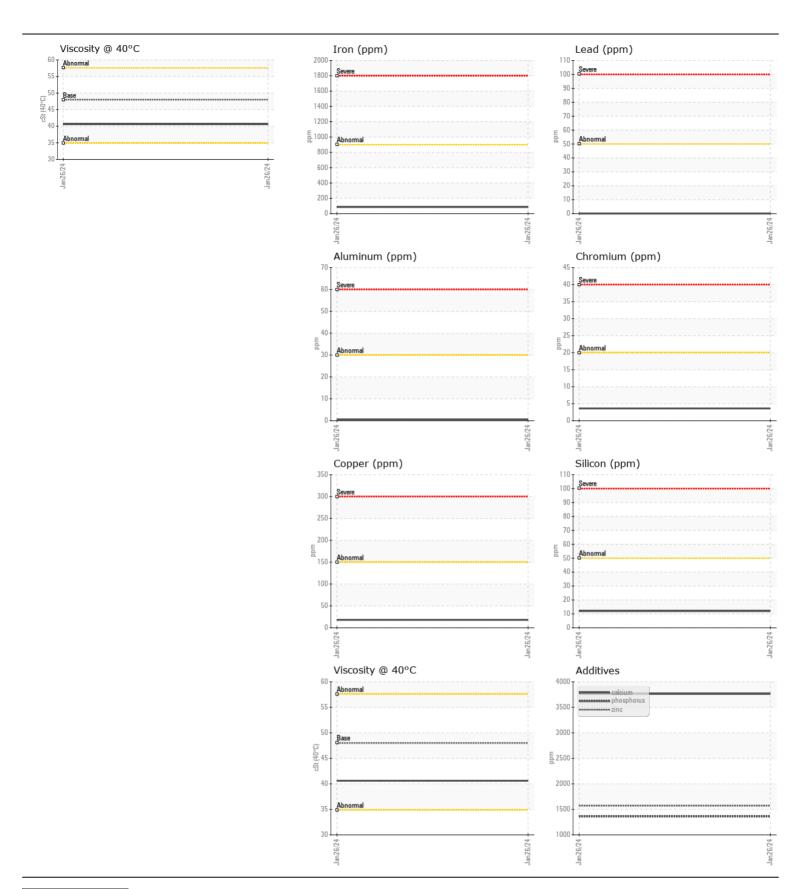



Certificate L2367

Report Id: VOLVO0093 [WUSCAR] 06083947 (Generated: 02/09/2024 17:57:06) Rev: 1

Laboratory Sample No.

Lab Number : 06083947 Unique Number : 10871392

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : VCP454401

Received **Tested** Test Package : MOB 1

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: 08 Feb 2024 : 09 Feb 2024 Diagnosed

: 09 Feb 2024 - Wes Davis

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD TAMPA, FL

US 33619 Contact: KENNY HANEY

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

Contact/Location: KENNY HANEY - VOLVO0093