



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
VOLVO L110H 631231
Component
Rear Axle
Fluid
VOLVO WB 102 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP432300	VCP420254	VCP359719
Sample Date		Client Info		08 Nov 2023	28 Apr 2023	15 Sep 2022
Machine Age	hrs	Client Info		12029	10851	9792
Oil Age	hrs	Client Info		0	2000	1700
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changed	Changed	Not Changed
Filter Changed		Client Info		Not Changed	Changed	Not Changed
Sample Status				NORMAL	ABNORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	25	▲ 1174	78
Chromium	ppm	ASTM D5185m	>20	<1	13	2
Nickel	ppm	ASTM D5185m	>10	0	8	1
Titanium	ppm	ASTM D5185m		0	<1	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>30	<1	7	3
Lead	ppm	ASTM D5185m	>50	0	<1	<1
Copper	ppm	ASTM D5185m	>120	0	2	<1
Tin	ppm	ASTM D5185m	>20	<1	0	<1
Vanadium	ppm	ASTM D5185m		0	<1	1
White Metal	scalar	*Visual	NONE	NONE	NONE	MODER
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	11	▲ 213	16
Potassium	ppm	ASTM D5185m	>20	0	1	0
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<1	1	7
Boron	ppm	ASTM D5185m		133	140	120
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		0	2	2
Manganese	ppm	ASTM D5185m		1	8	3
Magnesium	ppm	ASTM D5185m		21	15	13
Calcium	ppm	ASTM D5185m		3763	4013	3980
Phosphorus	ppm	ASTM D5185m		1342	1230	1257
Zinc	ppm	ASTM D5185m		1522	1575	1527
Sulfur	ppm	ASTM D5185m		4022	5416	4223
Visc @ 40°C	cSt	ASTM D445	55	43.7	47.4	43.9

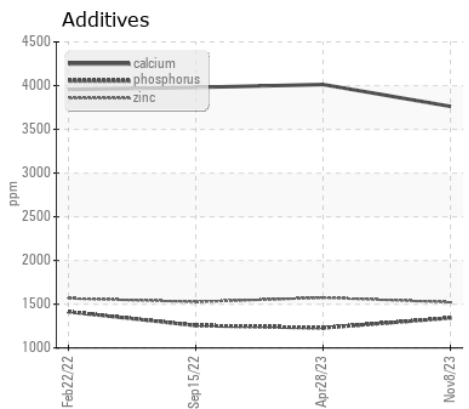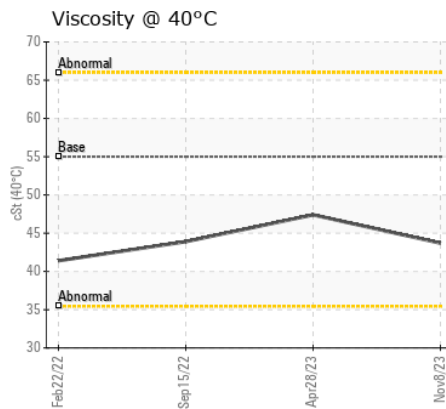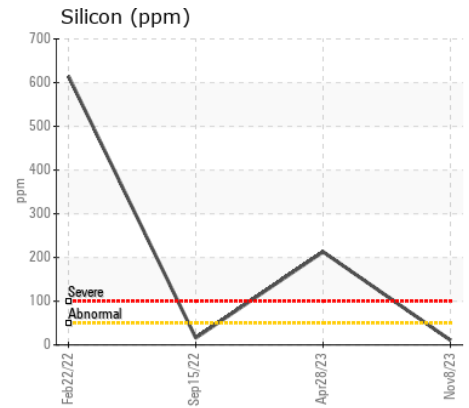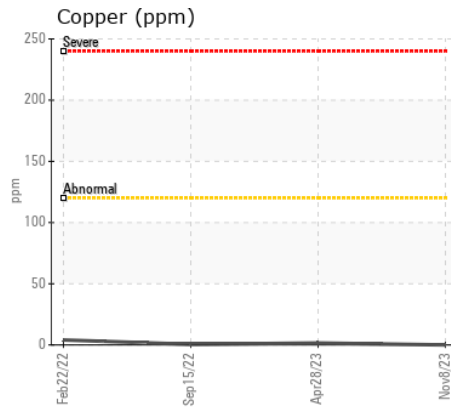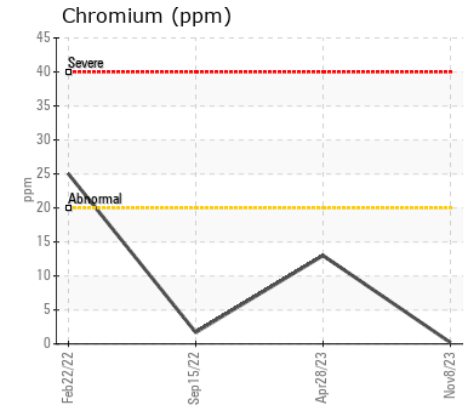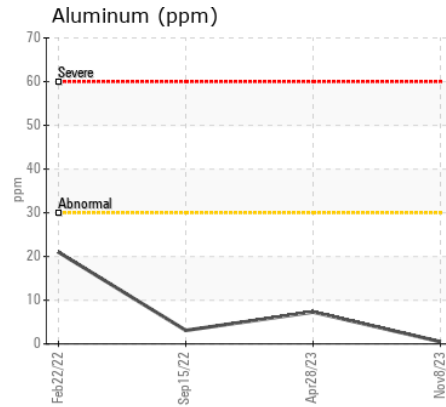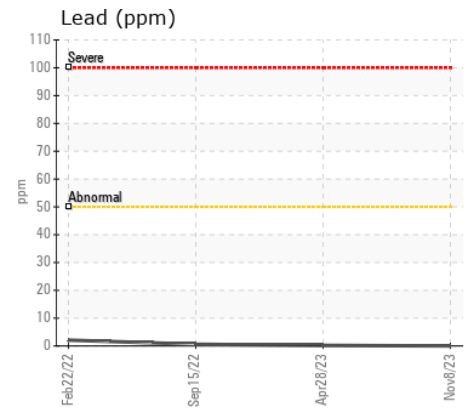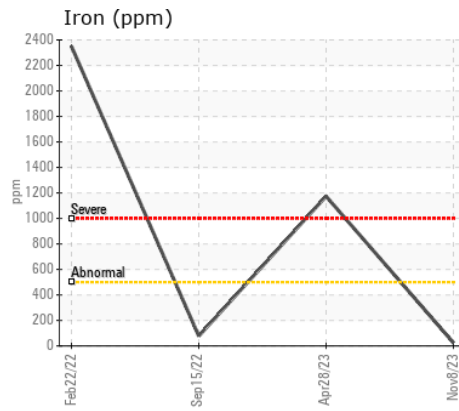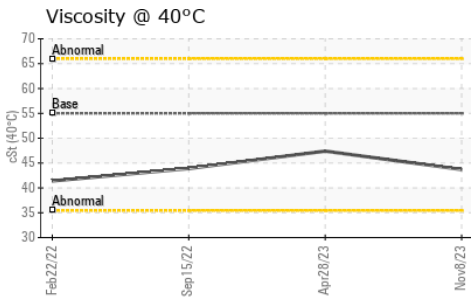

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP432300
Lab Number : 06083952
Unique Number : 10871397
Test Package : MOB 1

Received : 08 Feb 2024
Tested : 09 Feb 2024
Diagnosed : 09 Feb 2024 - Wes Davis

RIPA AND ASSOCIATES
 10149 FISHER AVENUE
 TAMPA, FL
 US 33619

Contact: PM Services
 PMServices@ripaconstruction.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
 F: