



RECOMMENDATION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the fluid.

FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

				· · · · ·		
Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP432095		
Sample Date		Client Info		30 Nov 2023		
Machine Age	hrs	Client Info		718		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Filter Changed		Client Info		Not Changd		
Sample Status				NORMAL		
Iron	ppm	ASTM D5185m	>160	91		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m	>5	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>5	0		
Aluminum	ppm	ASTM D5185m	>50	<1		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>225	5		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>20	10		
Potassium	ppm	ASTM D5185m	>20	0		
Water		WC Method	>0.1	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Sodium	ppm	ASTM D5185m		3		
Boron	ppm	ASTM D5185m		70		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		9		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		75		
Phosphorus	ppm	ASTM D5185m		201		
Zinc	ppm	ASTM D5185m		46		

ASTM D5185m

ASTM D445 35.0

ppm

cSt

WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL


Sulfur


Visc @ 40°C

Contact/Location: KENNY HANEY - VOLVO0093

1521

28.5

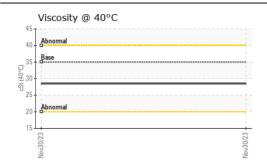

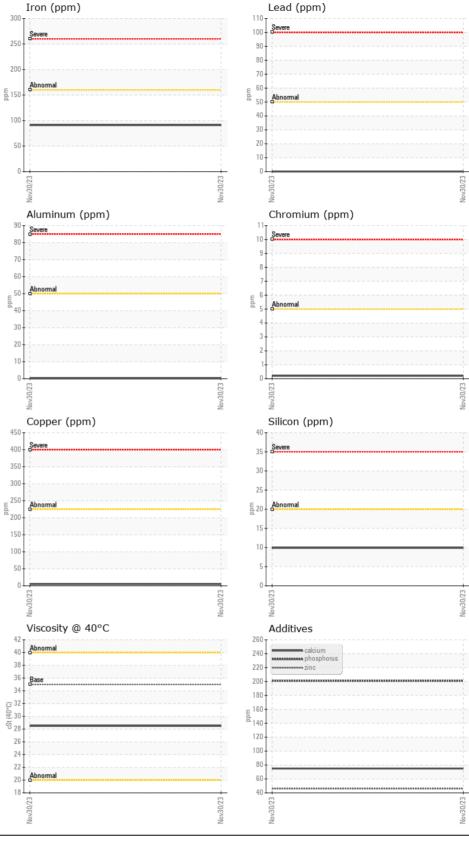

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP432095 :08 Feb 2024 Lab Number : 06084025 TAMPA, FL Tested :11 Feb 2024 Unique Number : 10871470 : 11 Feb 2024 - Don Baldridge US 33619 Diagnosed Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

Contact/Location: KENNY HANEY - VOLVO0093