

WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL



## VOLVO L110H 632644

Component
Transmission (Auto)
Fluid

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP431787		
	Sample Date		Client Info		04 Dec 2023		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>160	52		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>5	<1		
	Nickel	ppm	ASTM D5185m	>5	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>5	0		
	Aluminum	ppm	ASTM D5185m	>50	<1		
	Lead	ppm	ASTM D5185m	>50	0		
	Copper	ppm	ASTM D5185m	>225	4		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	7		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m	>20	0		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
·	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		3		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		82		
	Barium	ppm	ASTM D5185m		4		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		5		
	Magnesium	ppm	ASTM D5185m		0		
	Calcium	ppm	ASTM D5185m		63		
	Phosphorus	ppm	ASTM D5185m		195		
	Zinc	ppm	ASTM D5185m		9		
	Sulfur	ppm	ASTM D5185m		1634		
	Visc @ 40°C	cSt	ASTM D445	35.0	28.4		

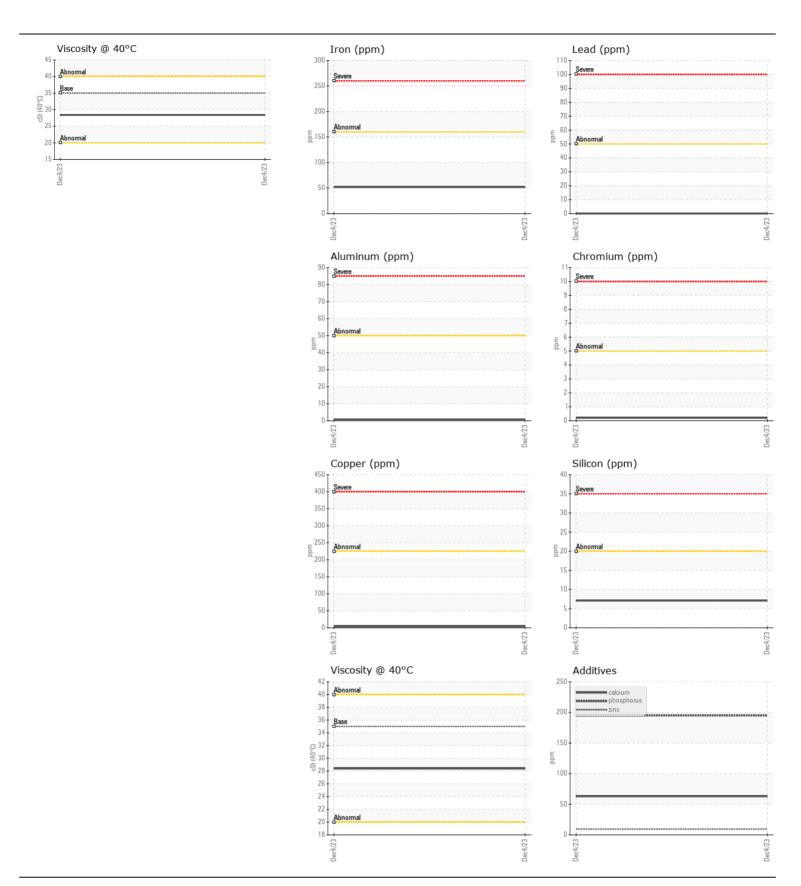



Certificate L2367

Laboratory Sample No.

: VCP431787 Lab Number : 06084027 Unique Number : 10871472 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 08 Feb 2024 : 11 Feb 2024 **Tested** 

: 11 Feb 2024 - Don Baldridge Diagnosed

**COVANTA** 350 FLAKENBURG ROAD TAMPA, FL US 33619

Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (813)684-5688 F: